



NISSAN 350Z 2002-2006, ALTIMA 2002-2006, MAXIMA 2002-2006, SENTRA 2007-2012, FRONTIER 2002-2012, MURANO 2004-2006, PATHFINDER 2002-2008, QUEST 2003-2006, TITAN 2002-2012, X-TERRA 2002-2012, INFINITI G35 2003-2005, I35 2002-2004, FX35/45 2003-2007, QX4 2002-2003

**ALL KEY FOBs MUST BE PRESENT AND REPROGRAMMED WHEN PROGRAMMING NEW FOBs.**

1. Close and lock all doors with the driver's side power lock/unlock switch.
2. Insert key into ignition and remove it from the ignition key cylinder at least six times within 10 seconds. Your Hazard Lamps will flash if you performed this step successfully. NOTE: Withdraw key completely from ignition cylinder each time. If this procedure is performed too fast, the system will not enter programming mode.
3. Insert key into the ignition cylinder and turn to the ACC position.
4. Within 5 seconds, push ANY button on the remote transmitter. Your Hazard Lamps should flash. NOTE: Do not press the button more than one time in the above step. If the button is pressed more than one time, the programming procedure will not be successful.
5. If there are any remaining transmitters (including the old ones), unlock then lock all doors using the driver's side power lock/unlock switch and within 5 seconds, push ANY button on the next remote. Your Hazard Lamps should flash. Repeat this step for each transmitter (including any existing transmitters).
6. Turn the key to the OFF position, remove keys from the ignition, unlock doors using the driver's side power lock/unlock switch and open the driver side door.
7. Test remote (s).