


DC MOTOR/DSR-80 Series

Maintenance Manual

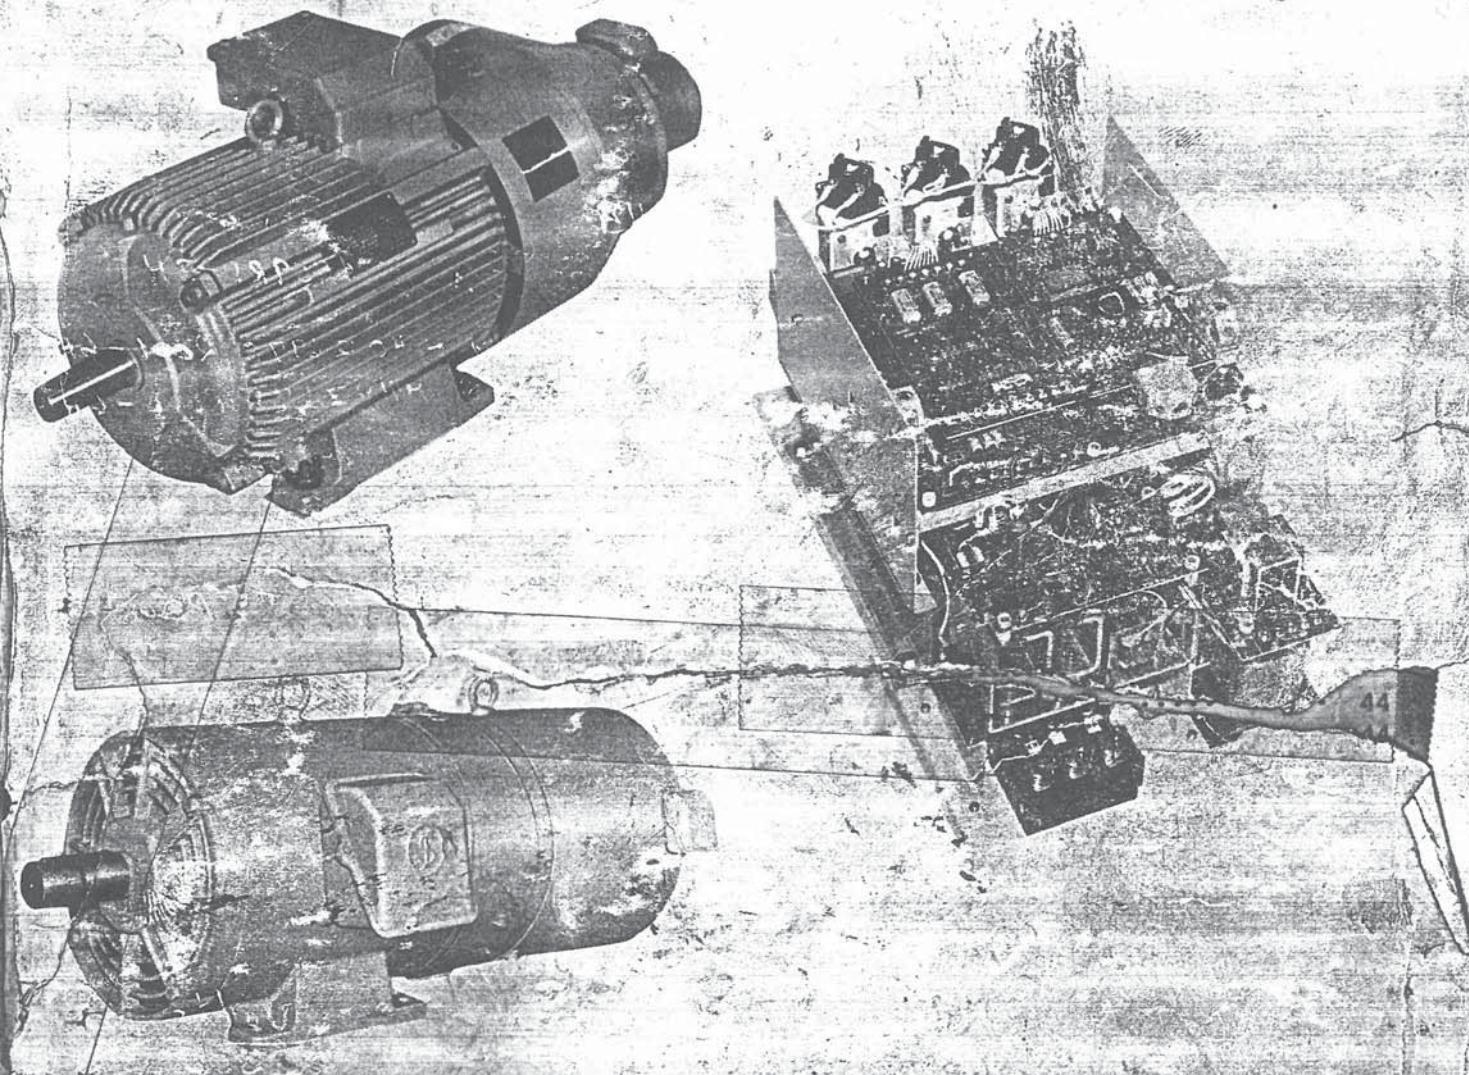

Fuji Electric Co.,Ltd.
FUji ELMES CO.,Ltd.

201-288-4422
 FAY 201 288 - 4496
 Elmes & OESS Service Inc
 800 Huyler St.
 Teterboro, N.J. 07608
 FAY # 201-288-4496

Motor Shop

Bresilker Electric Motors
 352 Roosevelt Road
 Glen Ellyn, ILL 60137
 630-469-7510
 800 - 922 - 1882

Model S/N

LL-7 154

LL-7 150.

SL-6 6T

SL-6 11T

L-3

L-5 10T

1-5

Type

FSD - 55 - DN 44

FSD - 55 - DN 43

FSD - 37 DN 33

FSD - 37 DN 35

S/N C26959R1-3H

S/N HH26978 R001-6H

S/N HHV26978 R001-6H

FSD - 30 DN 33

S/N HHG76955 R001-3H

del	Control	motor Model#	Output	Amp	Volt's
1-6	6T	GHP-6205	30KW, 37KW	111	300
5	6T	GHP 6187A	30KW, 22KW	92	
6	11T	GHP 6205A	30KW, 37KW	111/137	300
7 Both	6T	GGN - 3208A S/N M1101613415	30KW, 37KW	118/146	290

630-993-1635

71 OESS Corp

497 W. Wrightwood

Elmhurst, ILL

Calif 60126

*Ph. 714-220-1878

Fax 714-220-1870

CONTENTS

	Page
I. Preface	1
II. Attention in Adjusting and Checking	1
III. FSD-D Type Unit	2
1. Structure	2
1-1 Thyristor stuck	2
1-2 SREG. printed circuit board	2
(Speed Current Regulator P.C.B.)	2
1-3 Field Regulator (FREG-10C, FREG-10E, FREG-10D)	3
1-4 Pulse trans. printed circuit board	3
1-5 Auxiliary transformer for control power source and AVR	4
1-6 Current transformer	4
1-7 Fuse	4
2. Photo	6
3. Drawing	22
4. Adjusting and Maintenance	40
4-1 Confirmation of outer circuits	40
4-2 Confirmation of preparation for motors	40
4-3 Confirmations of capacities and voltage of power supply	41
4-4 Confirmations of phase rotation and frequency	41
4-5 Others	42
4-6 Confirmation before motor operation	42
4-6-1 Preparation	42
4-6-2 Power acceptance	42
4-6-3 Confirmation of regulating voltage from printed circuit boards	44
4-6-4 Confirmation of sequences	44
4-6-5 Confirmation of field current of motor and specifications	47
4-6-6 Checks of voltage polarities of motor and tacho generators	49
4-6-7 Confirmation of input voltage of speed setting	49
4-6-8 Confirmation of basic actions of printed circuit board	50
4-6-9 Recoveries	51
4-7 Motor operating	51
4-7-1 Conf. of motor rotating direction	51
4-7-2 Conf. of Max. speed of motor	51
4-7-3 Conf. of speed meter	52
4-7-4 Conf. of motor terminal voltage	52
4-7-5 Conf. of current limitation and of IR compensation	52
4-7-6 Conf. of system response	53
4-7-7 Others	53
4-8 Voltage figures of check pins	54
4-9 Adjusting resistance volumes and lists for the usages	58
4-10 Voltage wave form of each point	59
5. Trouble shooting	67
6. Alarm	68

IV. DC MOTOR	72
1. Structure	73
1-1 Open type motor	73
1-2 Close type motor	74
2. Out Line	75
2-1 Open type motor	75
2-2 Close type motor	76
3. Fan, Brush, Brushholder Application	78
4. Instruction of Motor (open and close)	82
4-1 General	82
4-2 Conforming the Product	82
4-3 Installation	83
4-4 Electrical connection	84
4-5 Precaution to be Effected Prior to Operation	84
4-6 Inspection and Maintenance	84
4-7 Maintenance Procedures for Brushes and Commutator	86
5. Inspection and Maintenance of Tacho-Generator	90
5-1 Monthly Inspection	90
5-2 half-yearly Inspection and Cleaning	90
5-3 Phenomena, cause by tachogenerator defects	90
5-4 Replacing of Brushes	91
6. Motor Application in Case of Hard Duty Cycle Operation	92
6-1 Limit	92
6-2 Inspection and Maintenance	93
7. Disassembling and Reassembling	94
7-1 Open type motor	94
7-2 Close type motor	97

I. Preface

This maintenance manual is Guide book for finding out trouble and checking equipment (DSR-80 Type Unit, DC Motor). After finishing installation, wiring of electrical appliances. Our products are inspected completely before shipping out from our factory.

The following 3 items should be examined by each machine tool builder because final confirmation is impossible without combination of motor and machine. But if trouble happen, please confirm and adjust. It is should on the forth item in this manual how to adjust.

- (1) Adjustment of the motor max speed.
(To compensate each deflections of T.G. generating voltage.)
- (2) Adjustment of the speed meter.
(To adjust deflection of meter)
- (3) Adjustment of system response
(To adjust PI setting to optimum on combination with machines)

II. Notes for adjusting and maintain

1. Only trained electrical and electronics personal should maintain this equipment.
2. When working on or near the equipment with power voltage applied, it is recommended that all metal object such as rings, watches and tie clasps be removed.
3. It is highly recommended that all personal working on this equipment wear rubber soled shoes (insulated).
4. Do not insert or remove printed circuit board from the equipment while power is applied or operating.

III. FSD-D Type unit

1. Structure

We can find fuse, SREG. printed circuit board, auxiliary transformer, regulator, and field regulator on front view of driving convertor unit. On back side of SREG. P.C.B., there are mounted pulse trans printed circuit board and thyristor stack. Option P.C.B. sometimes mounted on SREG. P.C.B. when machine tool builder requested it.

1-1 Thyristor stack

Six module type thyristors are mounted to one piece of the aluminum cooling fins. The thyristor itself is molded, which enables a complete insulation from the fin.

NOTE: On large capacity convertor or 440 V power supply, module type thyristor is no used.

1-2 SREG. printed circuit board

Speed current REGulator printed circuit board is mounted on front side of driving unit base, and has IC logic, LED, lead relay, connector. When providing a control system for stopping at regular position, use an internally and partially modified P.C.B. Depending upon user's specifications, the P.C.B.s are also partially modified. In this case, the basic circuit remains unchanged.

No.	Item	Old type	New type 1	New type 2
1	Model No.	CDPB3CPS-62	CDPB3CPS-82 CDPB3CPS-82-0 (For Orientation)	CDPB3CPS-83 CDPB3CPS-83-0 (For Orientation)
2	Faults Prevented	<ul style="list-style-type: none"> ○ Starting failure, tacho-loss (SFL) ○ Over-speed (OSL) ○ Fuse blown (37FL) ○ Overcurrent in motor cooling fan (88L) ○ Motor overheat (PTC) 	<ul style="list-style-type: none"> ○ Starting failure (functions are improved) ○ Over-Speed ○ Fuse blown ○ Overcurrent in motor cooling fan ○ Motor overheat ○ Motor overcurrent (OCL) 	Same as New type 1
3	Interchangeability	Old type, New type 1, New type 2, Each board is replaceable.		
4	TG feedback circuit control range extended.	24.7 to 43.2 V 46.7 to 95.4 V Discontinuous	11 to 91 V Continuously Controllable	Same as New type 1

No.	Item	Old type	New type 1	New type 2
5	Fault terminals	None	Added	Added
6	Contact capacity of fault detecting relay increased.	Resistor load DC24V Max. 0.5A	Resistor load o DC 24V, MAX. 0.5A o AC 250V, MAX. 7.5A Block terminals are extended in parallel with conventional connector terminal CN1.	Same as New type 1.
7	P and N ($\pm 15V$) power pull-out terminal.	None	Added (load capacity: $\pm 50mA$)	Same as New type 1.
8	Coupling for pulse shift P.C.B. with power failure P.C.B.	None	Jumping wire A18, A19, E10	Short pin SCl.

1-3 Field regulator (FREG-10C) (FREG-10E) (FREG-10D)

There are control printed circuit board on upper side, and diode, thyristor and auxiliary power trans are mounted under side of FREG unit. Adjusting cap for 50 Hz/60 Hz change, rheostat VR₁ ~ VR₅, IC, transistor and pulse transformer are arranged on control P.C.B.
(However, FREG-10D has no 50/60 Hz change-over cap.)
For characteristic differences, refer to the previous item.

1-4 Pulse trans. printed circuit board

Difference between pulse trans. P.C.B. for 220V power supply and 440V are shown in photo <p-7> ~ <p-10>. This P.C.B. has twelve pulse transformers, resistors and capacitors, etc.

Besides, the 200V pulse transformer P.C.B.s are available in new (2 kinds) or old (2 kinds) types, each having the following differences.

No.	Item	Old type	New type	
1	Model No.	CDPD3ZPA-11 and -12	CDPD3ZPA-13	CDPD3ZPA-14
2	Mechanism for preventing gate connector from coming out	None	Included	Included
3	Protective circuit against power failure	None	None	Included
Interchangeability				

1-5 Auxiliary transformer for control power source and AVR

Control power source ($\pm 15V$, $+24V$) is produced, first by dropping 3ϕ , 200/220V with auxiliary transformer, and then necessary power source is available with constant voltage device after its rectification. AVR is equipped on the transformer.

The specifications for each component of the power source unit are as follows:

* Three-phase auxiliary transformer

Capacity	; 25VA
Primary voltage	; $210V \pm 15\%$
Secondary voltage, current ;	
$U_1 - V_1 - W_1$	17.8V (650mA) between the cables
$U_2 - V_2 - W_2$	17.8V (80mA) between the cables
$U_3 - V_3 - W_3$	7V (50mA) between the cables

Power source regulator

Type : EHD ~ RD 3153PA	
Input voltage	; 18.5V
Output voltage	; 15V
Permissible output current ;	500mA

1-6 Current transformer

The current transformer is equipped in order to check motor current at AC side. In its structure, this transformer winds secondary winding to cut core, and it is of a window-type; at the primary side, main circuit connecting bar goes straight through the core and makes one turn.

1-7 Fuse

The fuse is installed between the cables of alternating current U, V, W phases for the purpose of protecting the thyristor from overcurrent. If the fuse is blown off, the white mark of the micro switch installed at the top of the fuse body will protrude, which shows blow-off fuse distinctly. (See Fig. 1)

In case the mark protrudes forward again, replace the fuse. Even if the mark is again pushed in, the exchanged fuse is not used as it is, because the fuse is blown off. The types of the fuse are as follows:

Fuse Types

Drive Unit Type No.	—	—	FSD -18DN43	FSD -22DN43	FSD -30DN43	FSD -37DN43	—	—
	—	—	FSD -11DN33	FSD -15DN33	FSD -18DN33	FSD -22DN33	FSD -30DN33	—
	FSD -5DN23	FSD -7DN23	FSD -11DN23	FSD -15DN23	—	—	—	FSD -18DN23
Fuse Type No.	CS5F-40-G		CS5F-75-G		CS5F-100-G			CS5F 150-G

	—	—	—	—	FSD -45DN43	FSD -55DN43	FSD -75DN43	FSD -90DN43	FSD -110DN43	FSD -150DN43
Drive Unit Type No.	—	—	—	—	FSD -37DN33	FSD -45DN43	FSD -55DN33	—	—	—
	FSD -22DN23	FSD -23DN23	FSD -25DN23	FSD -30DN23	FSD -37DN23	FSD -45DN23	—	—	FSD -55DN23	FSD -75DN23
Fuse Type No.	CS5F-200-G				CS5F-250-G				CS5F-400-G	


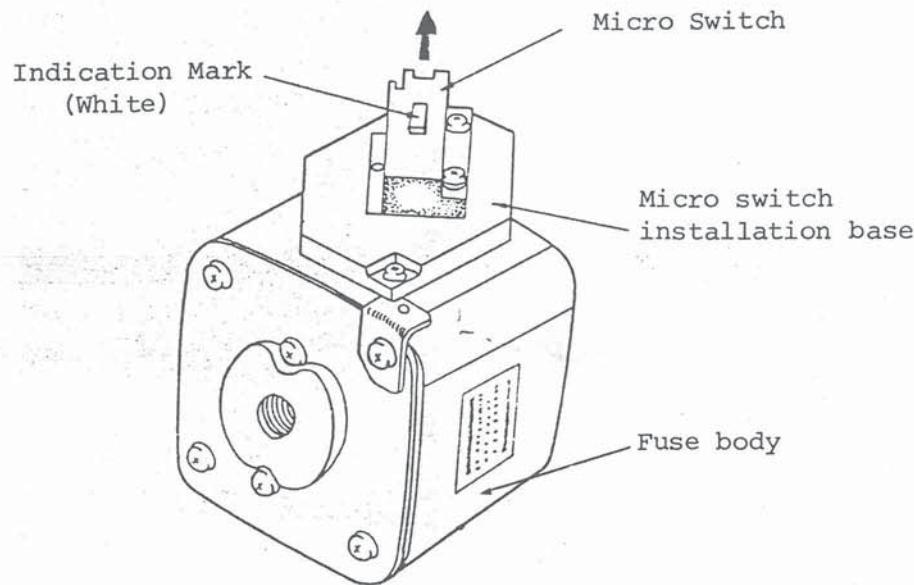


Fig. 1

2. Photo



ドライブユニット
DRIVE UNIT
<P-1>

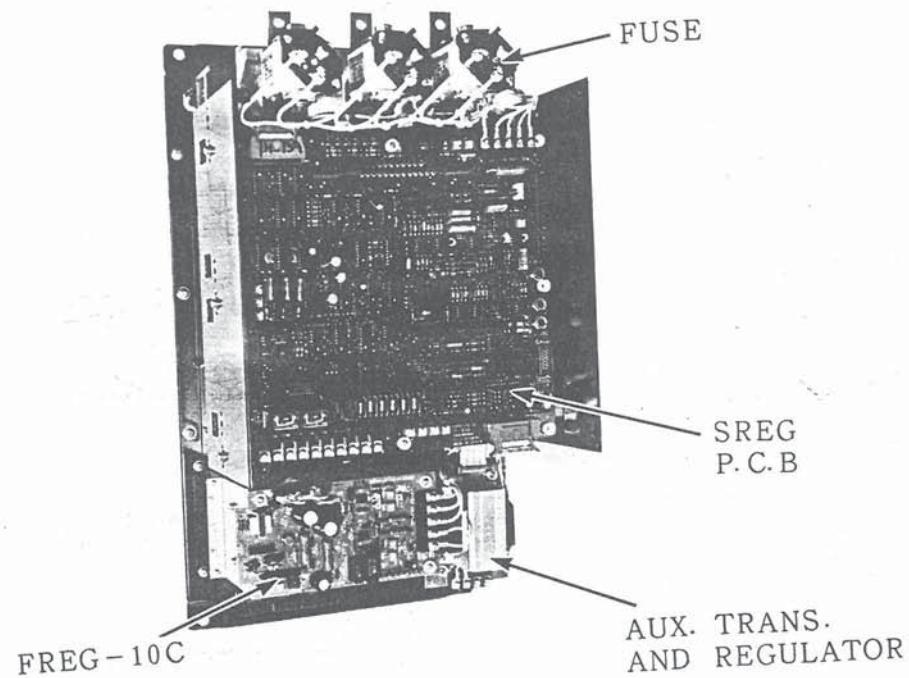

SREGプリント板
SREG. PRINTED CIRCUIT BOAD
<P-2>

(CDPB3CPS-62)

(CDPB3CPS-82)

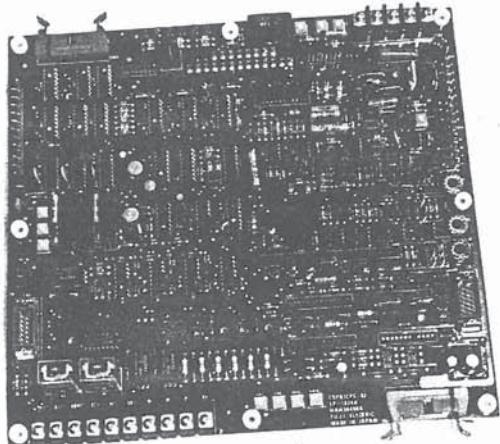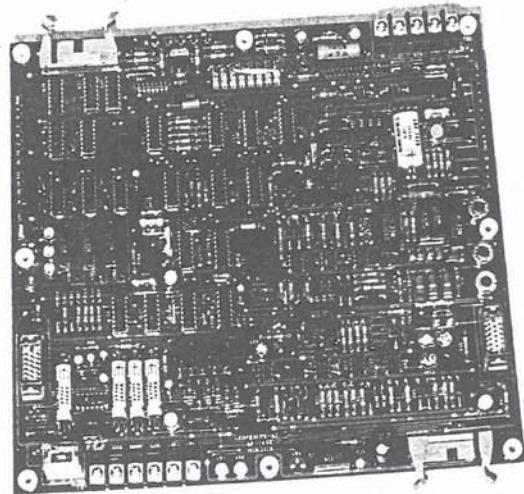

SREG. P 板



チェック 端子


<P-3>

With Scope to Pulse

PHU
PHX
PHV
PHY
PHW
PHZ
FG
RG
SH
TOD
M


50HZ / 60HZ
切換
CHANGE

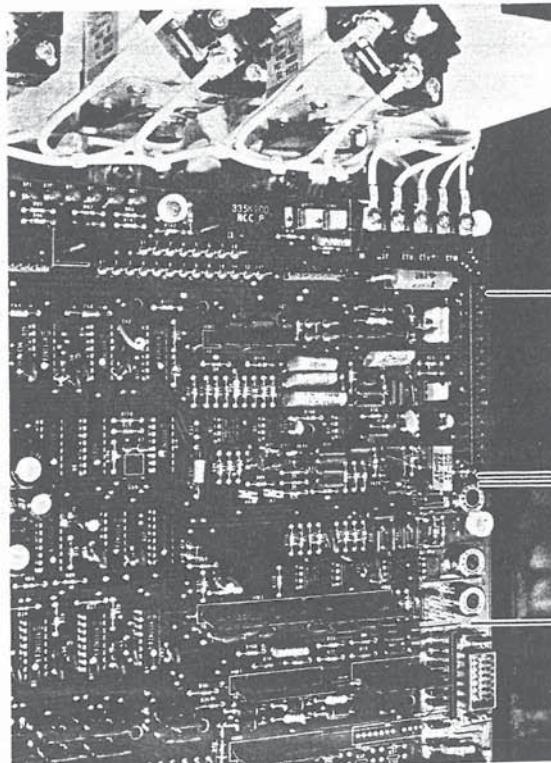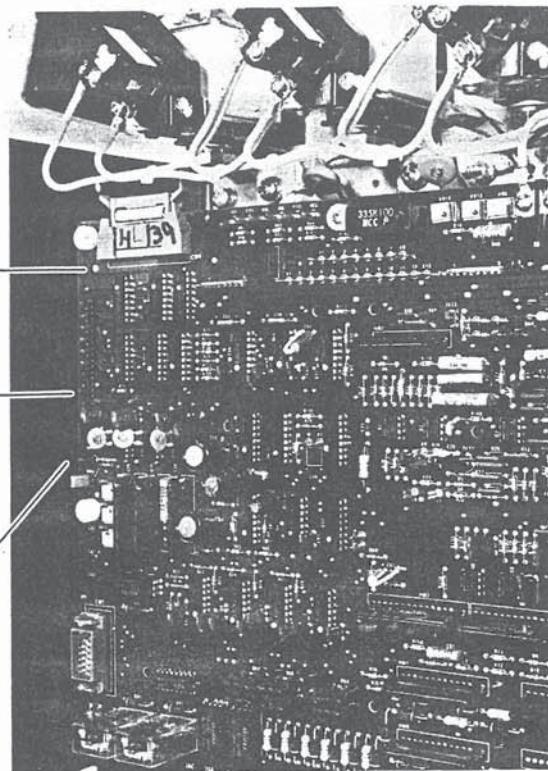


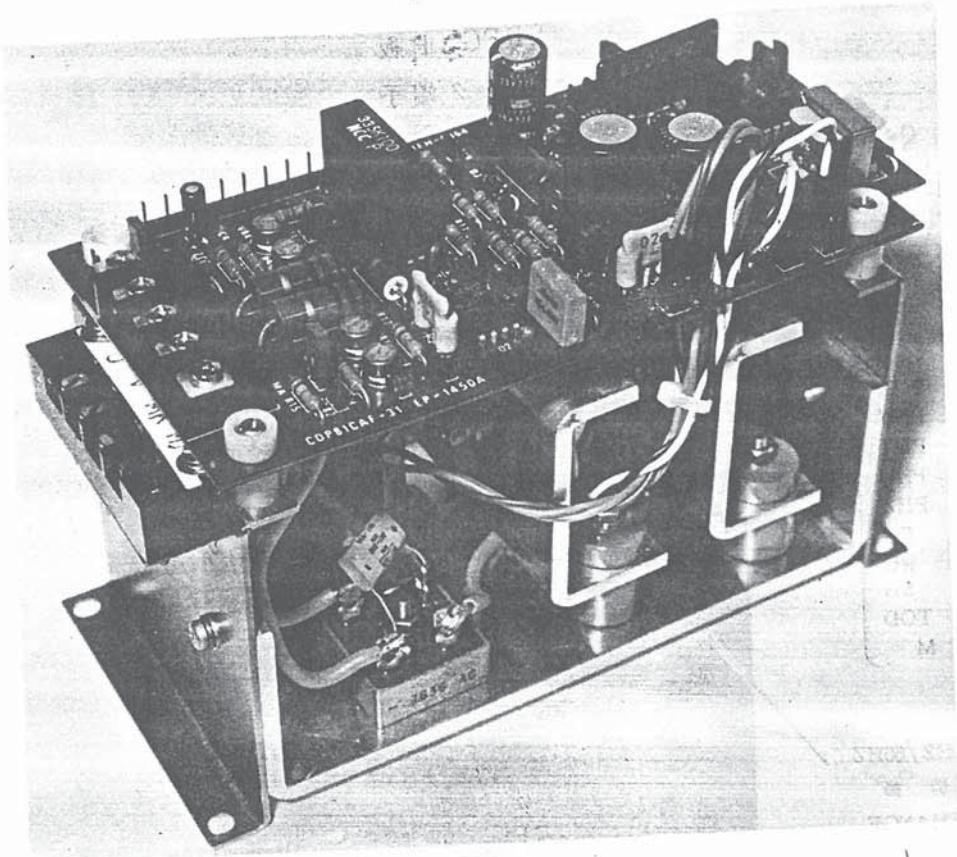


自動界磁調整器
FIELD REGULATOR
(FREG-10C)
<P-4>


Ooya
Vertical
mill

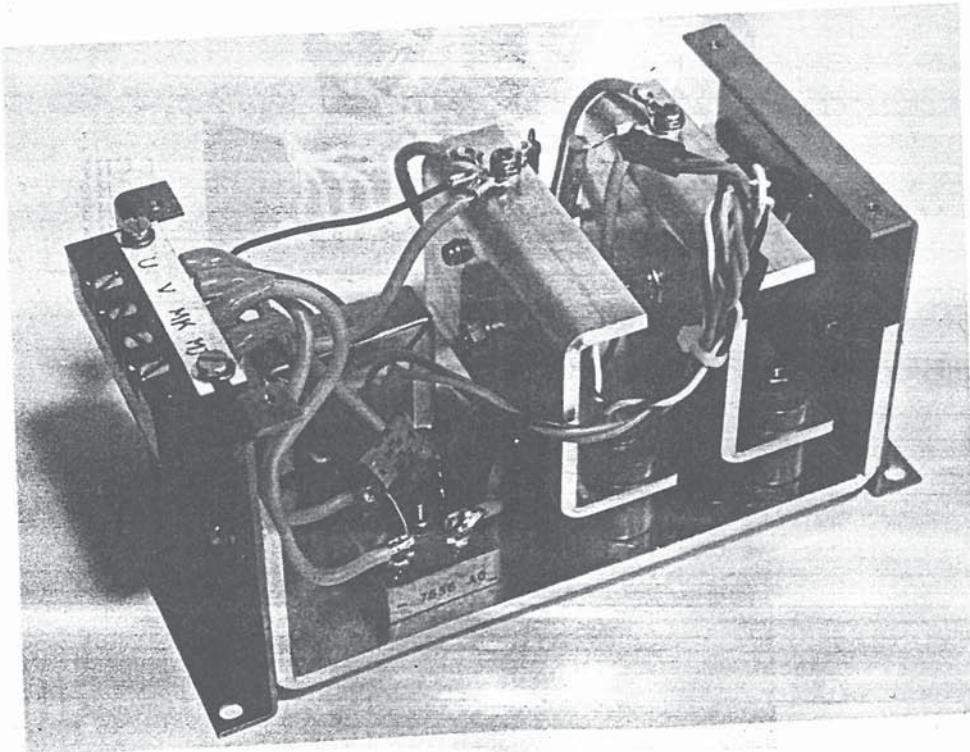

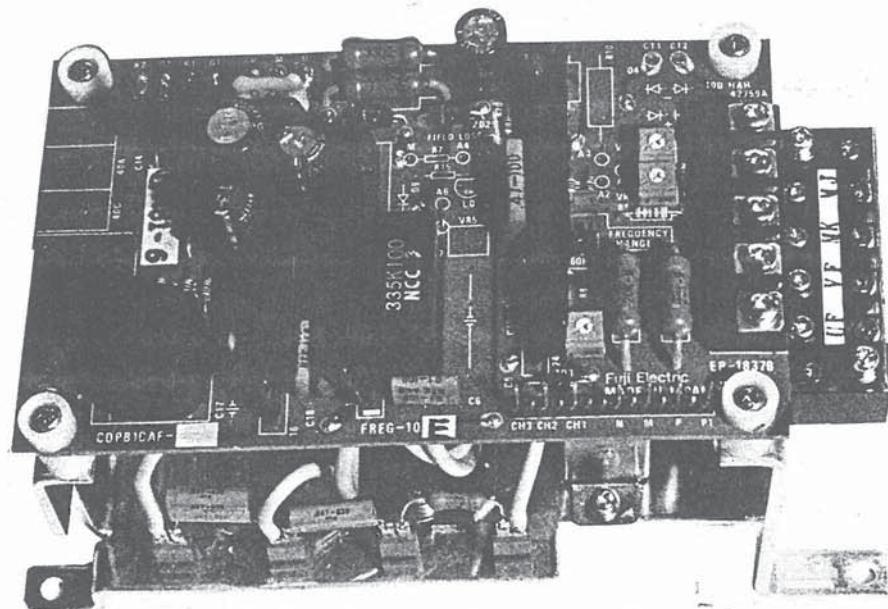


自動界磁調整器
FIELD REGULATOR
(FREG-10 E)
<P-5>

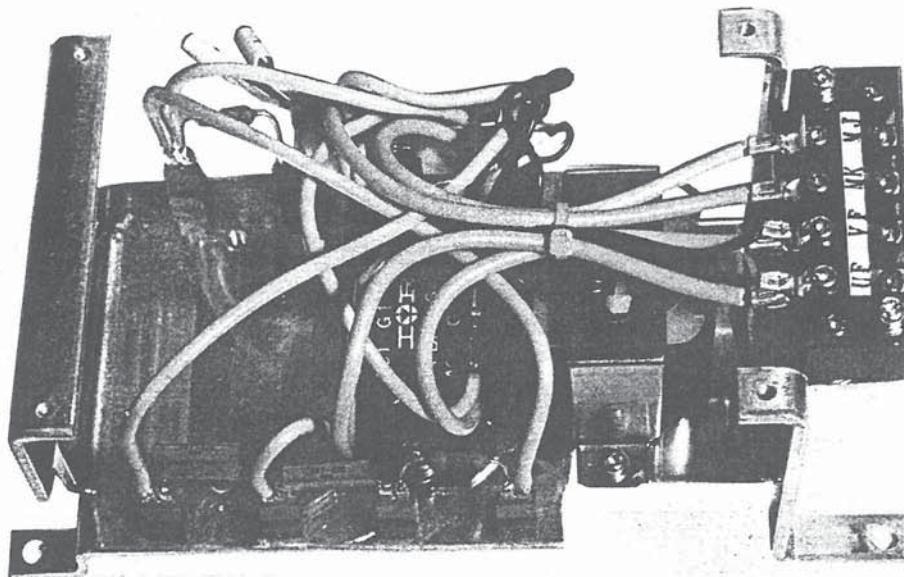

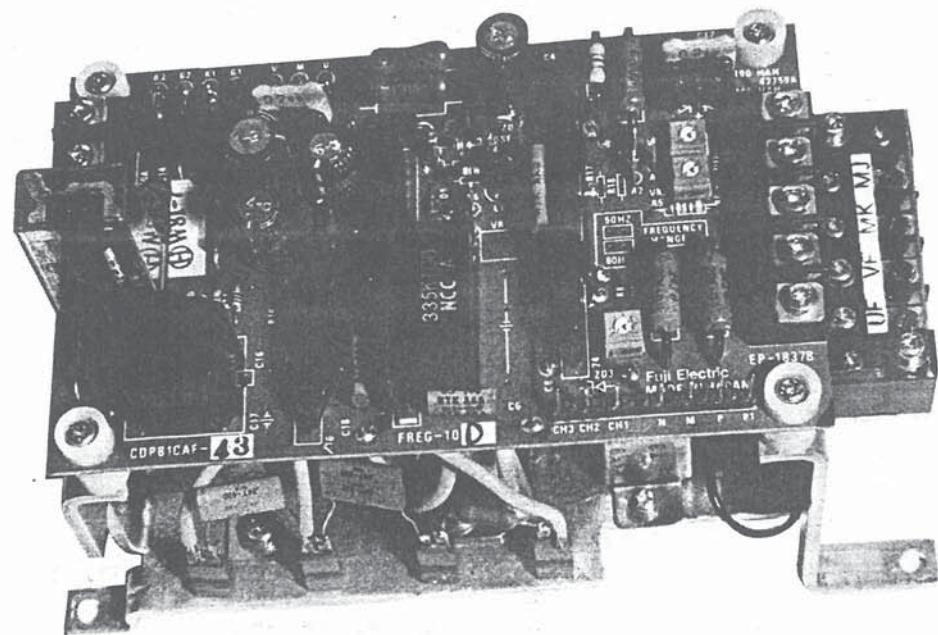


自動界磁調整器
FIELD REGULATOR
(FREG-10D)
<P-6>

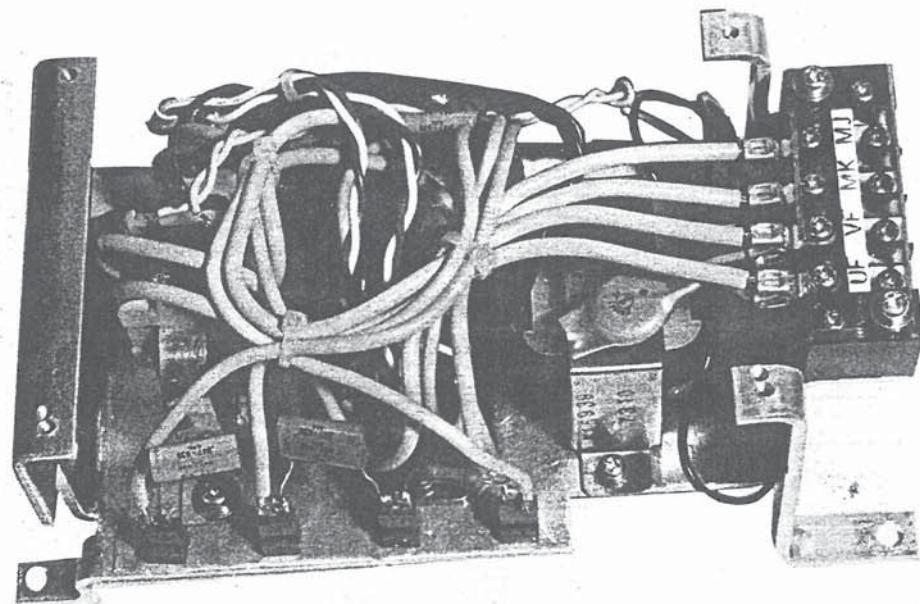

パルストラns P板 (200V用)
PULSE TRANS. P・C・B (200V)

(CDPD3ZPA-11)


<P-7>

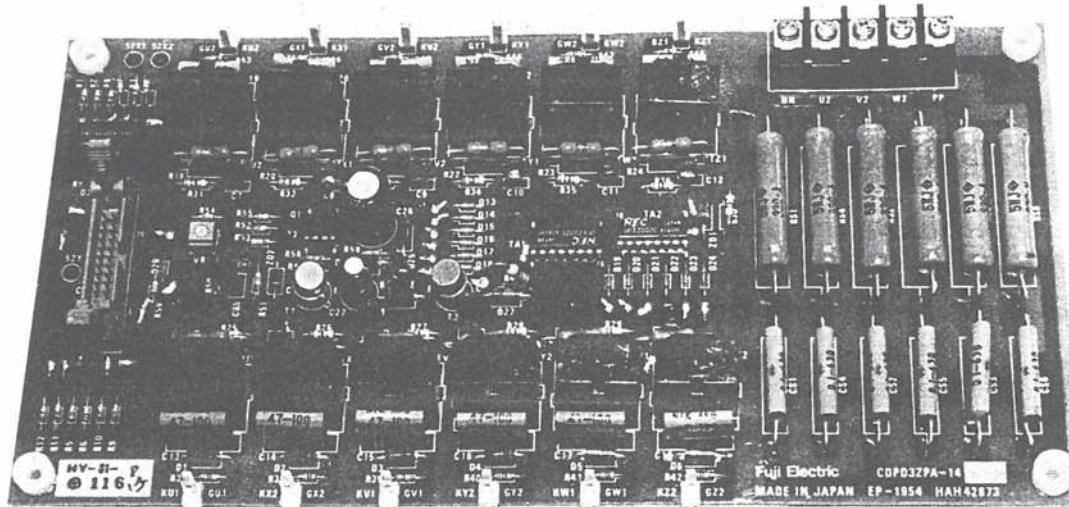


パルストラns P板 (200V用)
PULSE TRANS. P・C・B (200V)

(CDPD3ZPA-13)


<P-8>

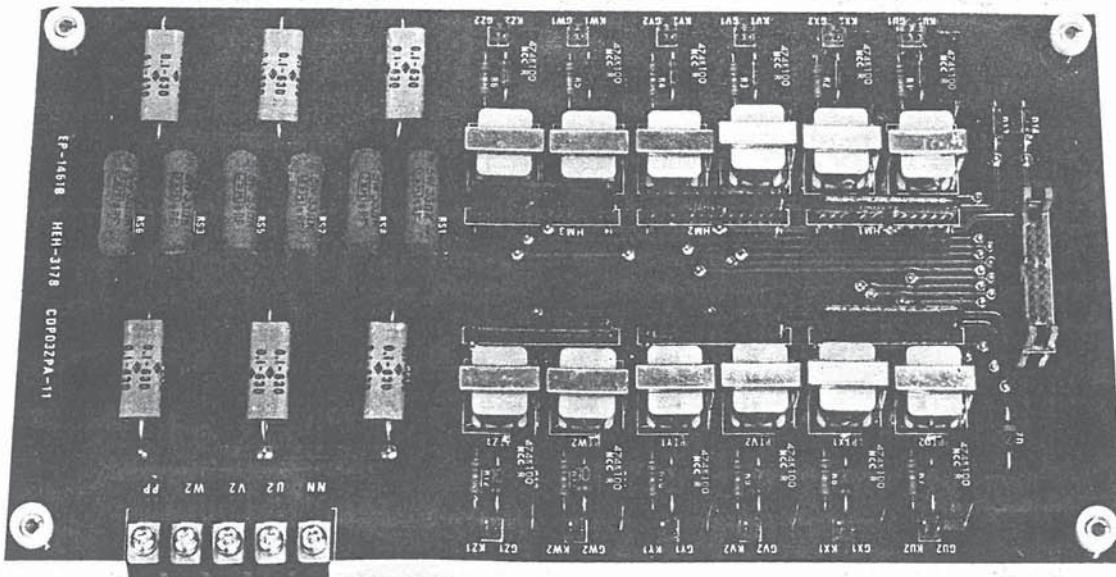


パルストラns P板 (200V用)
PULSE TRANS. P・C・B (200V)
(CDPD3ZPA-14)
<P-9>

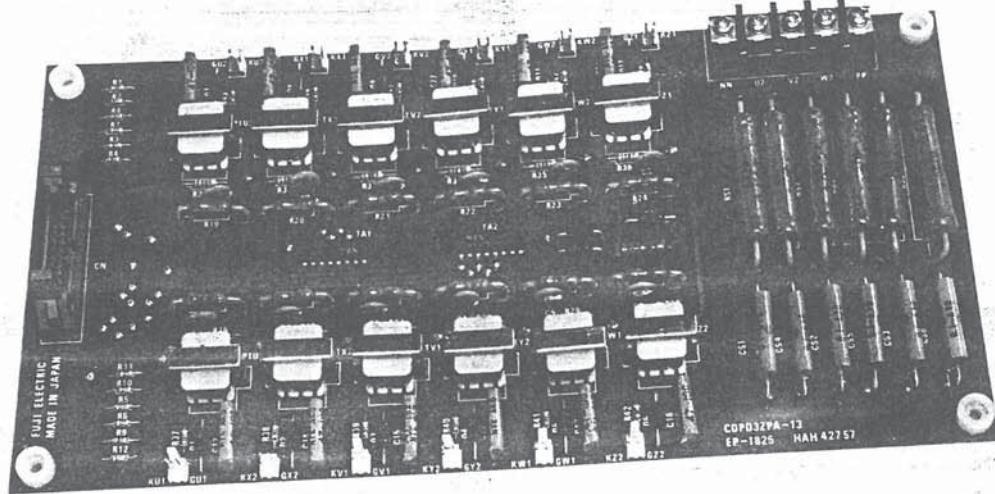


パルストラns P板 (400V用)
PULSE TRANS. P・C・B (400V)
<P-10>

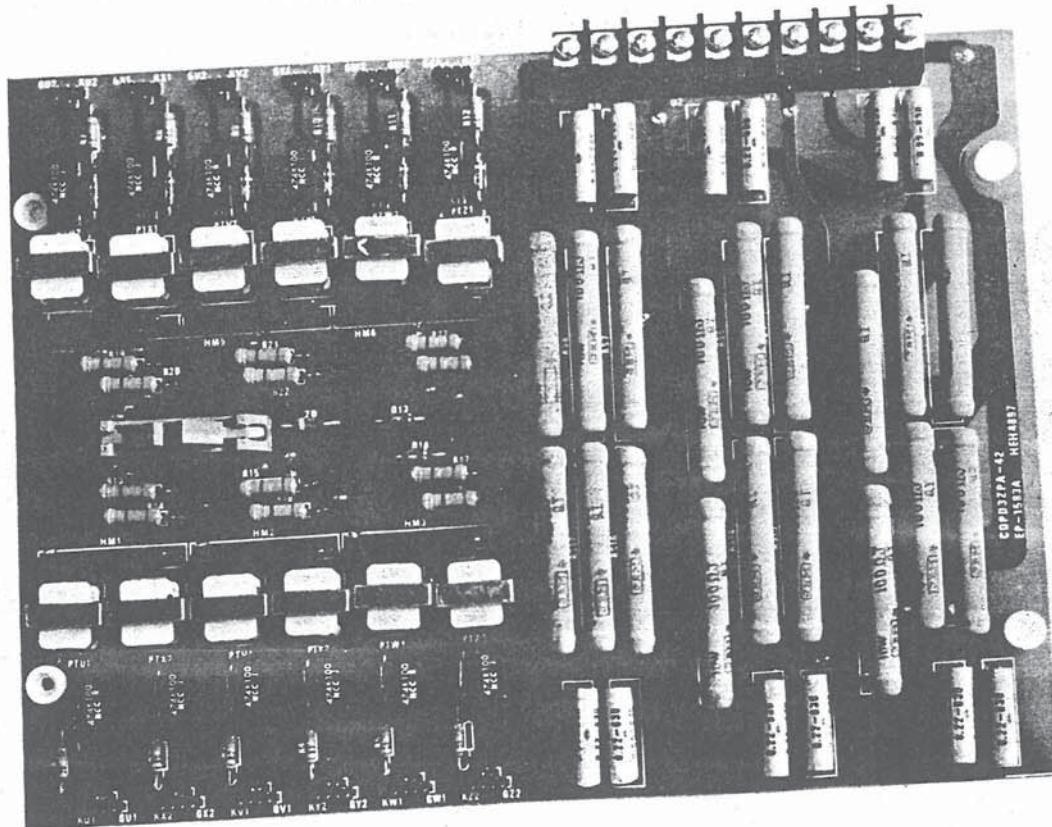


サイリスタ
THYRISTOR (FUJI)
<P-11>

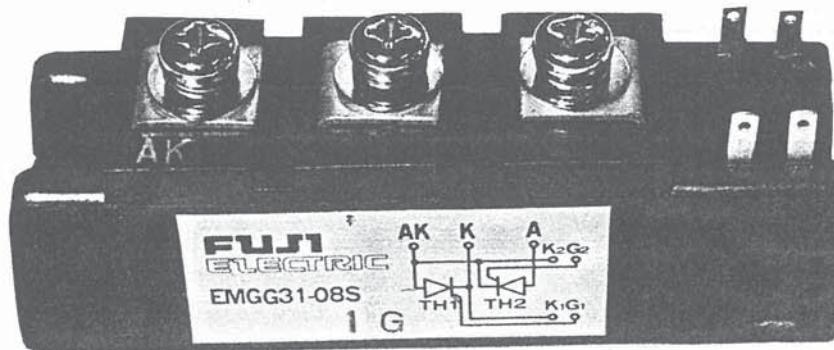


サイリスタ
THYRISTOR (FUJI)
<P-12>

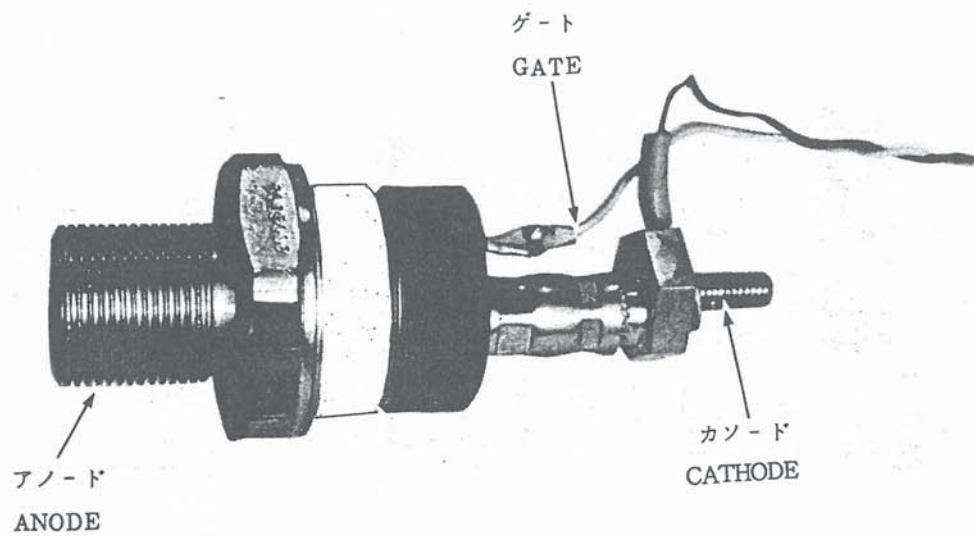


HLR • Comparator P.C.B.
(CDPAOPUJ-22)
<P-13>

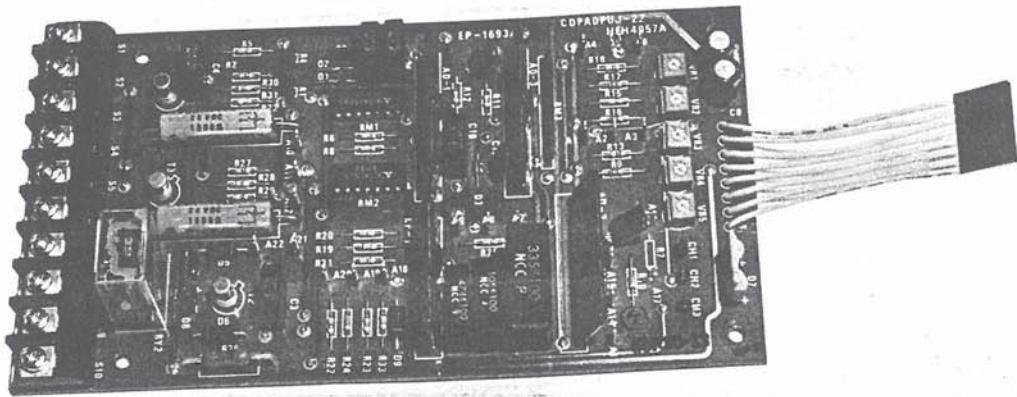


Override with HLR P.C.B.
(CDPAOPUJ-32)
<P-14>

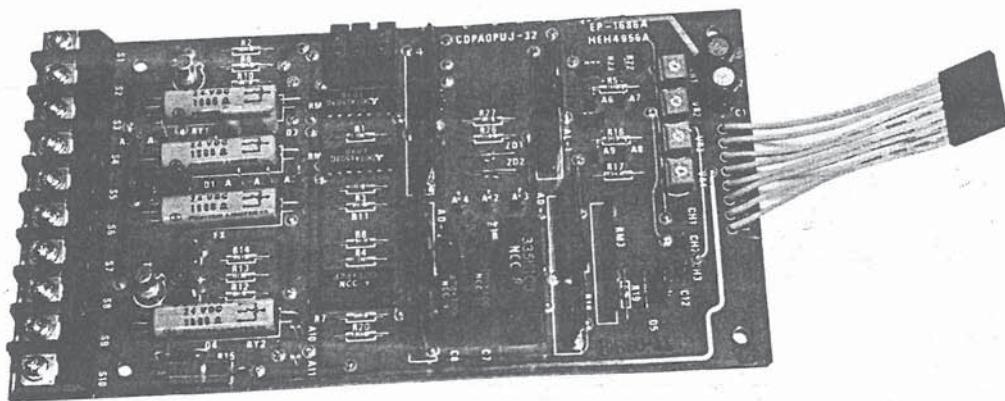

HLR • Speed arrival signal • Comparator P.C.B.
(CDPAOPUJ-41)
<P-15>

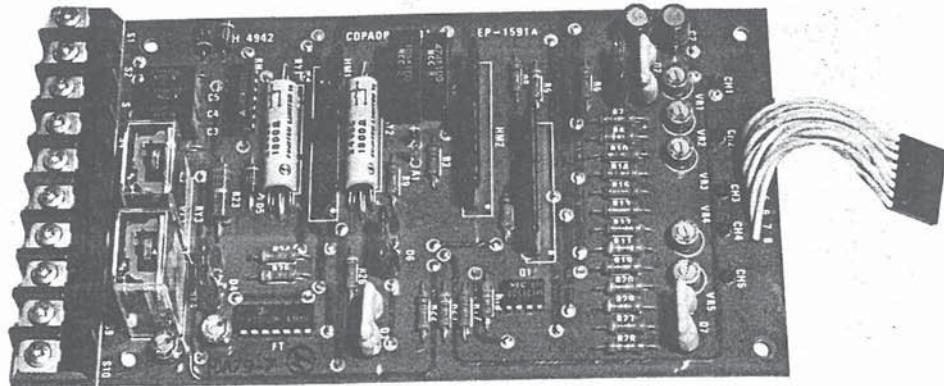


Torque limiter • Speed arrival signal P.C.B.
(CDPAOBTL-31)
<P-16>

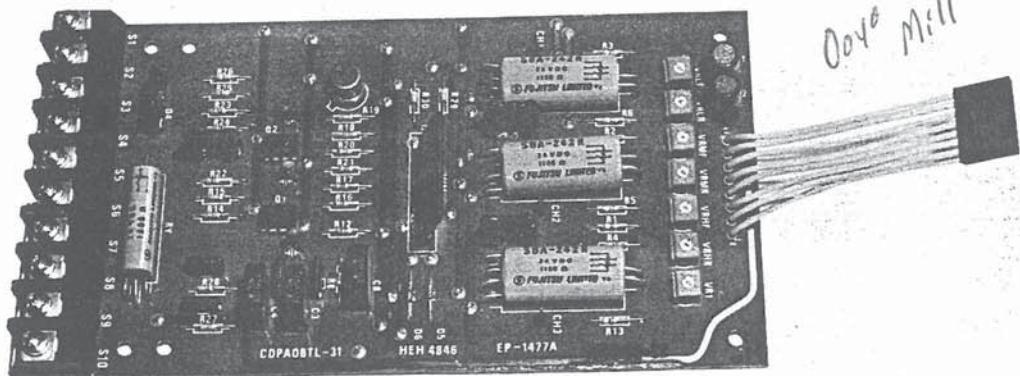

Torque limiter • Current limit pattern generate P.C.B.

(CDPAOBTL-41)

<P-17>

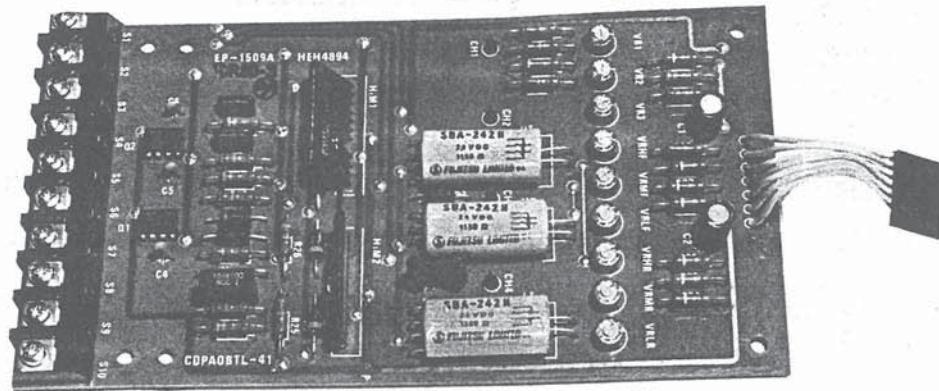


D/A Convertor • Speed arrival signal P.C.B.


(CDPAOTAD-21)

<P-18>


\$510.00
Vertical
004a

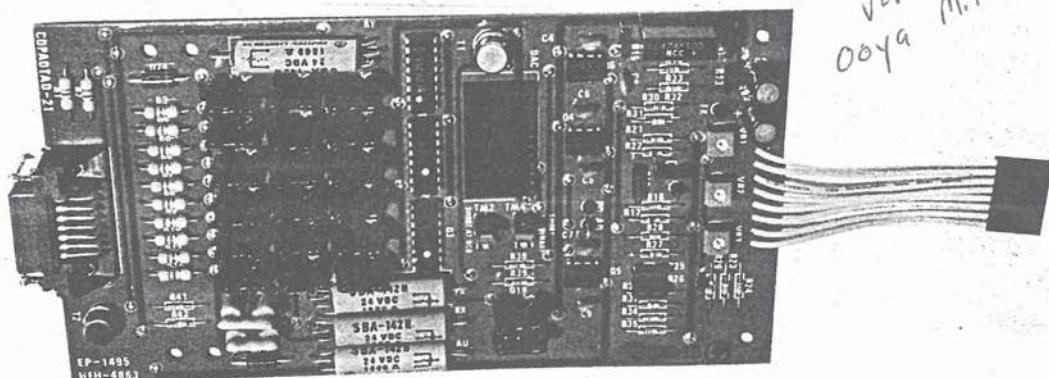

Comparator P.C.B.
(CDPAOLKX-71)
<P-19>

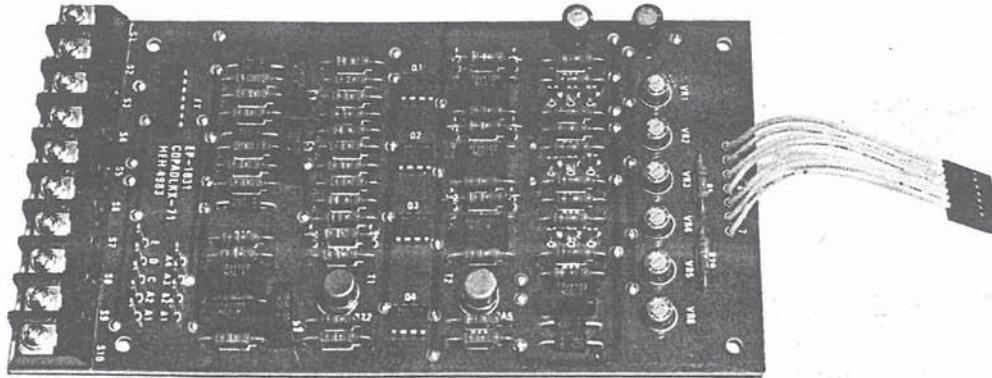


Comparator • SC • Timer • Phase rotation P.C.B.
(CDPAOLKX-52)
<P-20>

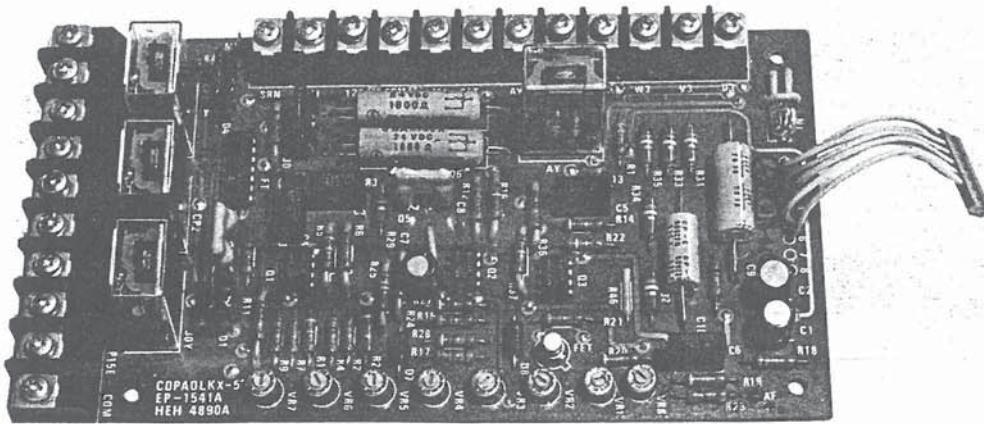

Position adjustment P.C.B.

(CDPAOCAP-51)


<P-21>

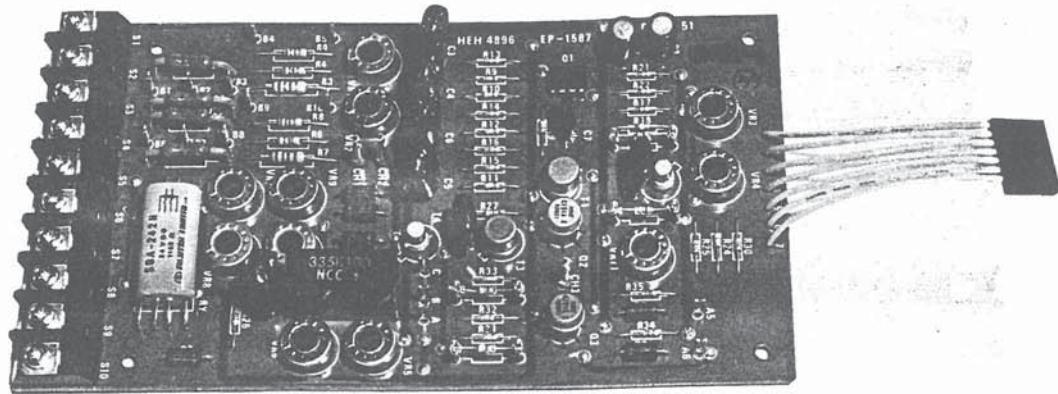


Torque limiter • Load meter P.C.B.

(CDPAOBTL-52)


<P-22>

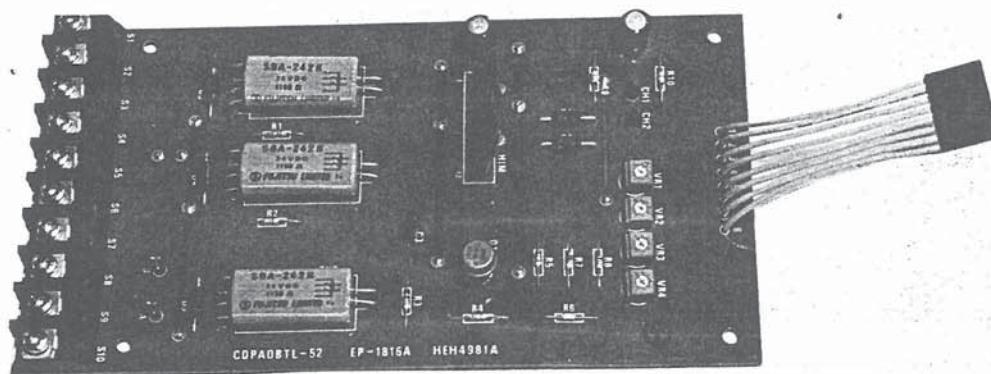


Load meter P.C.B.
(CDPAO AAC-11)
<P-23>

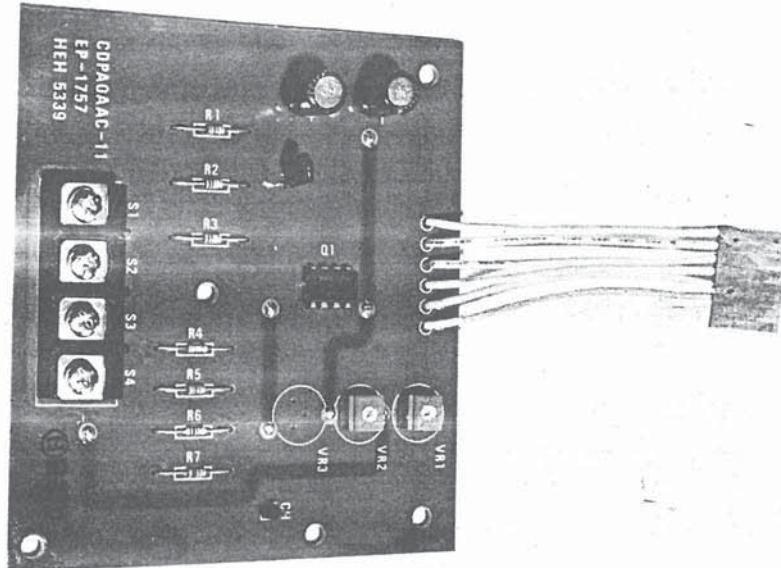


Speed arrival signal P.C.B.
(CDPAOLKX-41)
<P-24>

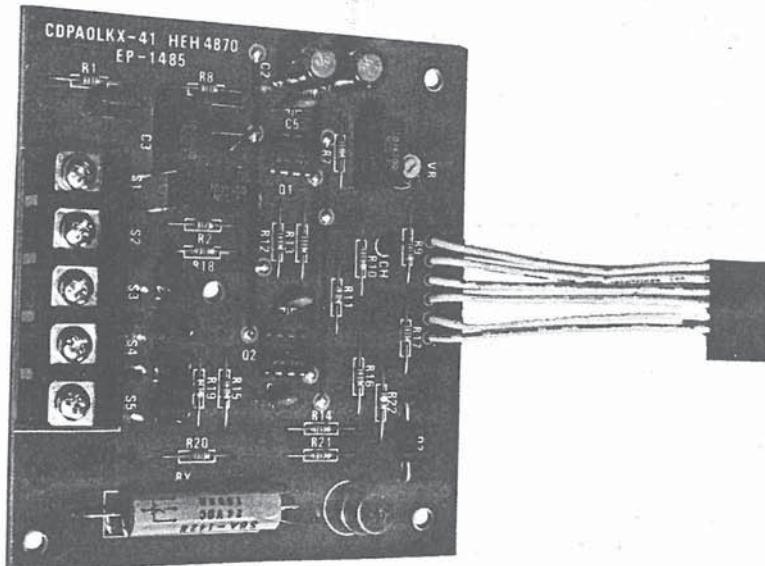


Speed arrival signal • Comparator P.C.B.
(CDPAOLKX-61)
<P-25>

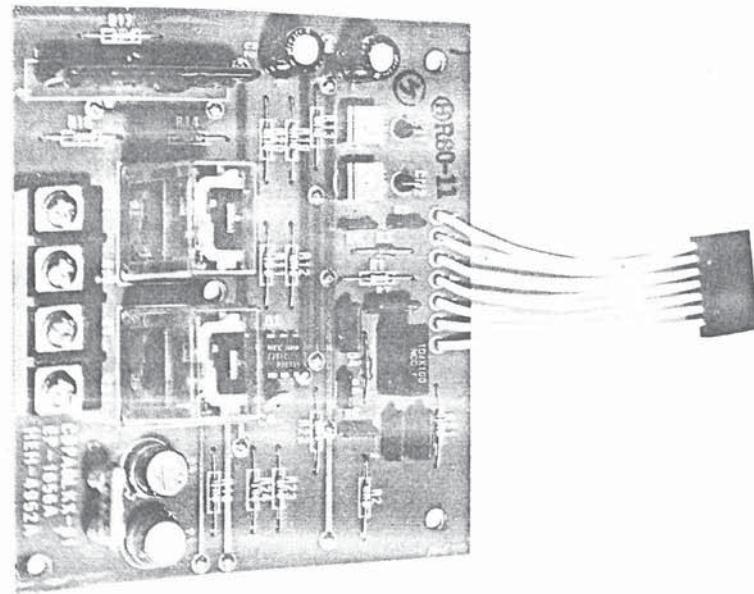

Attachment P.C.B.
<P-26>

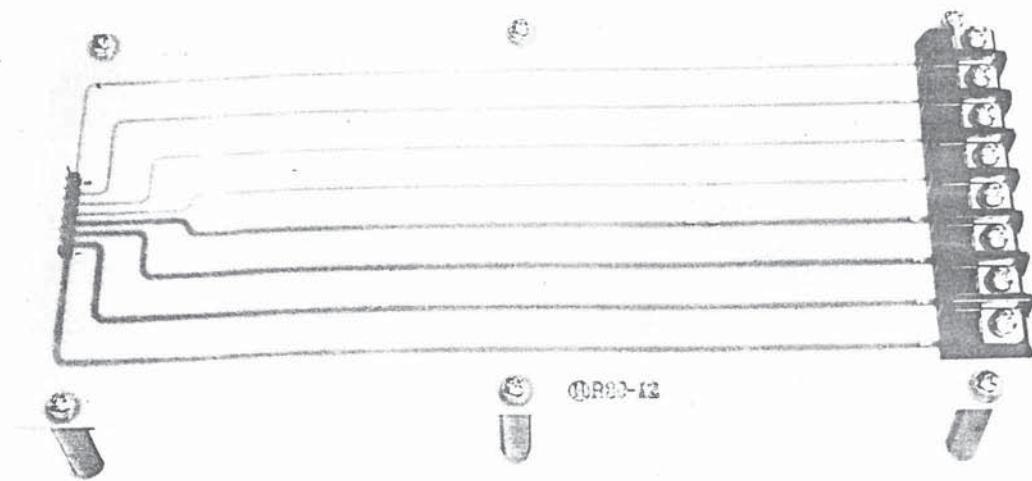

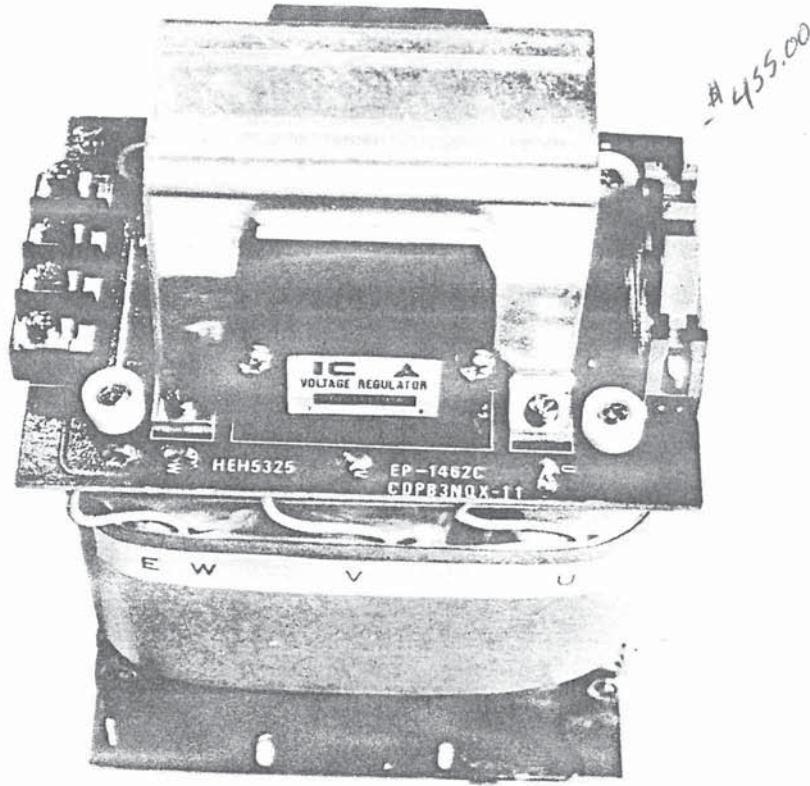

<P-27>

補助変圧器及び定電圧装置
AUX. TRANS. AND REGULATOR


3. Drawing

3-1 Standard Whole Drawing (Without Option)

- | | |
|--|-----------|
| (1) SREG. (CDPB3CPS-62) + pulse trans (CDPD3ZPA-11)
+ Field Unit (FREG-10C) + Power Unit + Main Circuit | HEH3179 |
| (2) SREG. (CDPB3CPS-83-0) + pulse trans (CDPD3ZPA-12)
+ Field Unit (FREG-10C) + Power Unit + Main Circuit | HAH30607 |
| (3) SREG. (CDPB3CPS-83) + pulse trans (CDPD3ZPA-12)
+ Field Unit (FREG-10C) + Power Unit + Main Circuit | HAH30496C |
| (4) SREG. (CDPB3CPS-82) + pulse trans (CDPD3ZPA-11)
+ Field Unit (FREG-10C) + Power Unit + Main Circuit | HAH30496a |

3-2 Option P.C.B.


- | | |
|---|----------|
| (1) HLR, comparator (CDPA0PUJ-23) | HEH4957 |
| (2) Override HLR (CDPA0PUJ-33) | HEH4956 |
| (3) HLR, speed arrival signal, comparator (CDPA0PUJ-42) | HEH4942 |
| (4) Speed arrival signal (CDPA0LKX-41) | HEH4870 |
| (5) Comparator timer, sine change (CDPA0LKX-52) | HEH4890 |
| (6) Speed arrival signal, comparator (CDPA0LKX-61) | HEH4952 |
| (7) Speed arrival signal, Torque limiter (CDPA0BTL-31) | HEH4868 |
| (8) Current limit, Torque limiter (CDPA0BTL-41) | HEH4894 |
| (9) Torque limiter, Load meter (CDPA0BTL-53) | HEH4981 |
| (10) D/A convertor (CDPA0TAD-21) | HEH4863 |
| (11) Orientation (2 sensor) (CDPA0LAC-52) | HAH42999 |
| (12) Orientation (pulse encoder) (CDPA0LAC-62)
(CDPA0LAC-72)
(CDPA0LAC-72Z) | HAH42896 |
| (13) Load meter P.C.B. (CDPA0AAC-11) | HEH5339 |

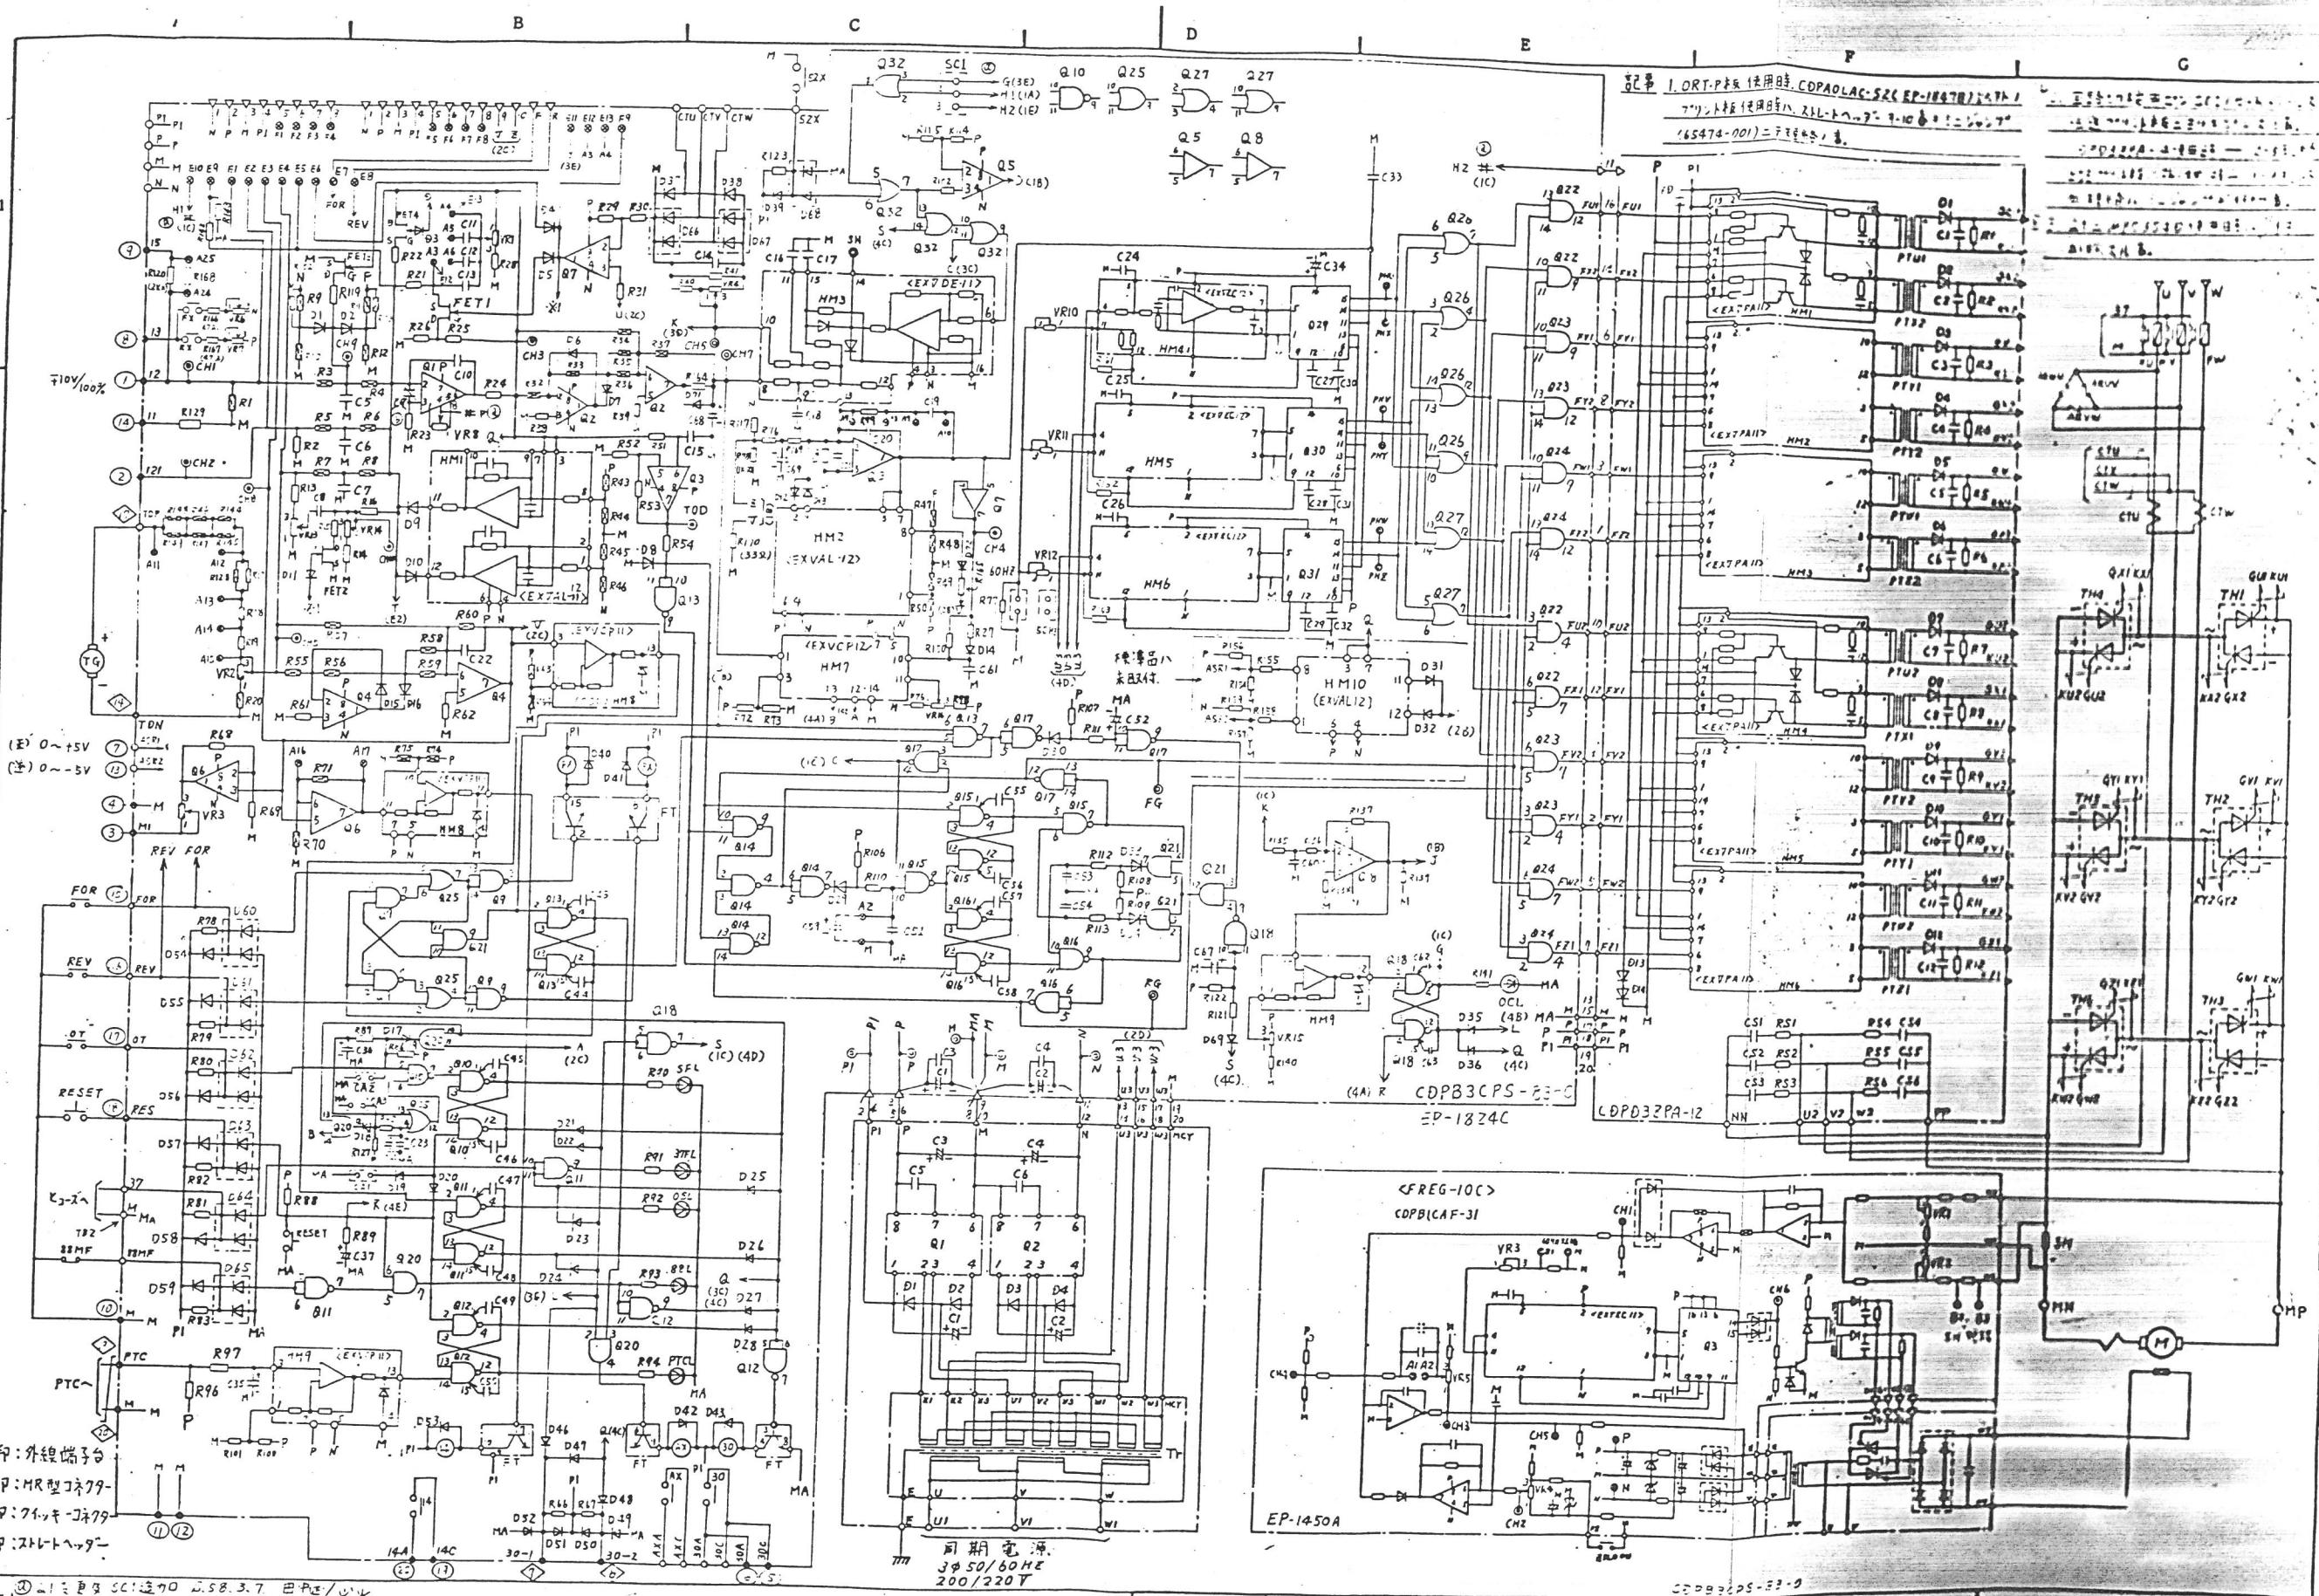

第三角法


3 phase pure bridge anti-parallel type


HAH 30607

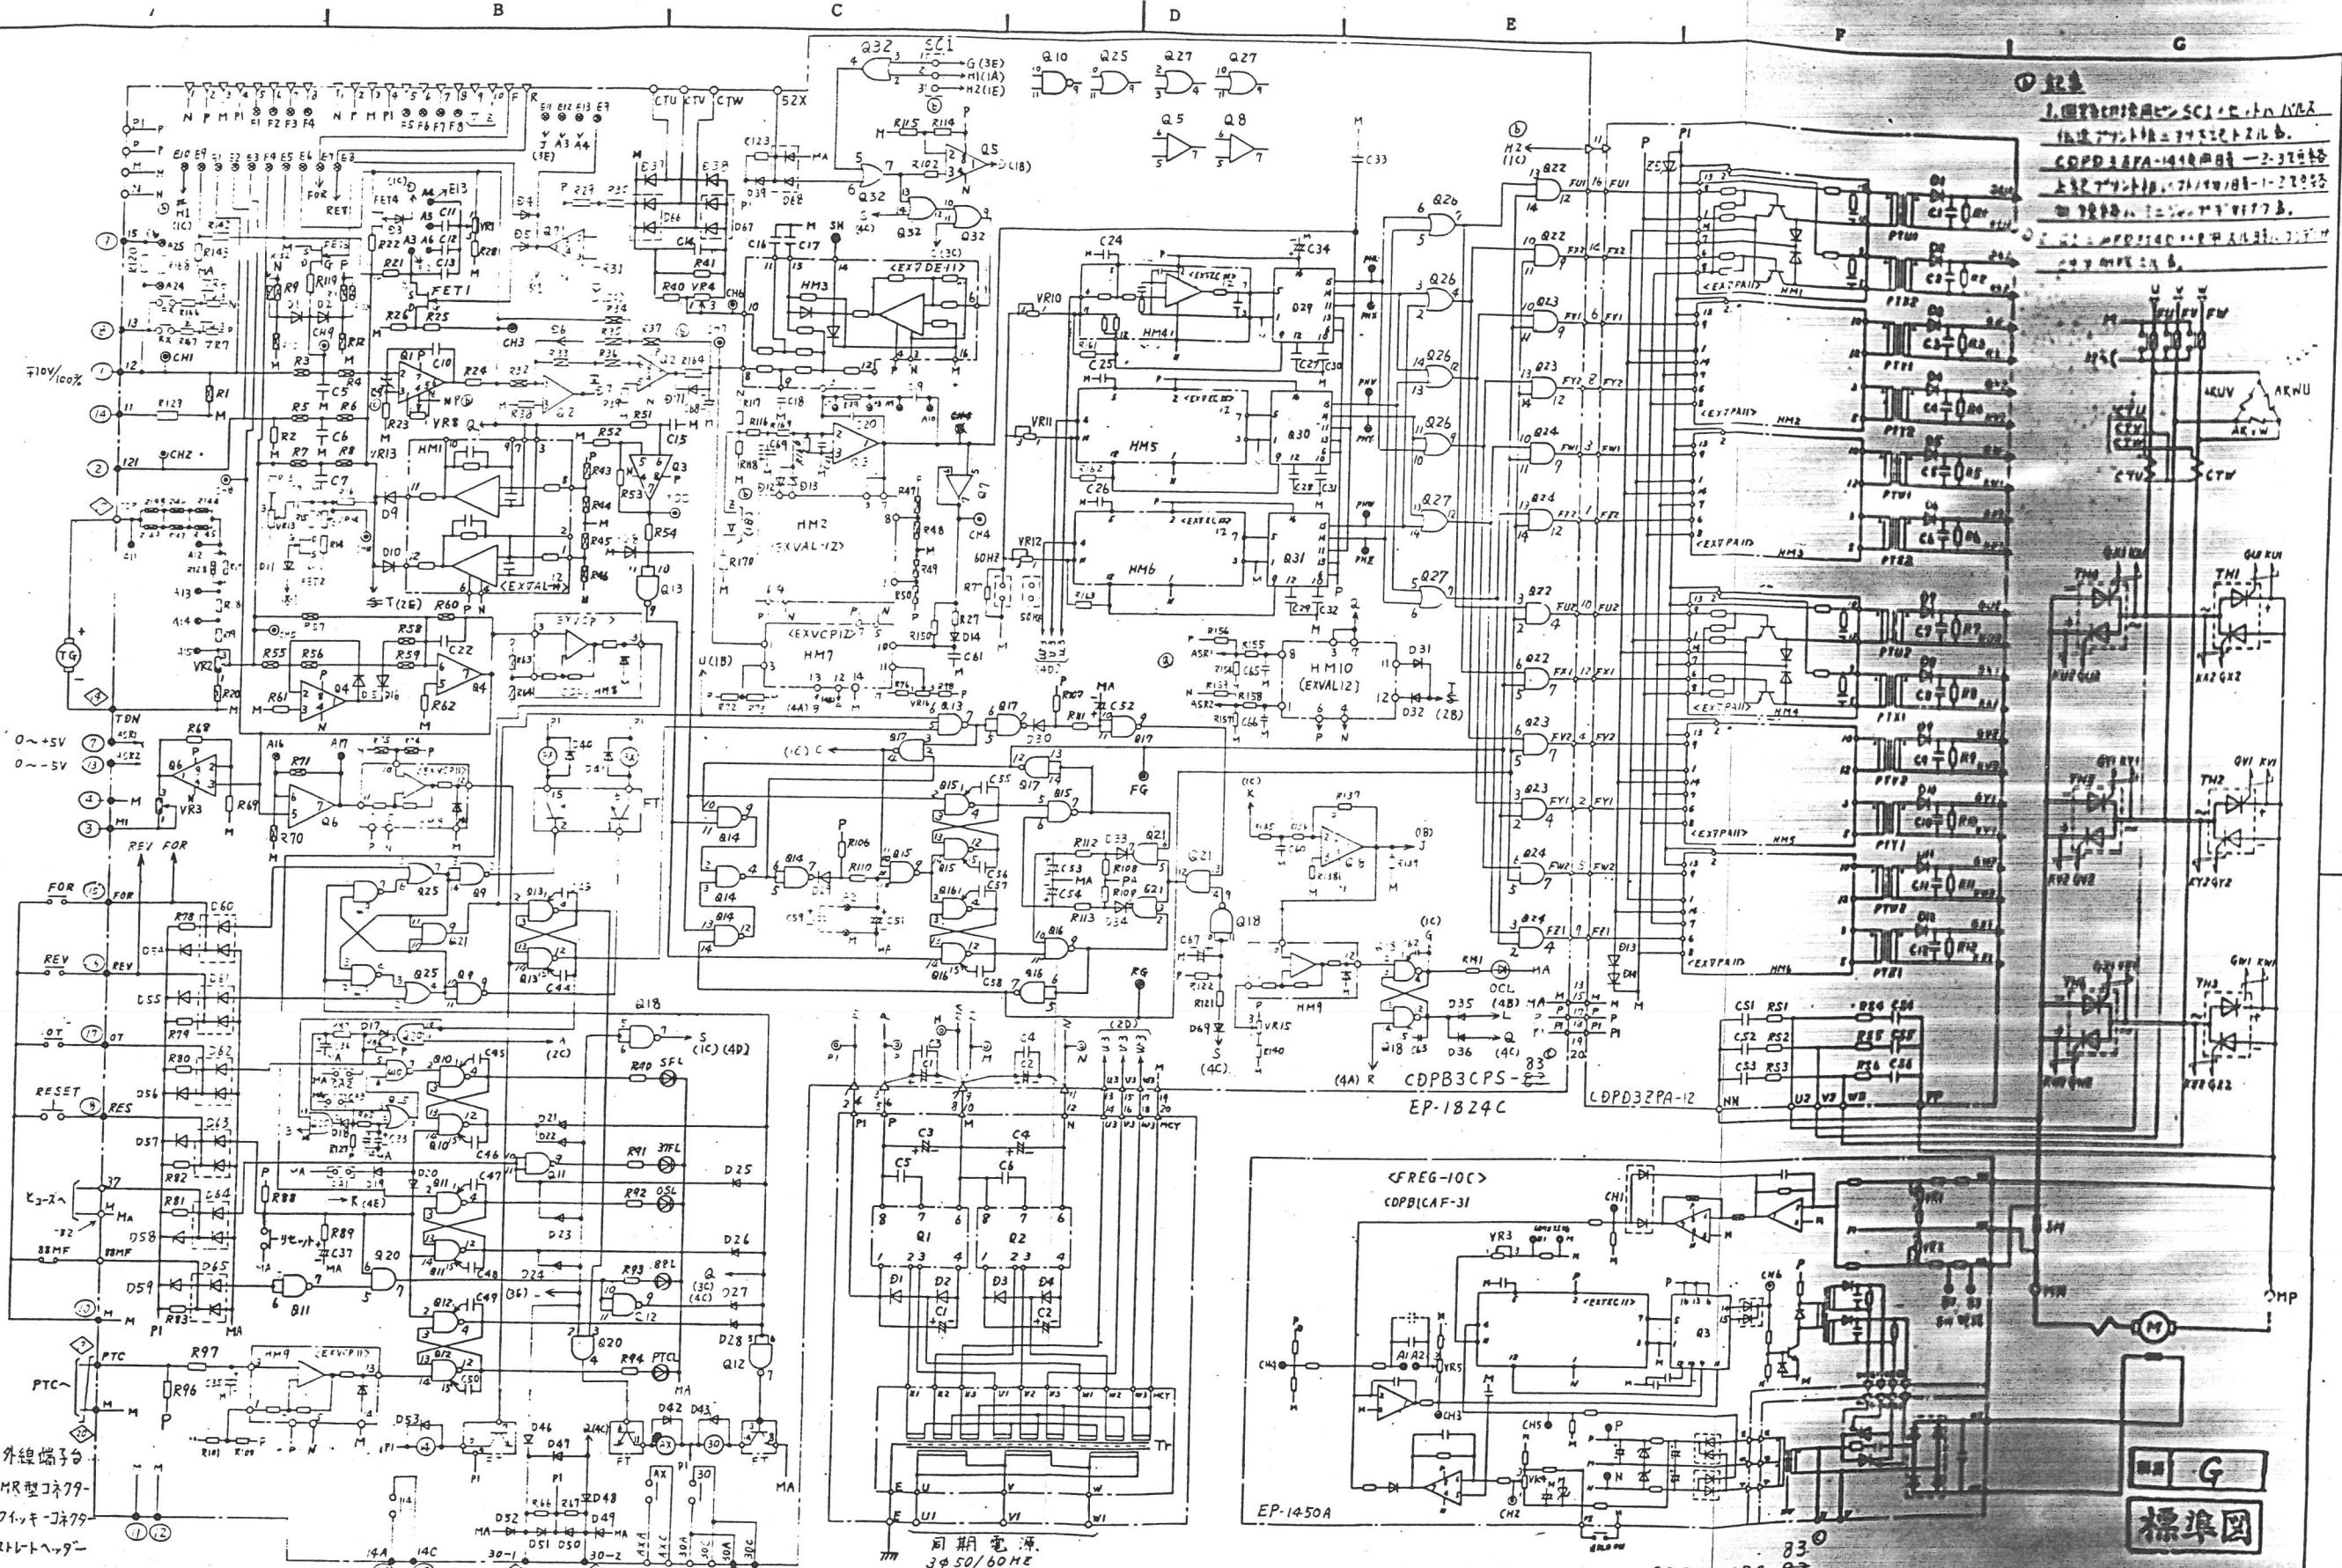

日付 器名 尺度
製図 87-3-27 三寸
調査 昭
昭 - -
第三角法
工具
富士電機製造株式会社
3 phase pure bridge anti-parallel type
Whole Connection diagram
HAK 30496

(1) L7: 2-338115, S.55, 9.11. (西2) 小2
(2) YPT 安全 D.58.5.10 四中2/1/1
(3) C9 削除 S.58.7.1 四中2/1/1
変更

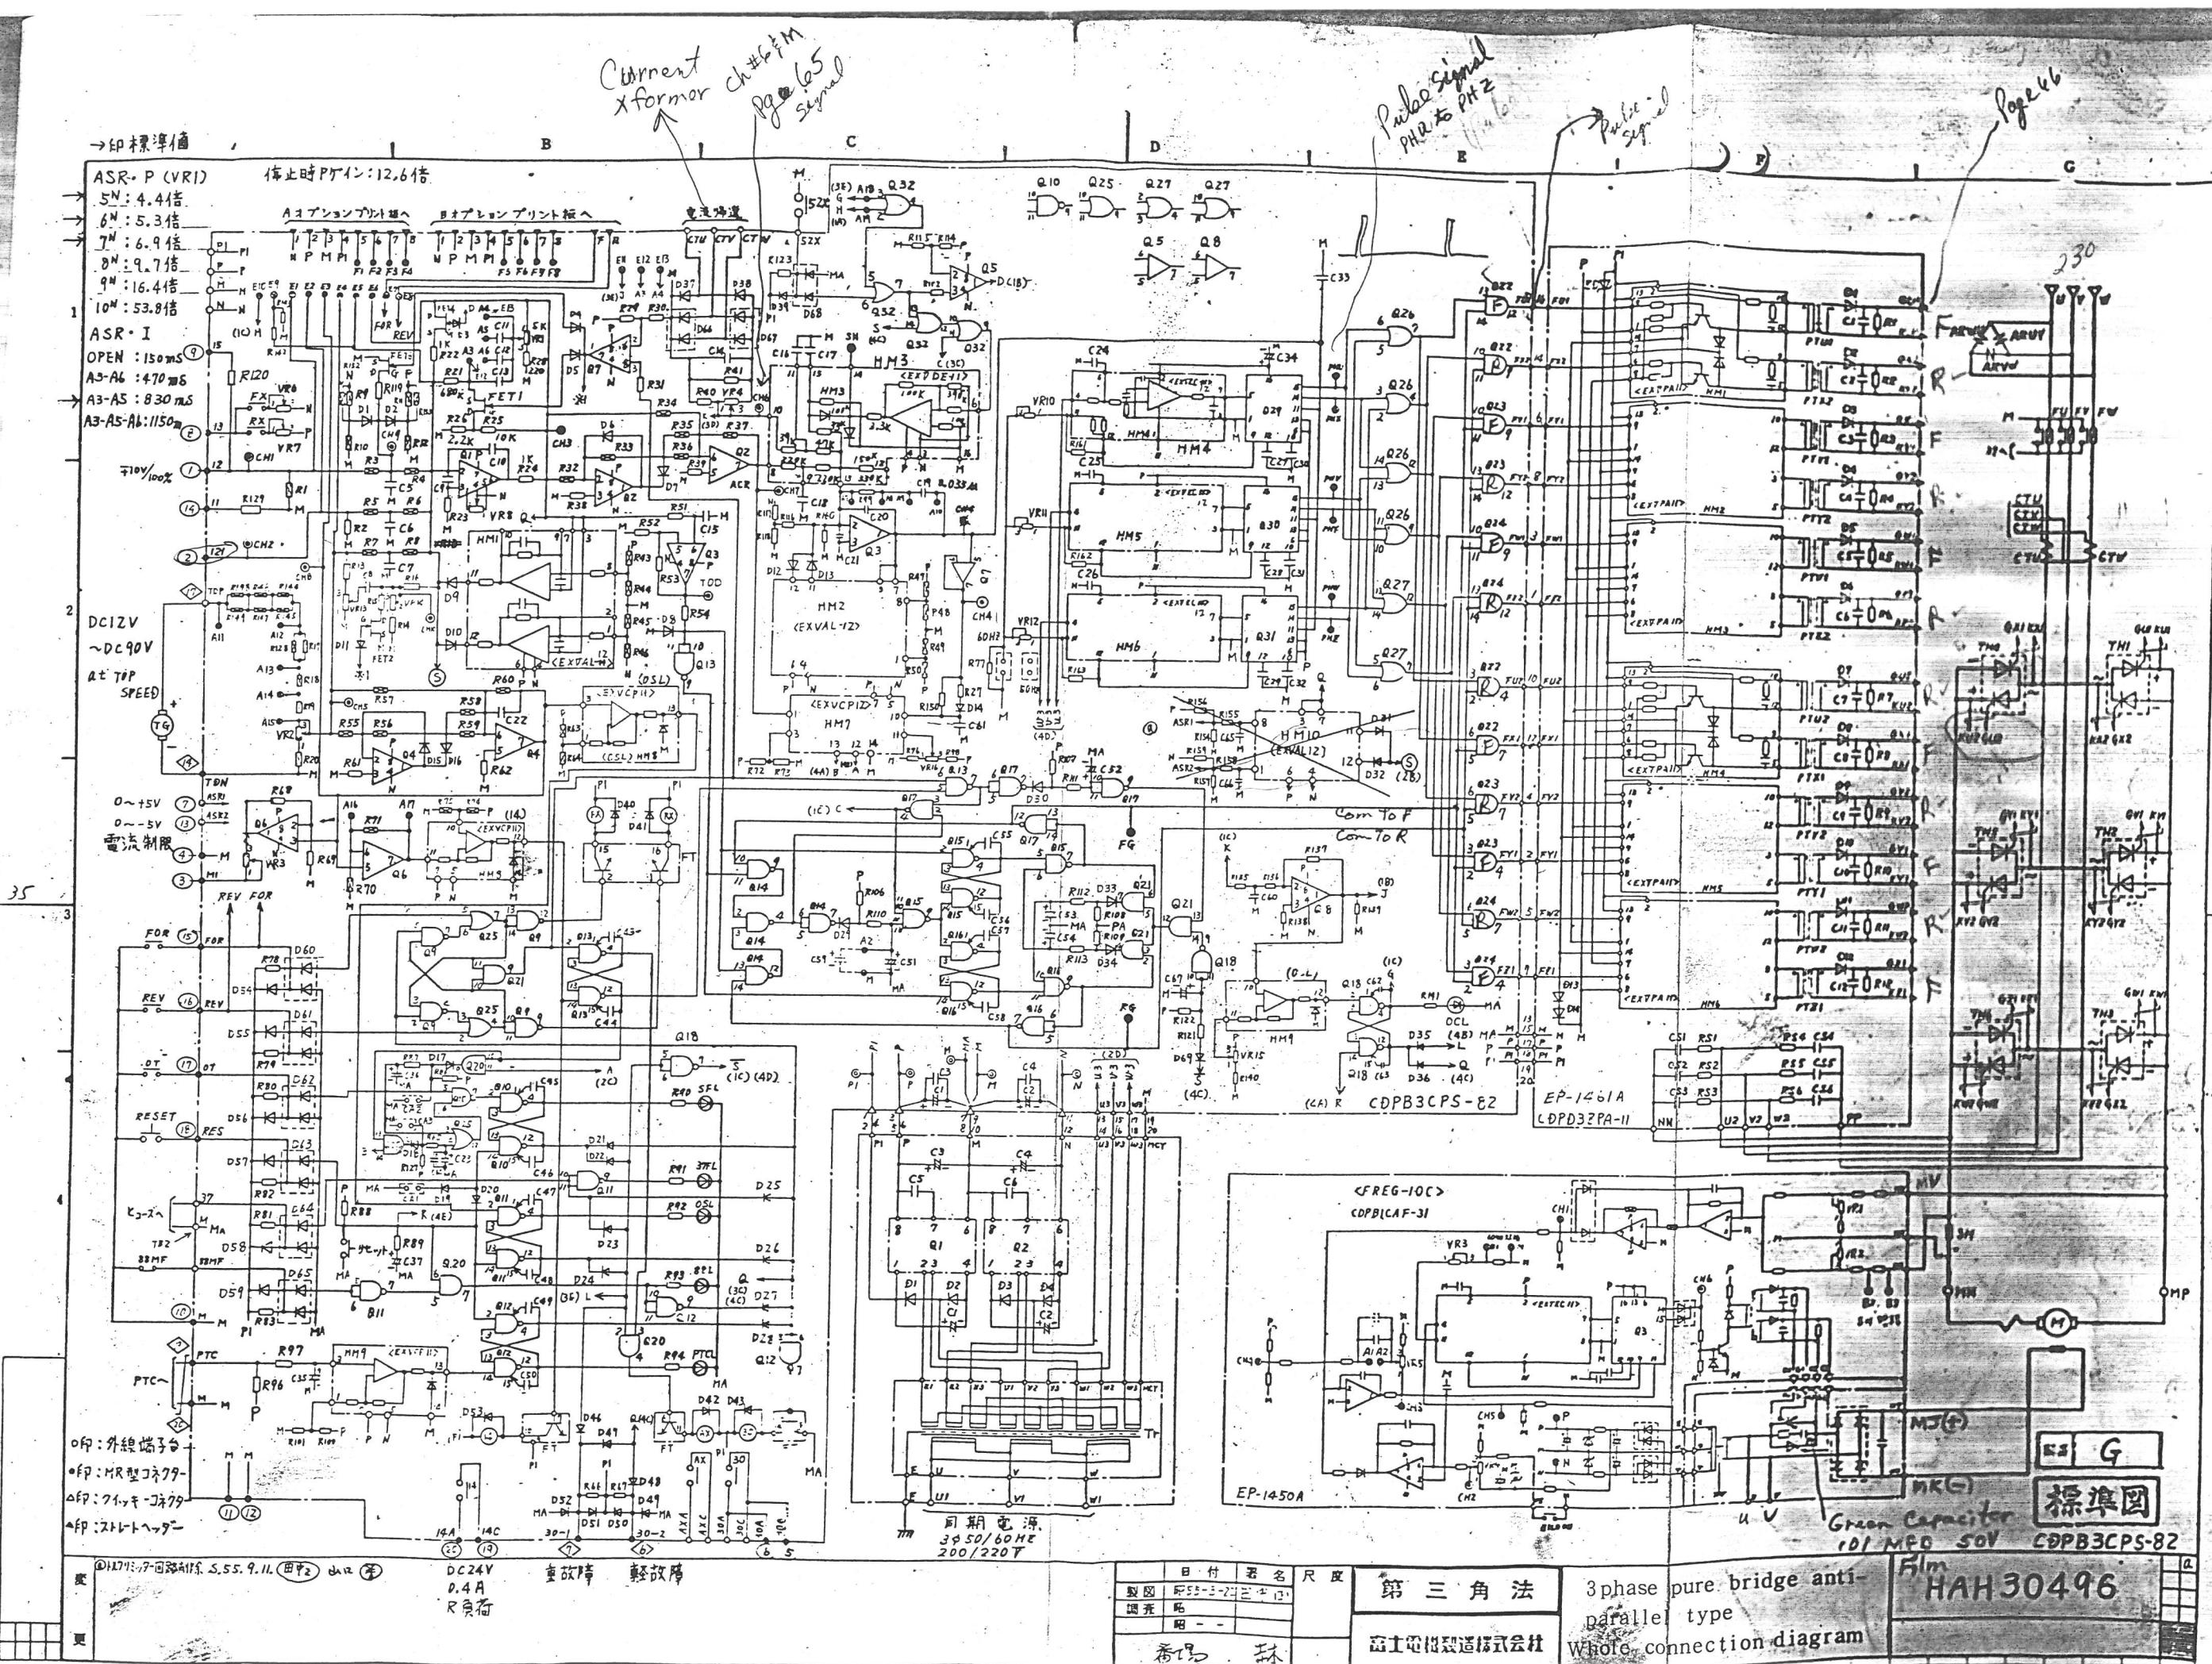

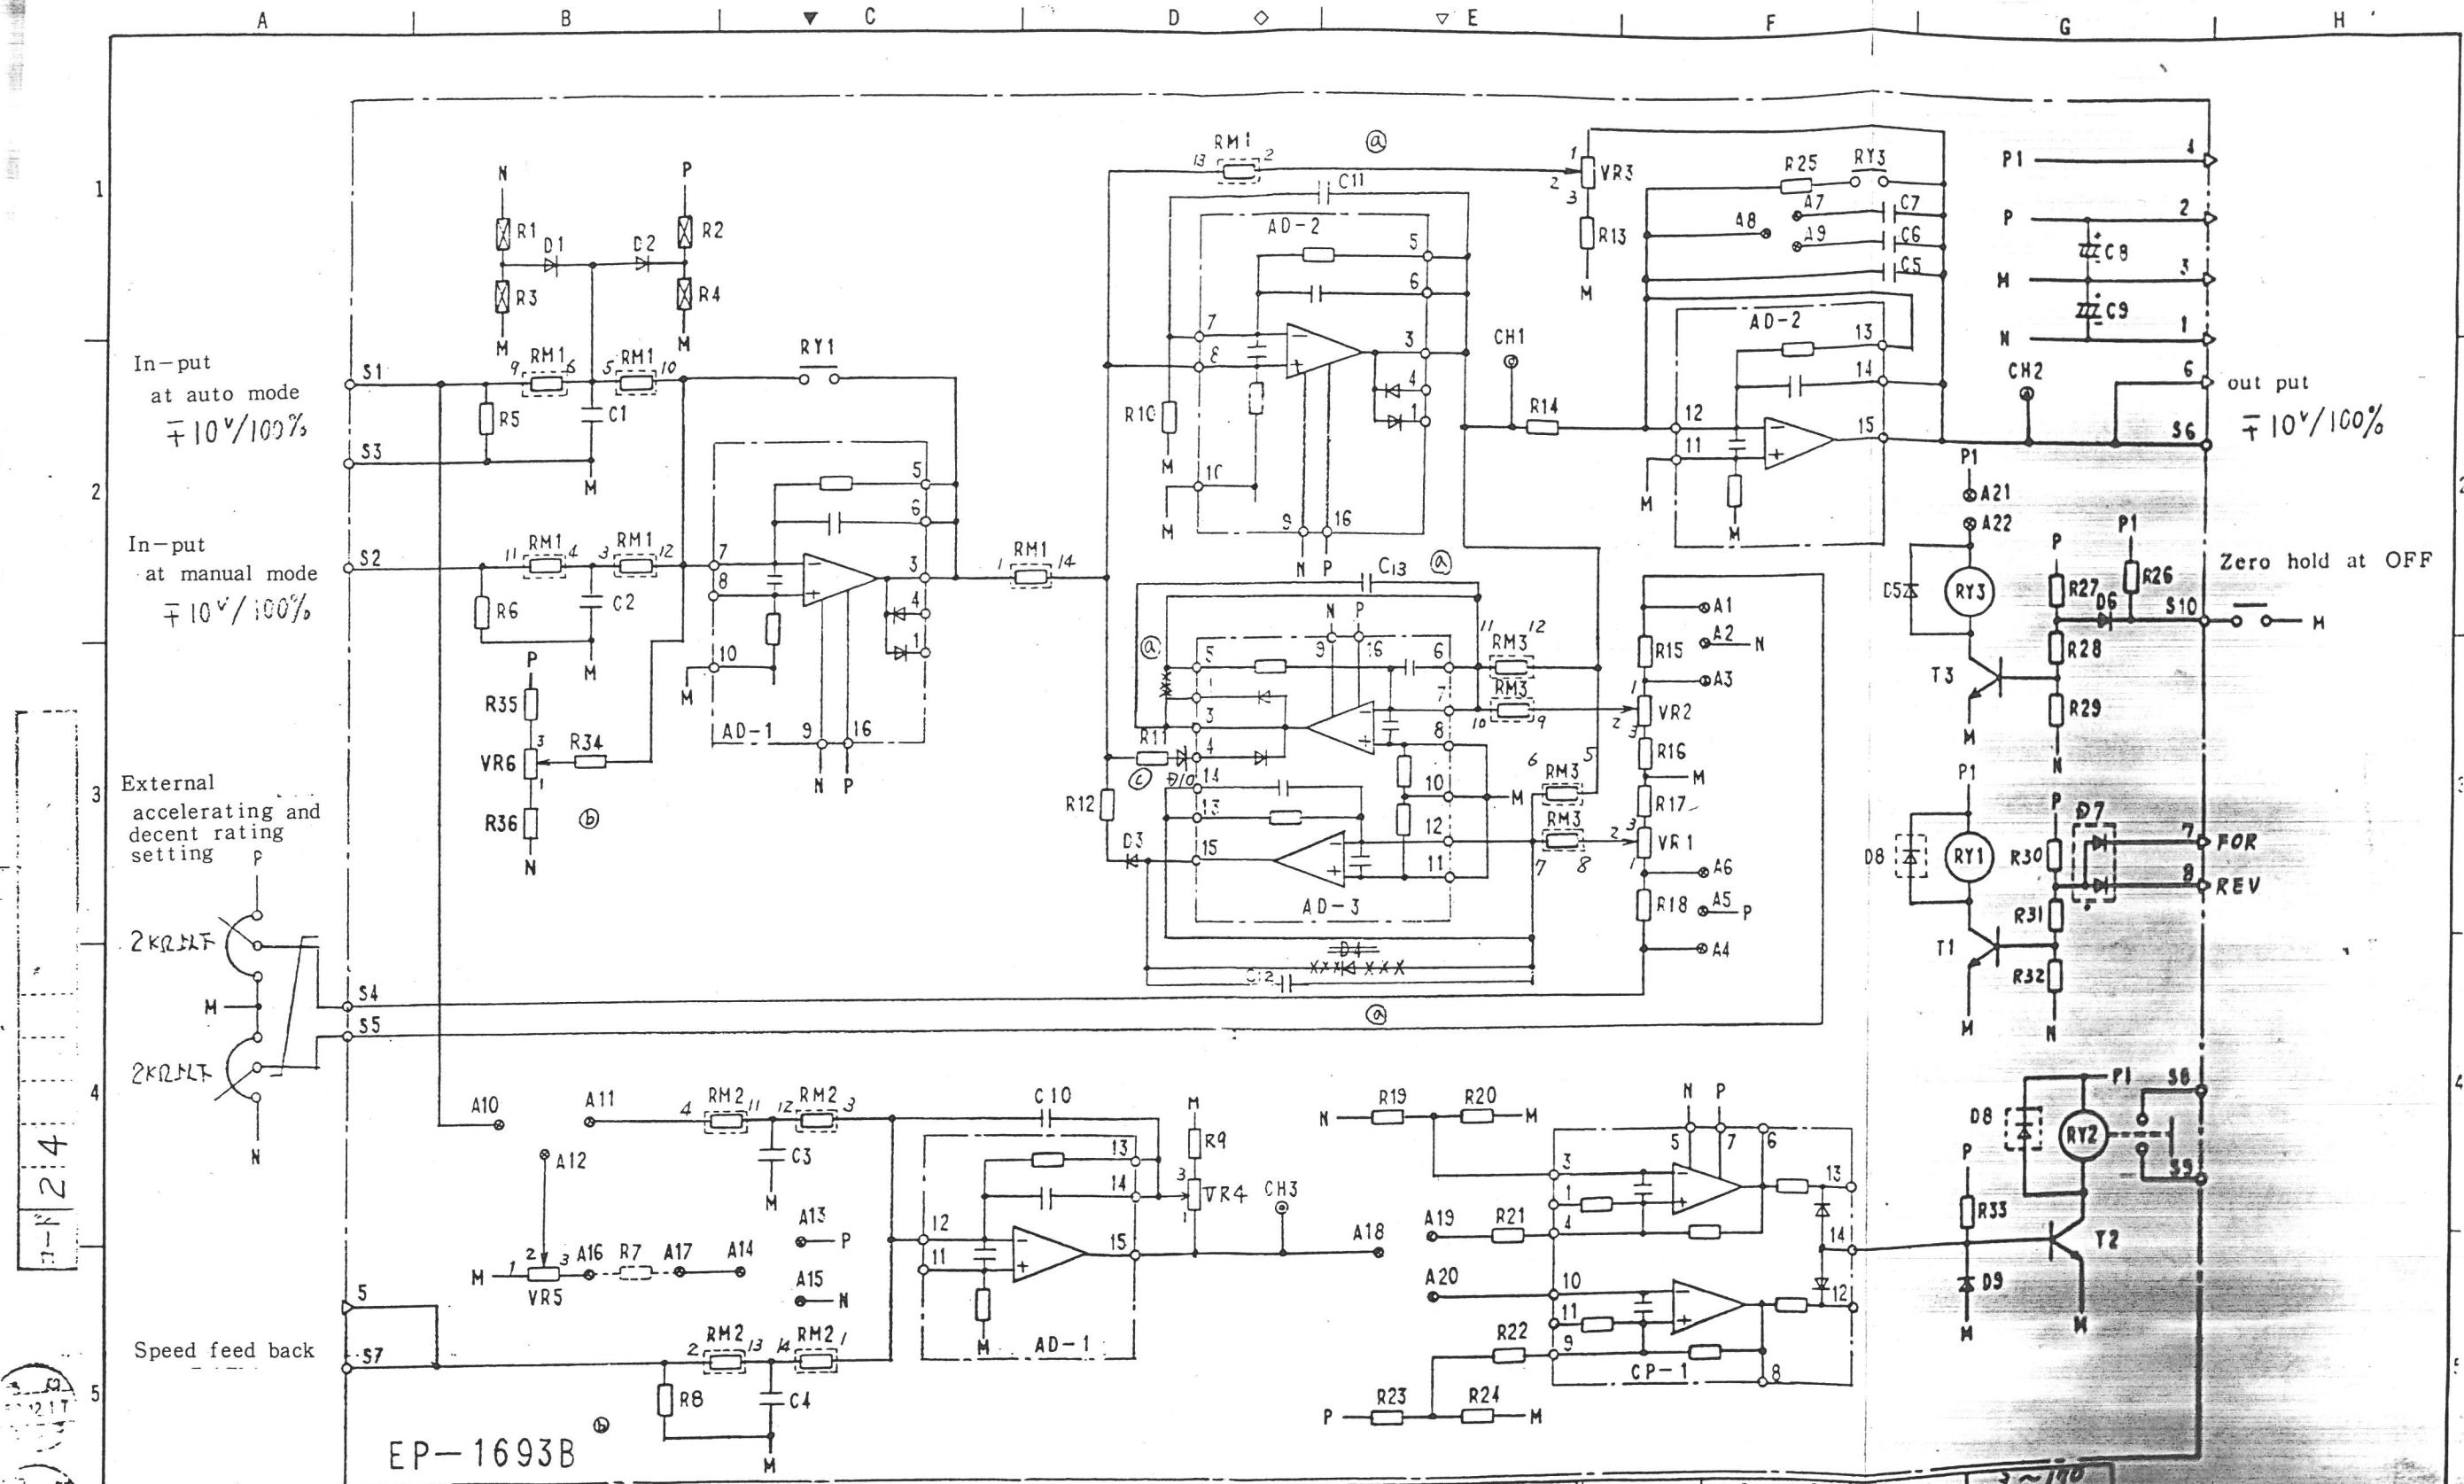

Revisions
a. 7付-D4前除、2170サ-キットAD-3①-⑤開放、J-テ-ンチC11~C13
追加、部品要目表変更 S55-2-18(付上)(高田)
b. S56-11-5 オセレトヨ路用抵抗追加 (R34~R36, VR6) X付


Date 54-9-25
Name 村上
Drawn 54-9-25
Checked 54-10-13
高田


Fuji Electric Co.,Ltd.

Title CDPAO PUJ - 23
HLR, Comparator diagram

HEH4957

標準

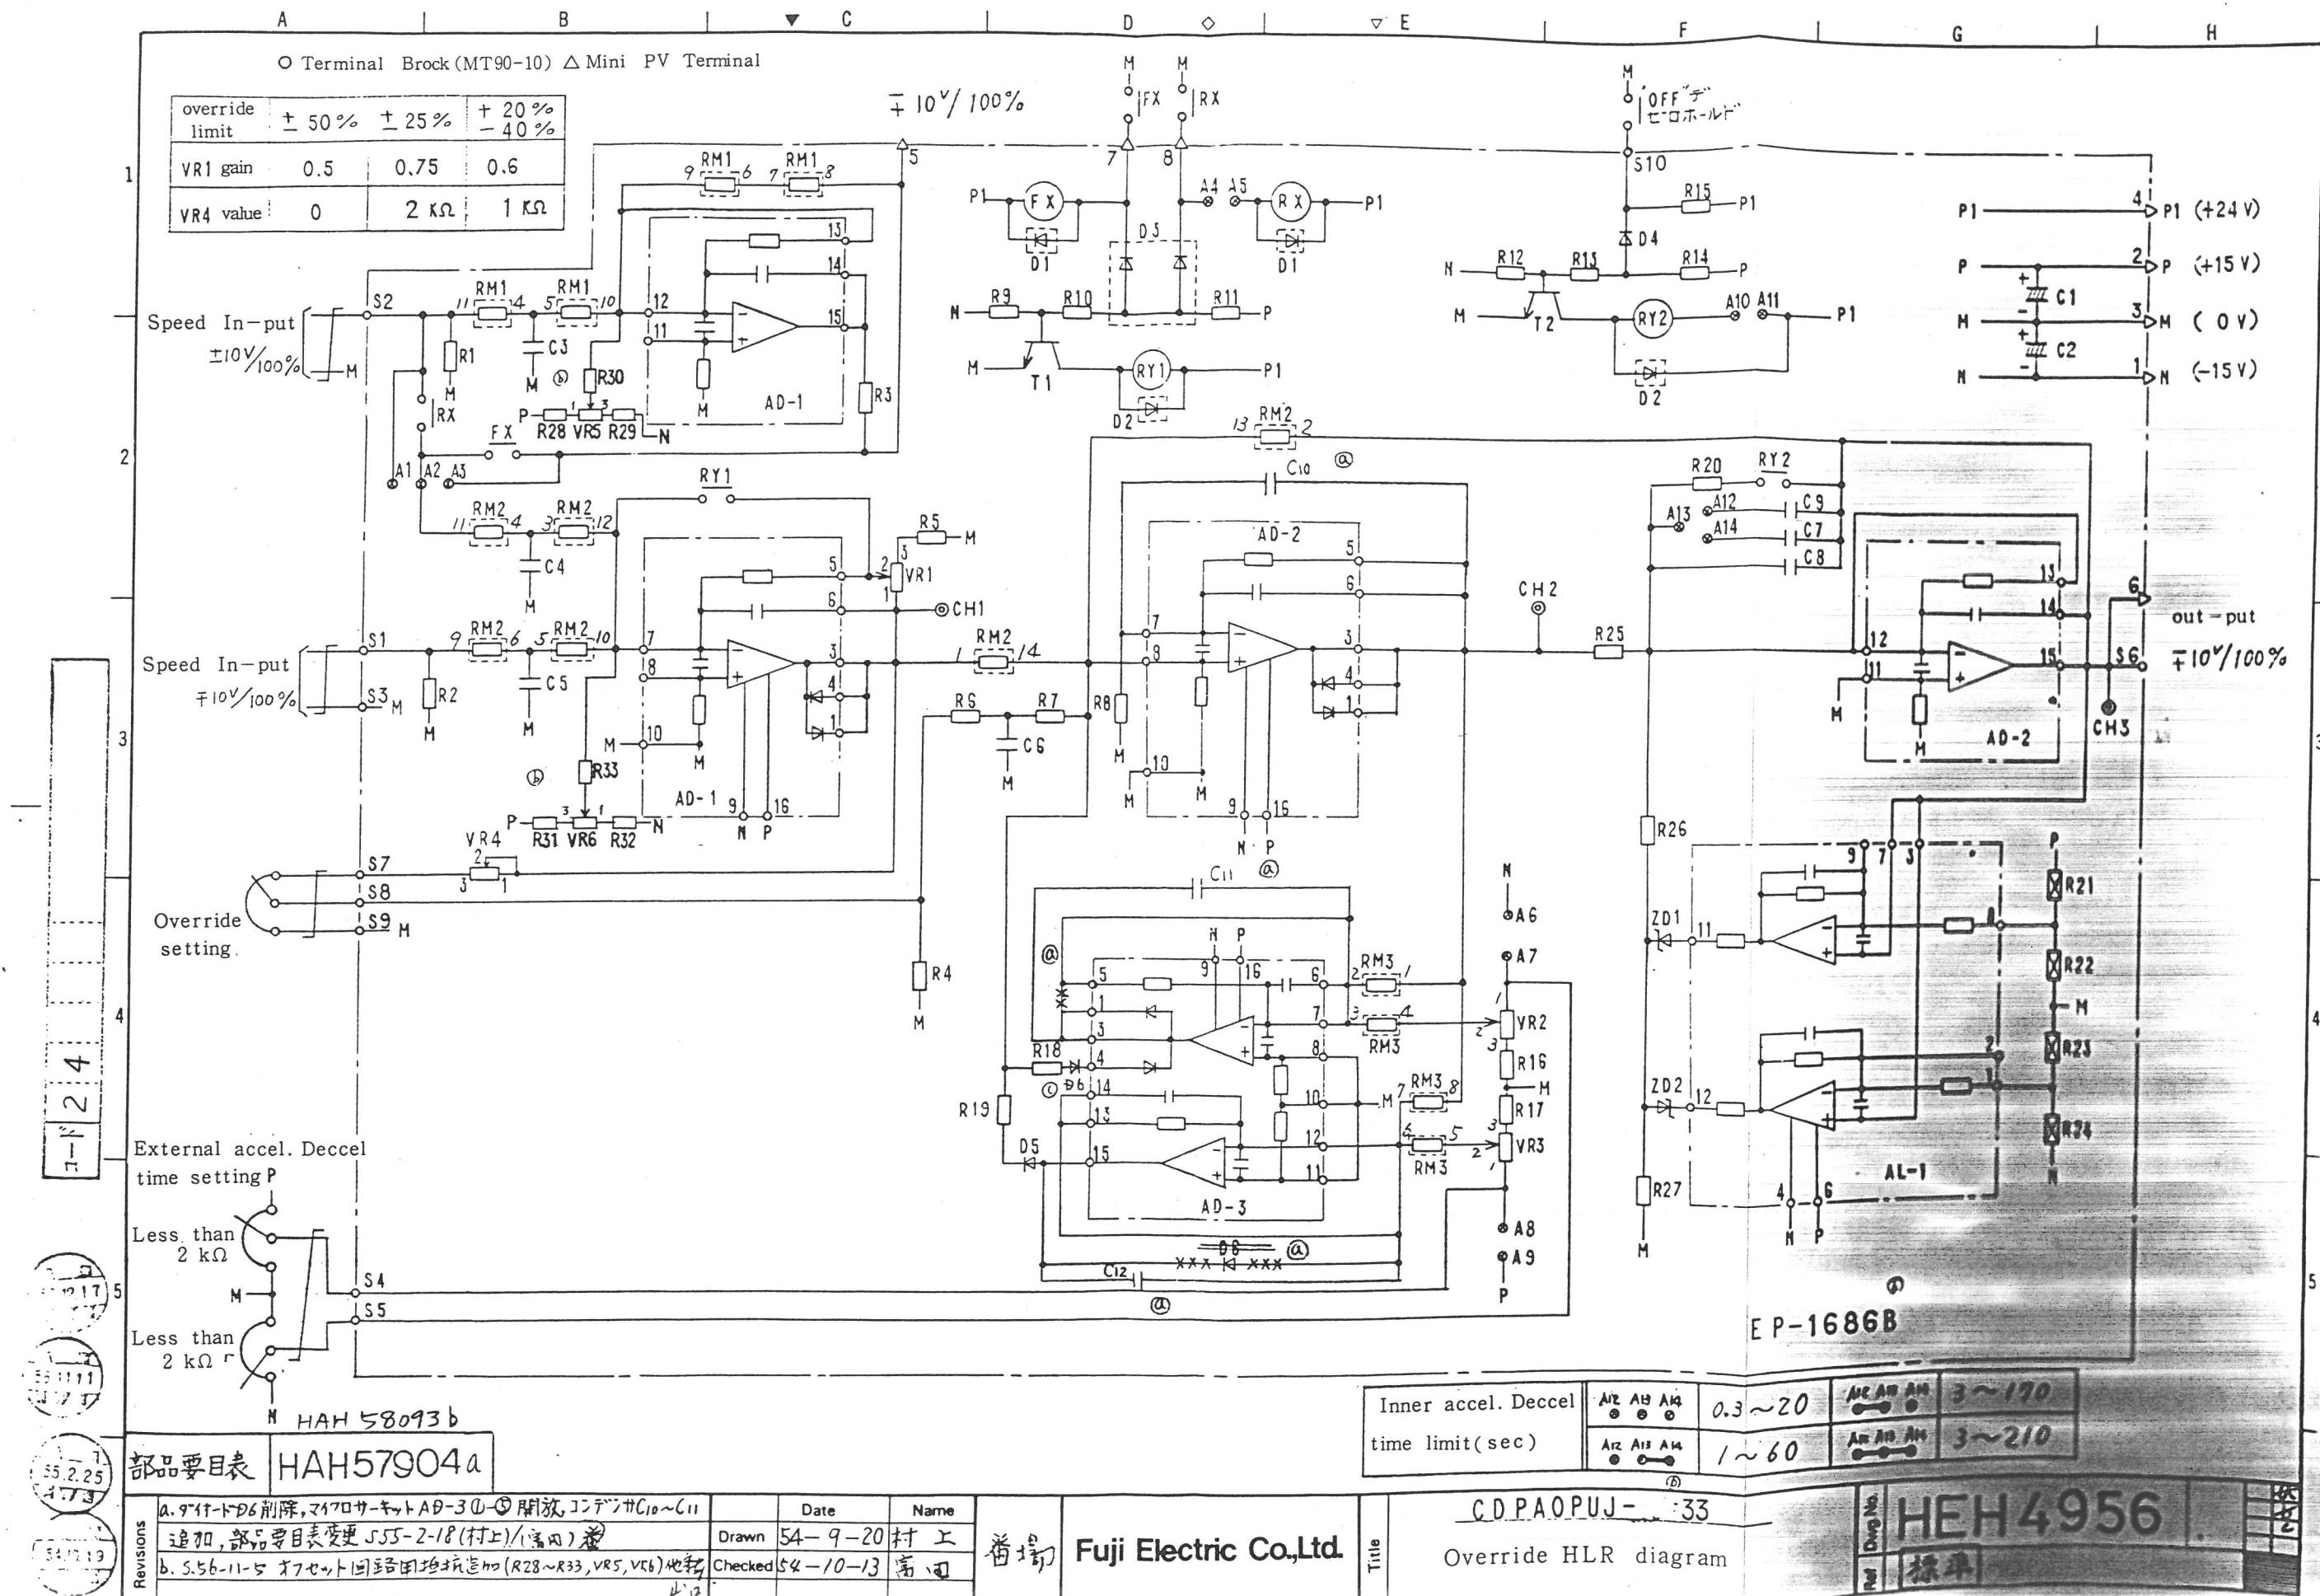

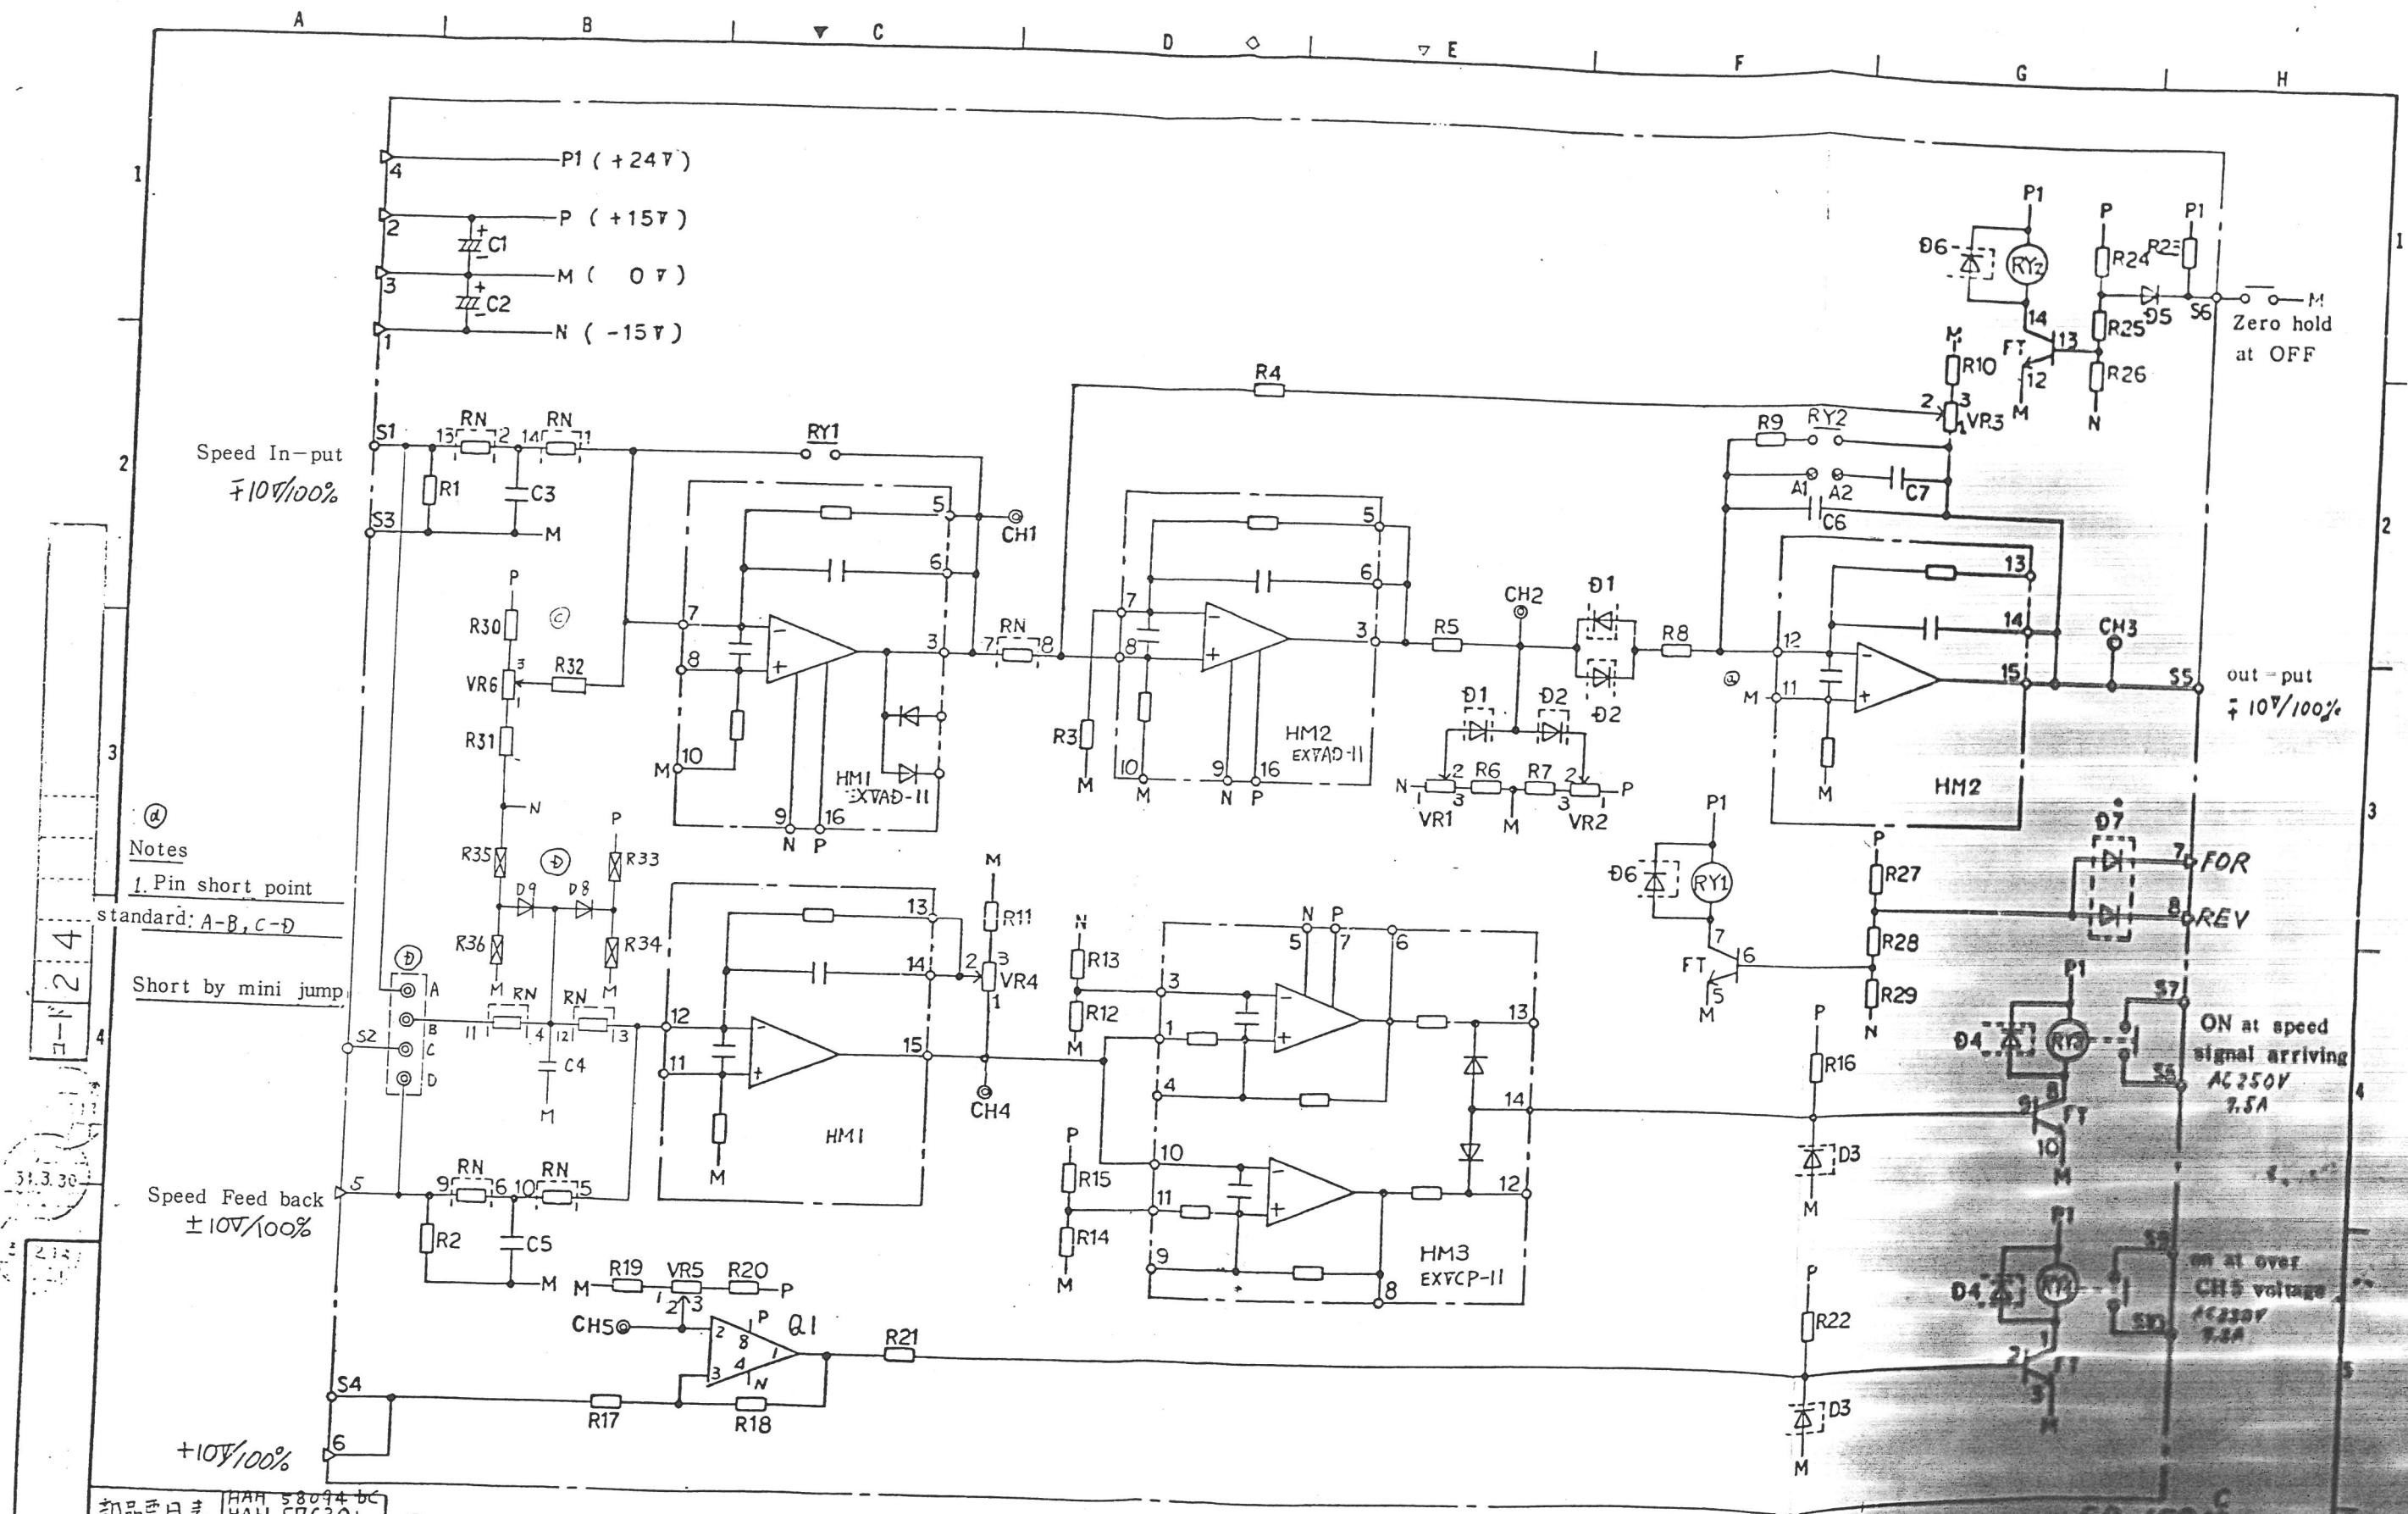

部品要目表

a) HM2-⑪ 7M-

b) EP 音写变

② 入力切換回路追加及び入カリミタ回路変更 S.56.12.1.⑪

二三九 554.3.2
一零 554.3.2

丁 2.55.9.5. (田)
丁 2.55.9.5. (田)

①入力切換回路追加及び入力リミット回路変更 S.56.12.1.⑥

四 醉石椅圖


正統店

DATE NA

154-1-29 高

Fuji Electr
Co Ltd

COPAOPUJ- 742
HLR • Speed arrival sign

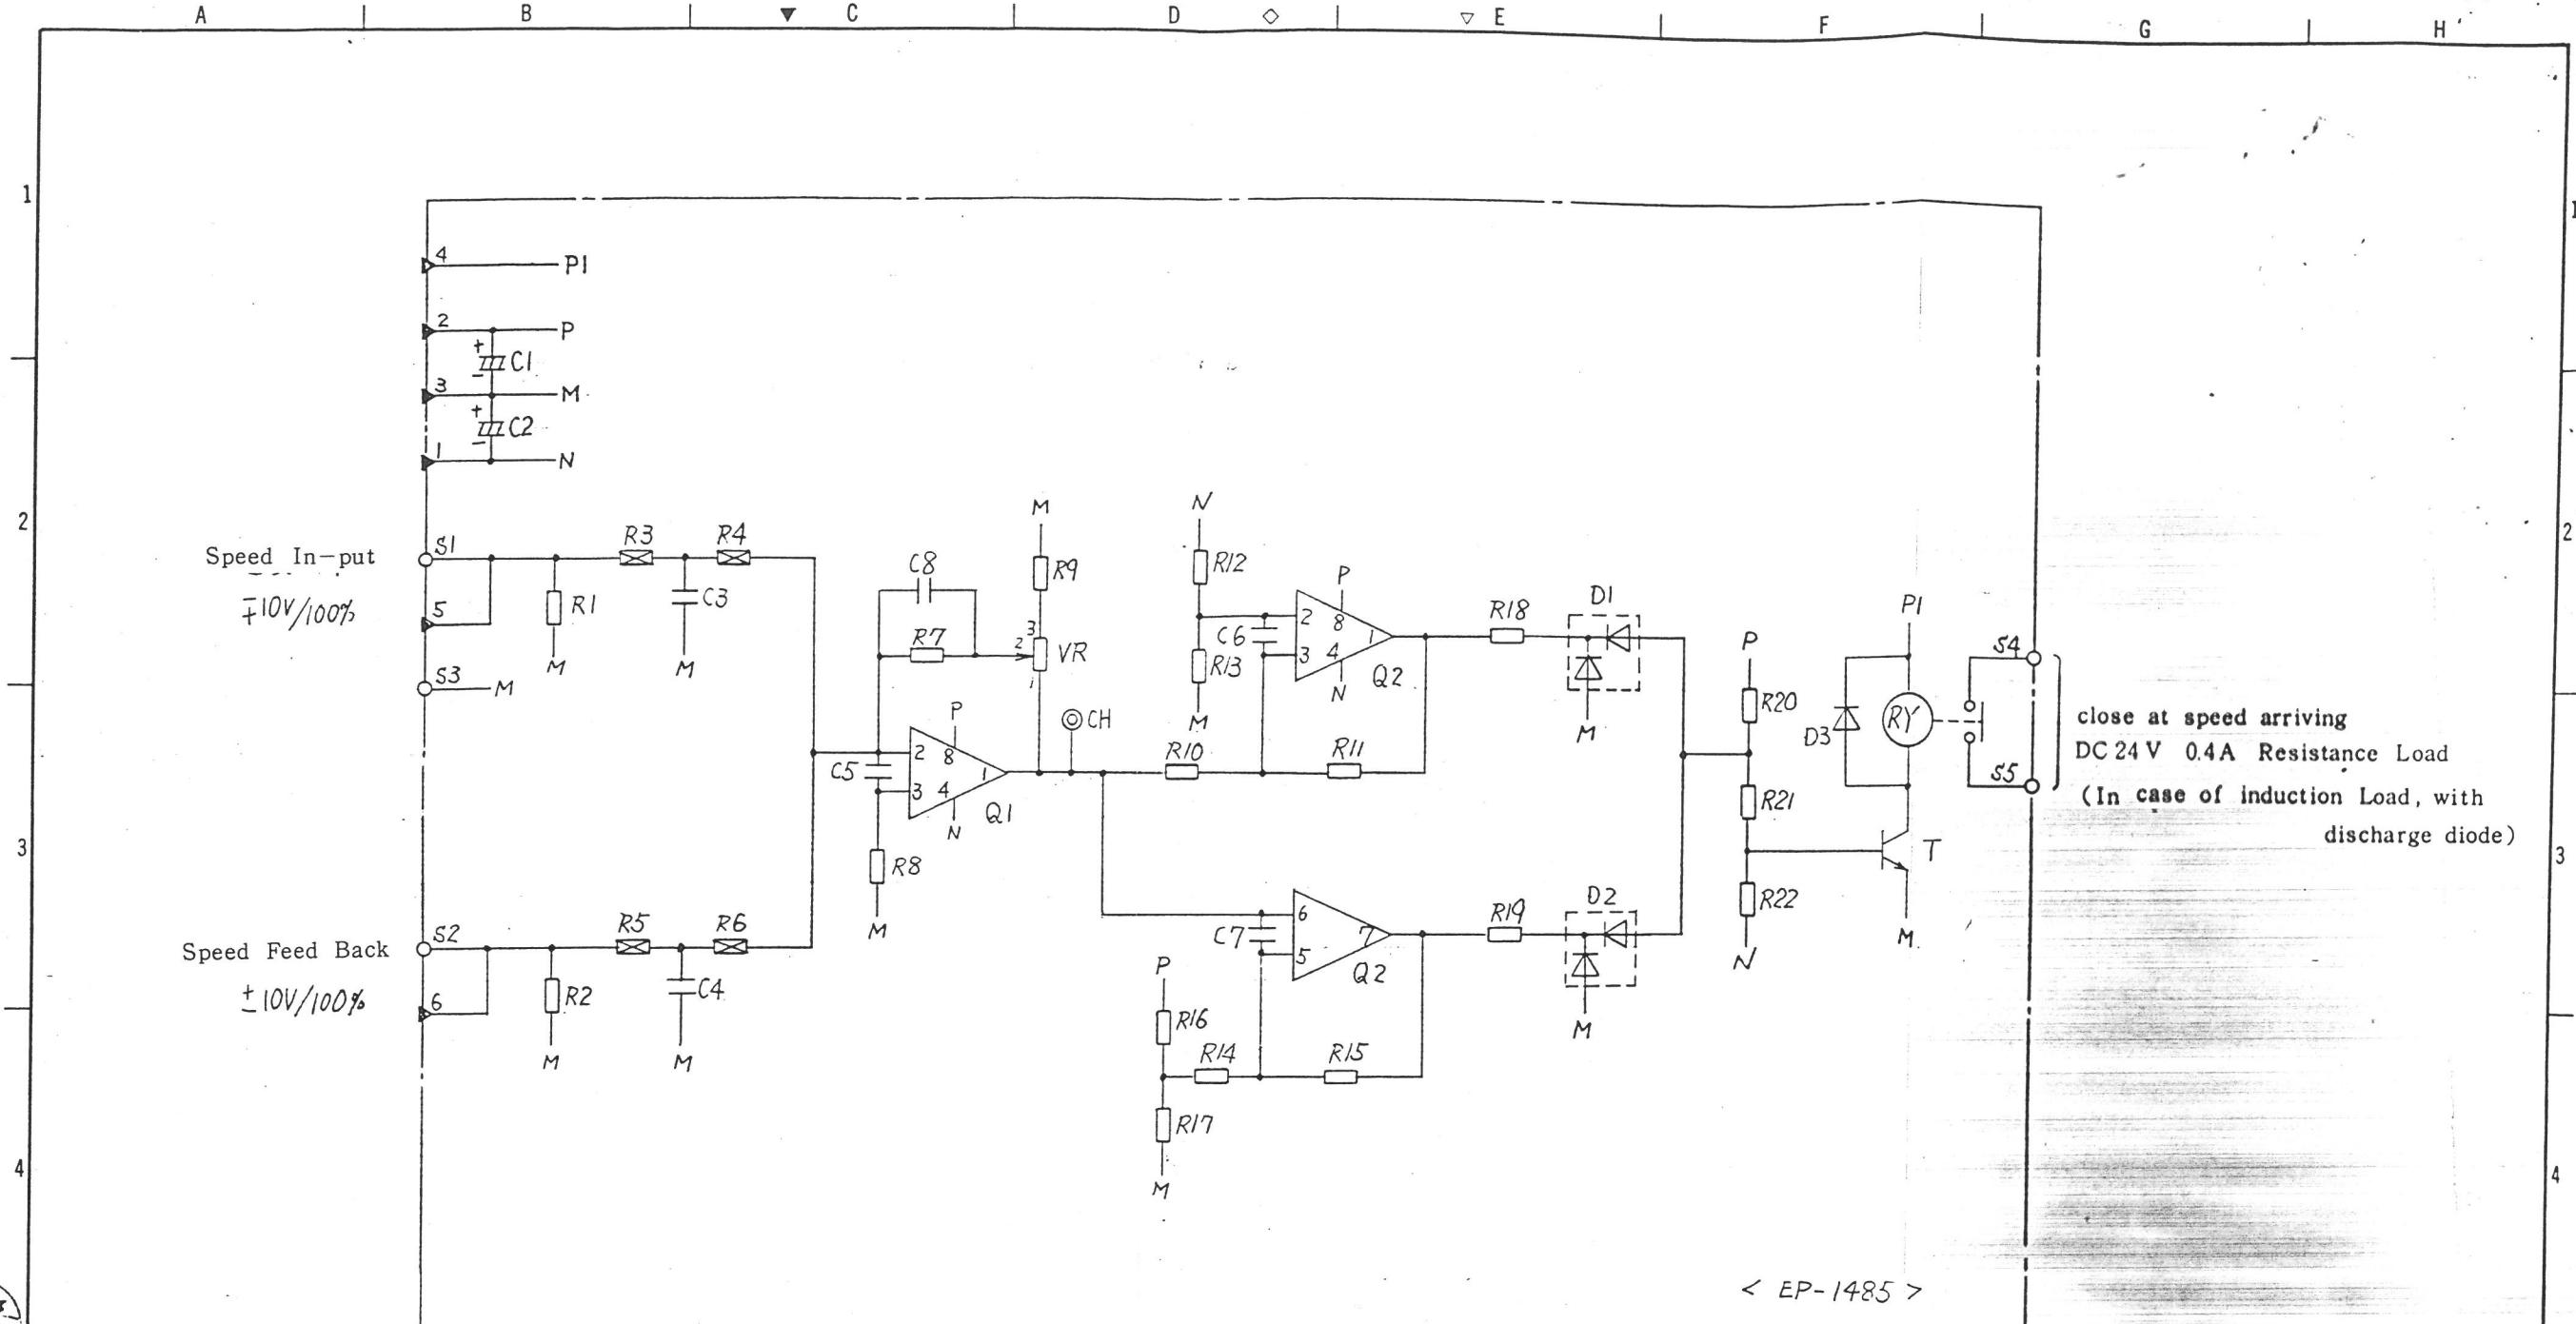

部品目録 HAH 57208

REVISION

DRN. 53-4-27
GHD. 53-5-19


DATE
NAME
FUJI ELECTRIC
CO., LTD.


CDPA0LKX-41
Speed arrival signal diagram

HEH 4870

G

標準圖

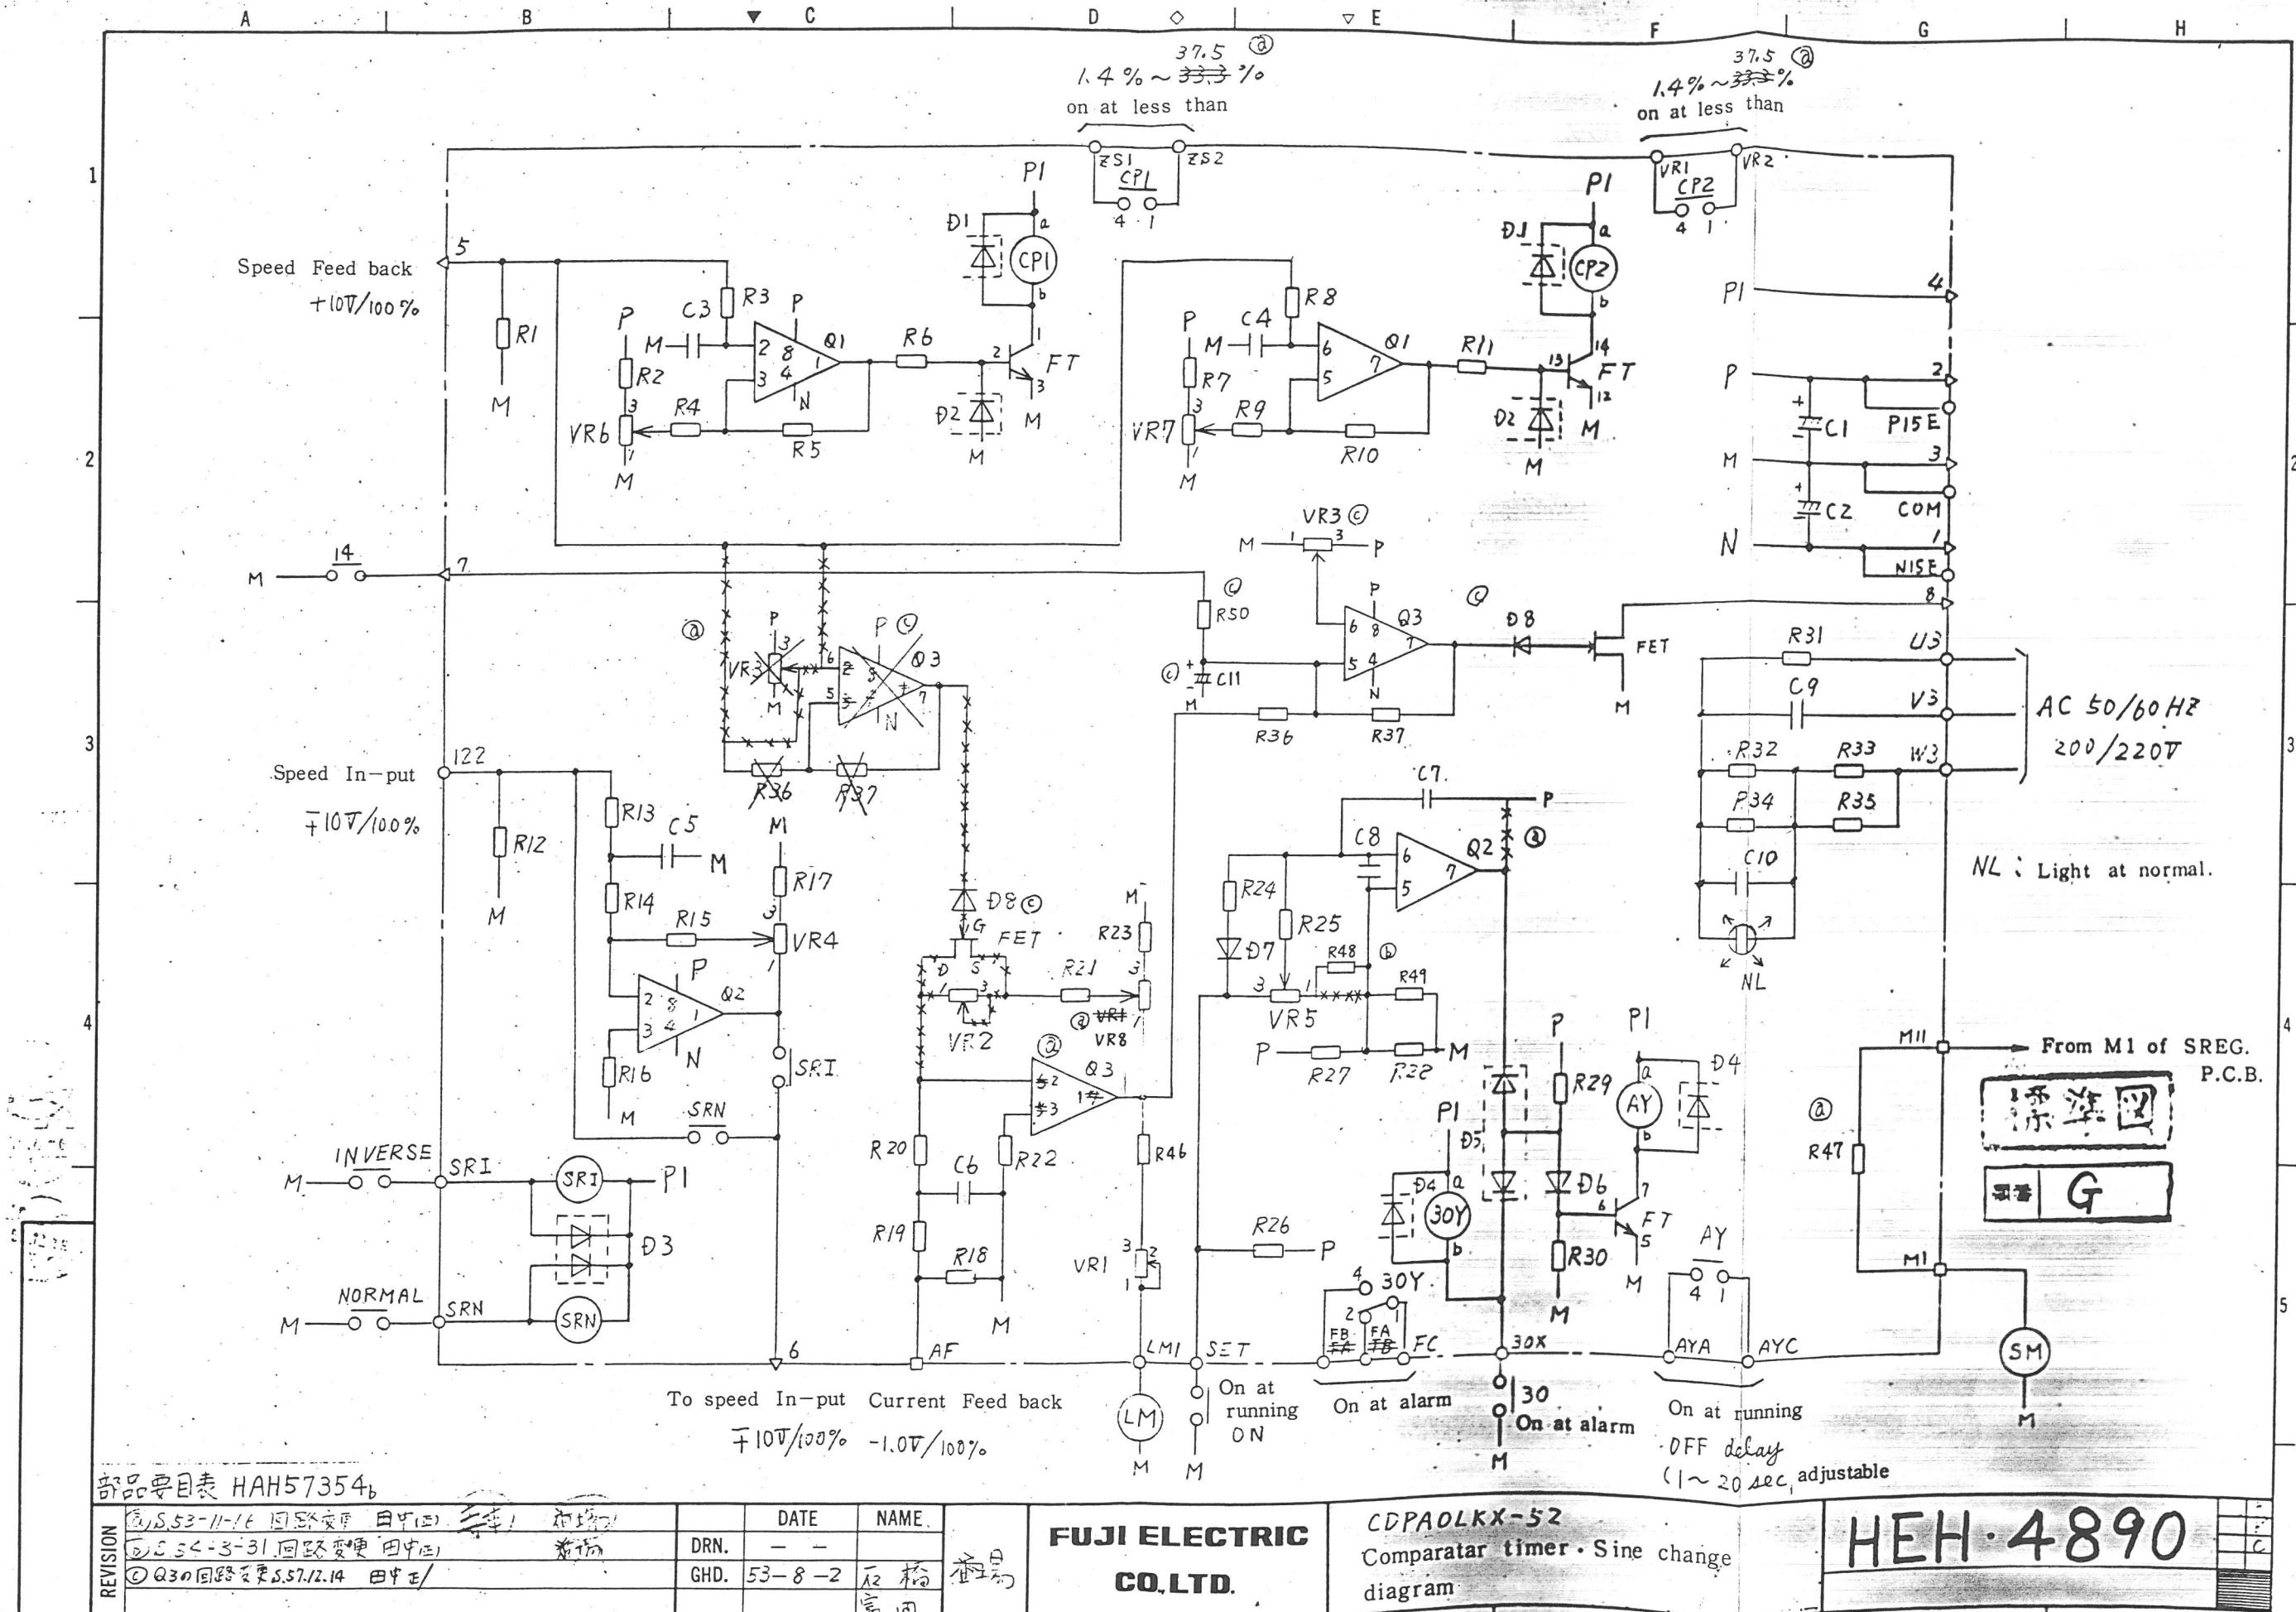

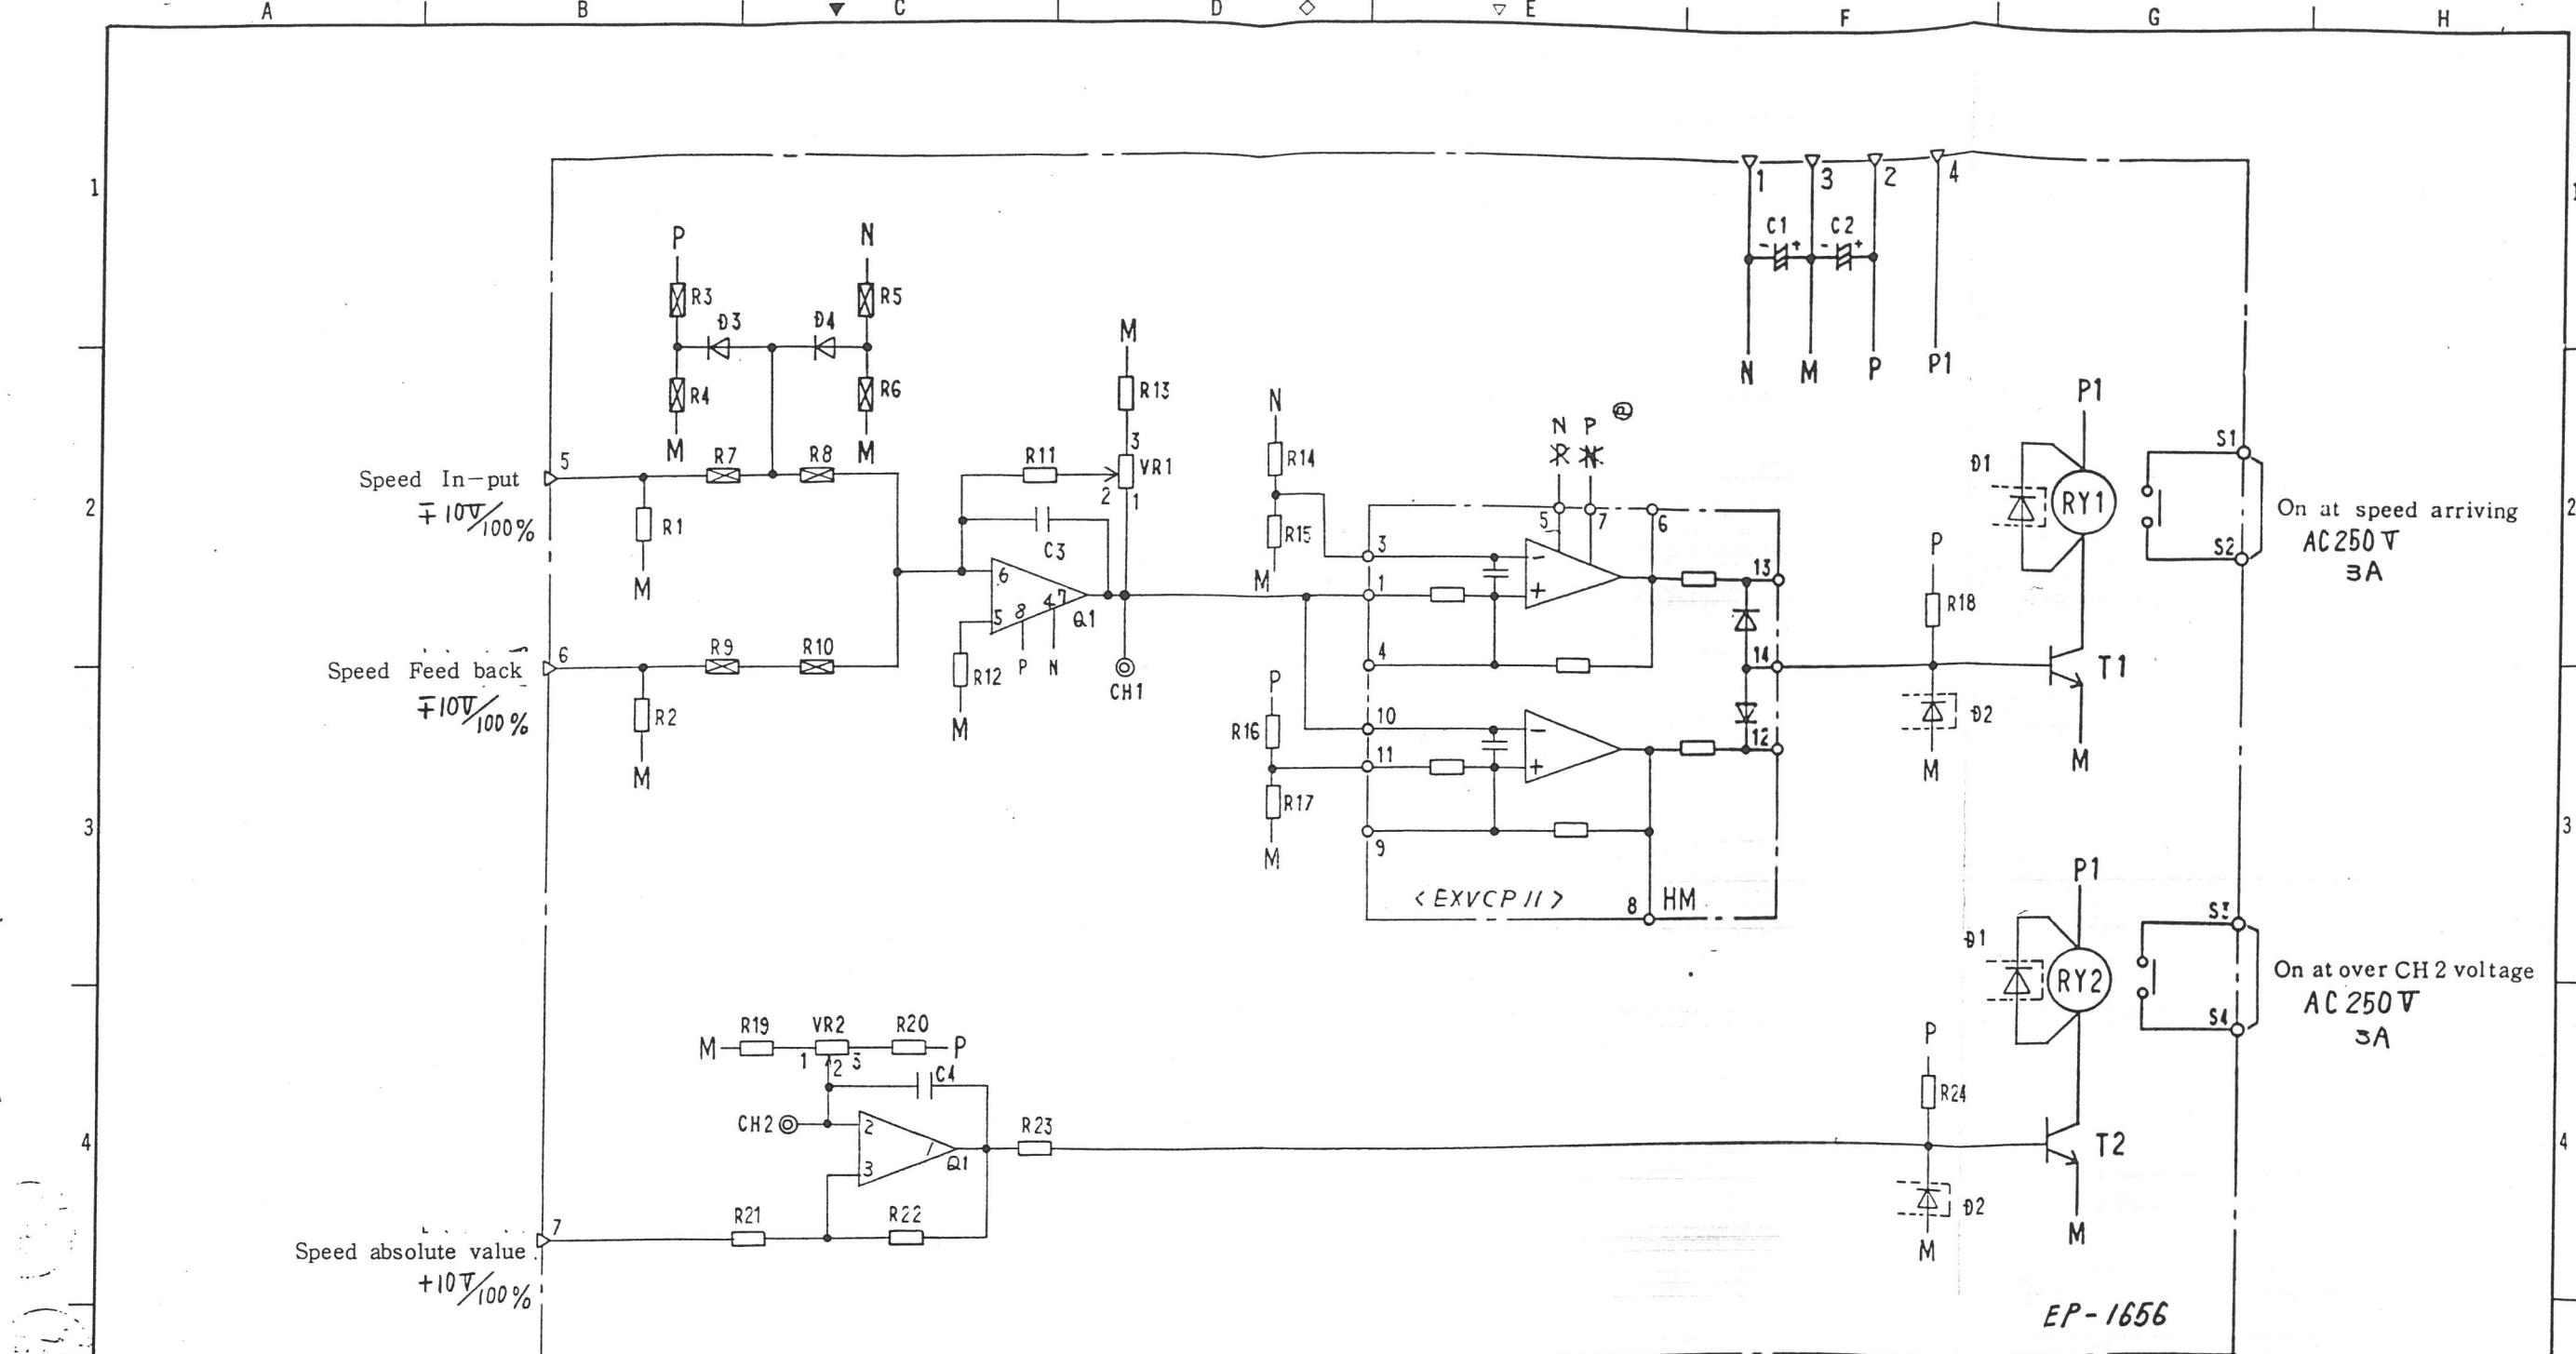

○ : Outside line terminal

△ : Mini PV terminal

標準圖

REVISION a) 5545 2-2-2-B 安全 (高) (石板)


DATE NAME
DRN. — —
GHD. 54-7-25 I. 柏


Fuji Electric
Co.,Ltd.


CDPAOLKX-561
Speed arrival signal
Comparator diagram


HEH 4952

A | B | C | D | E | F | G | H

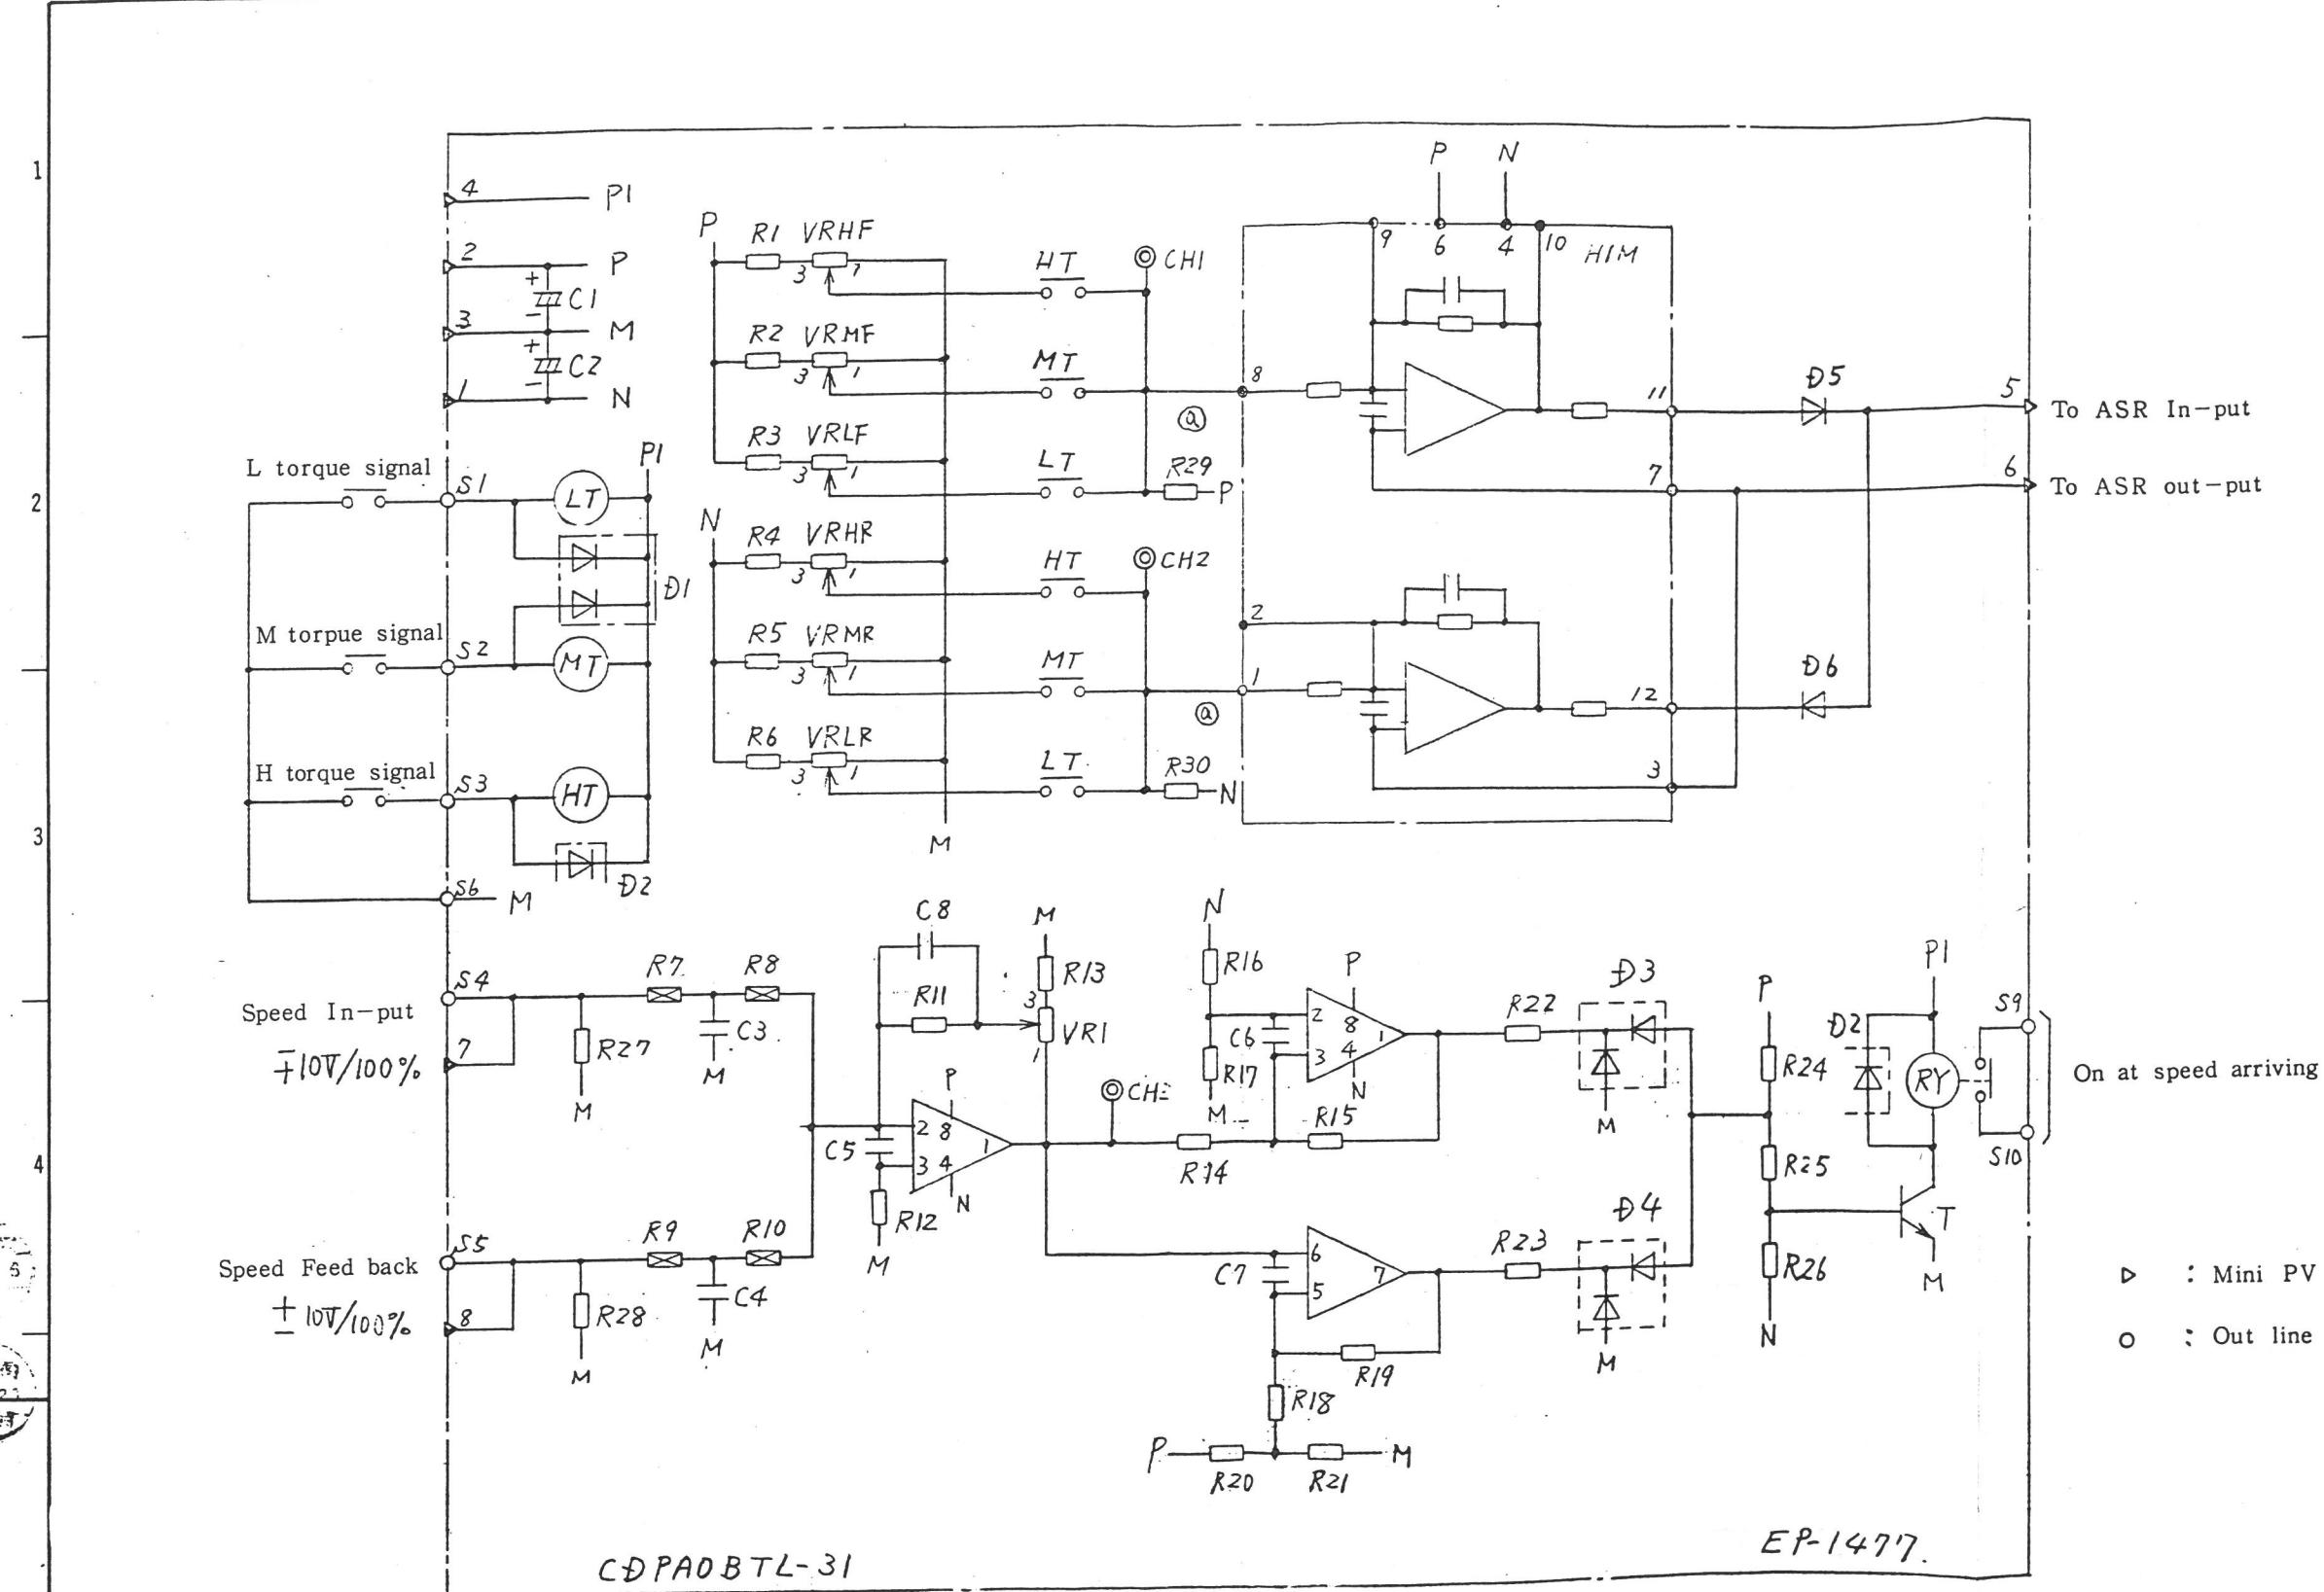


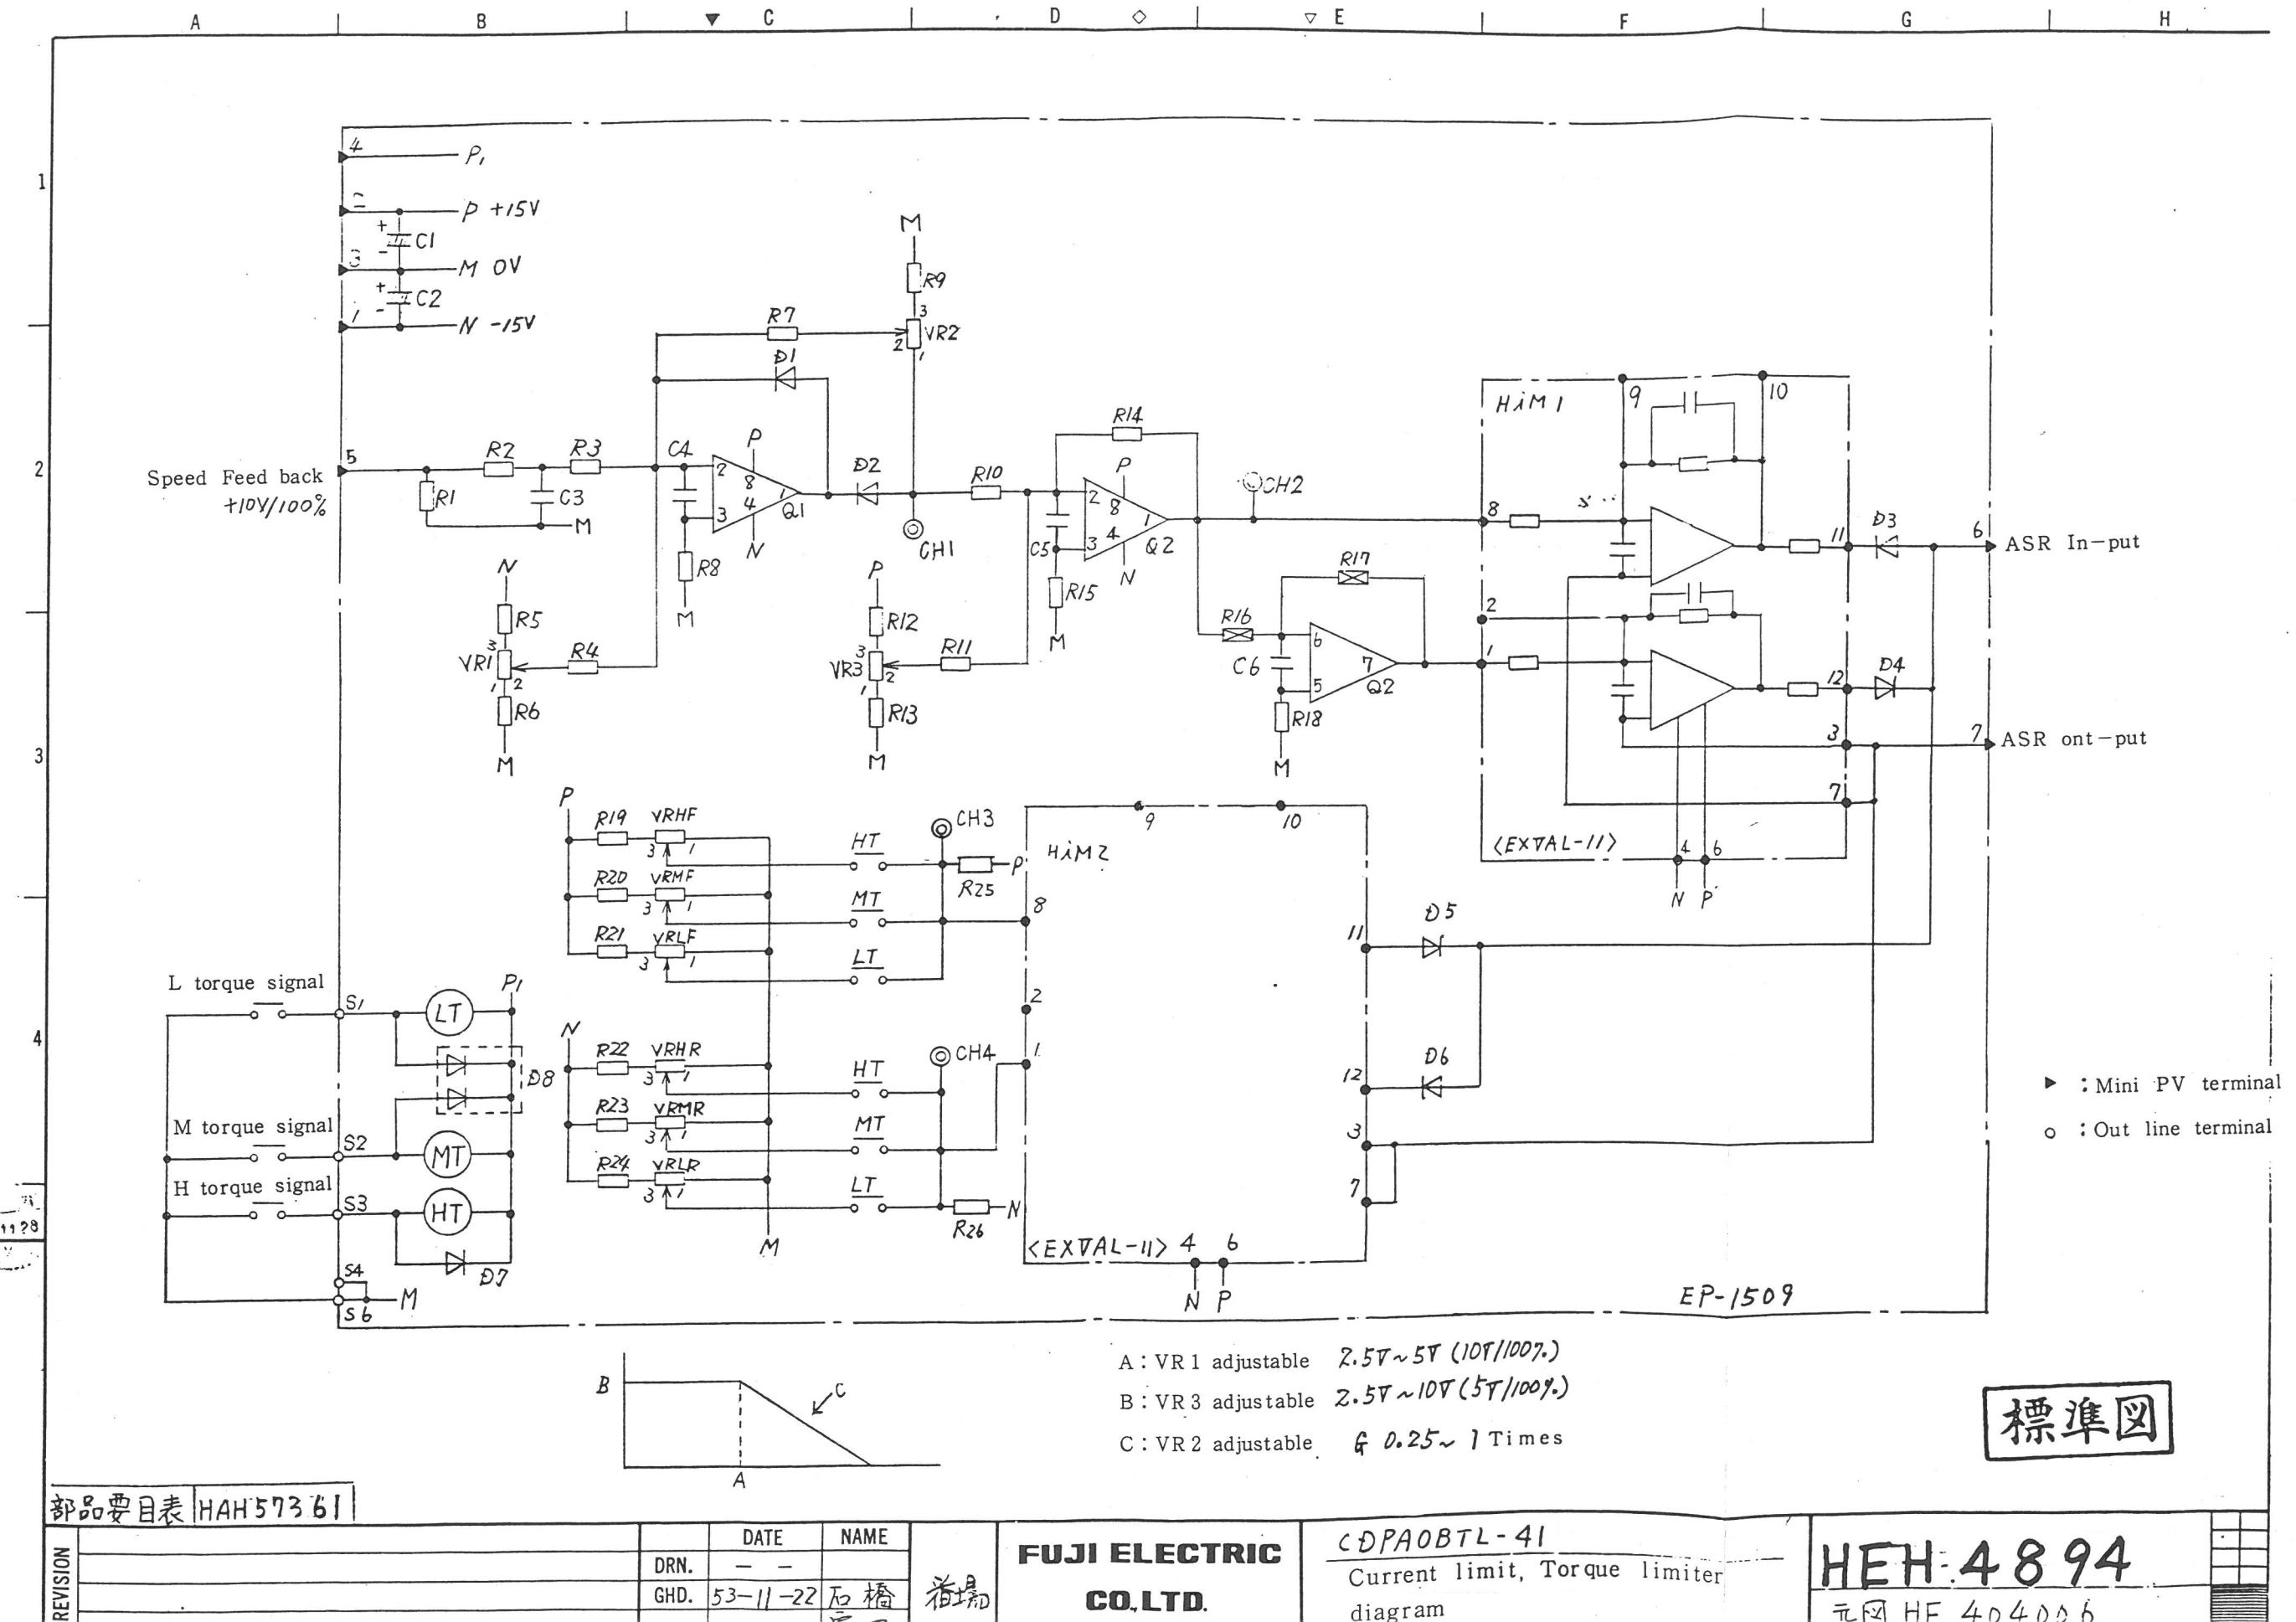

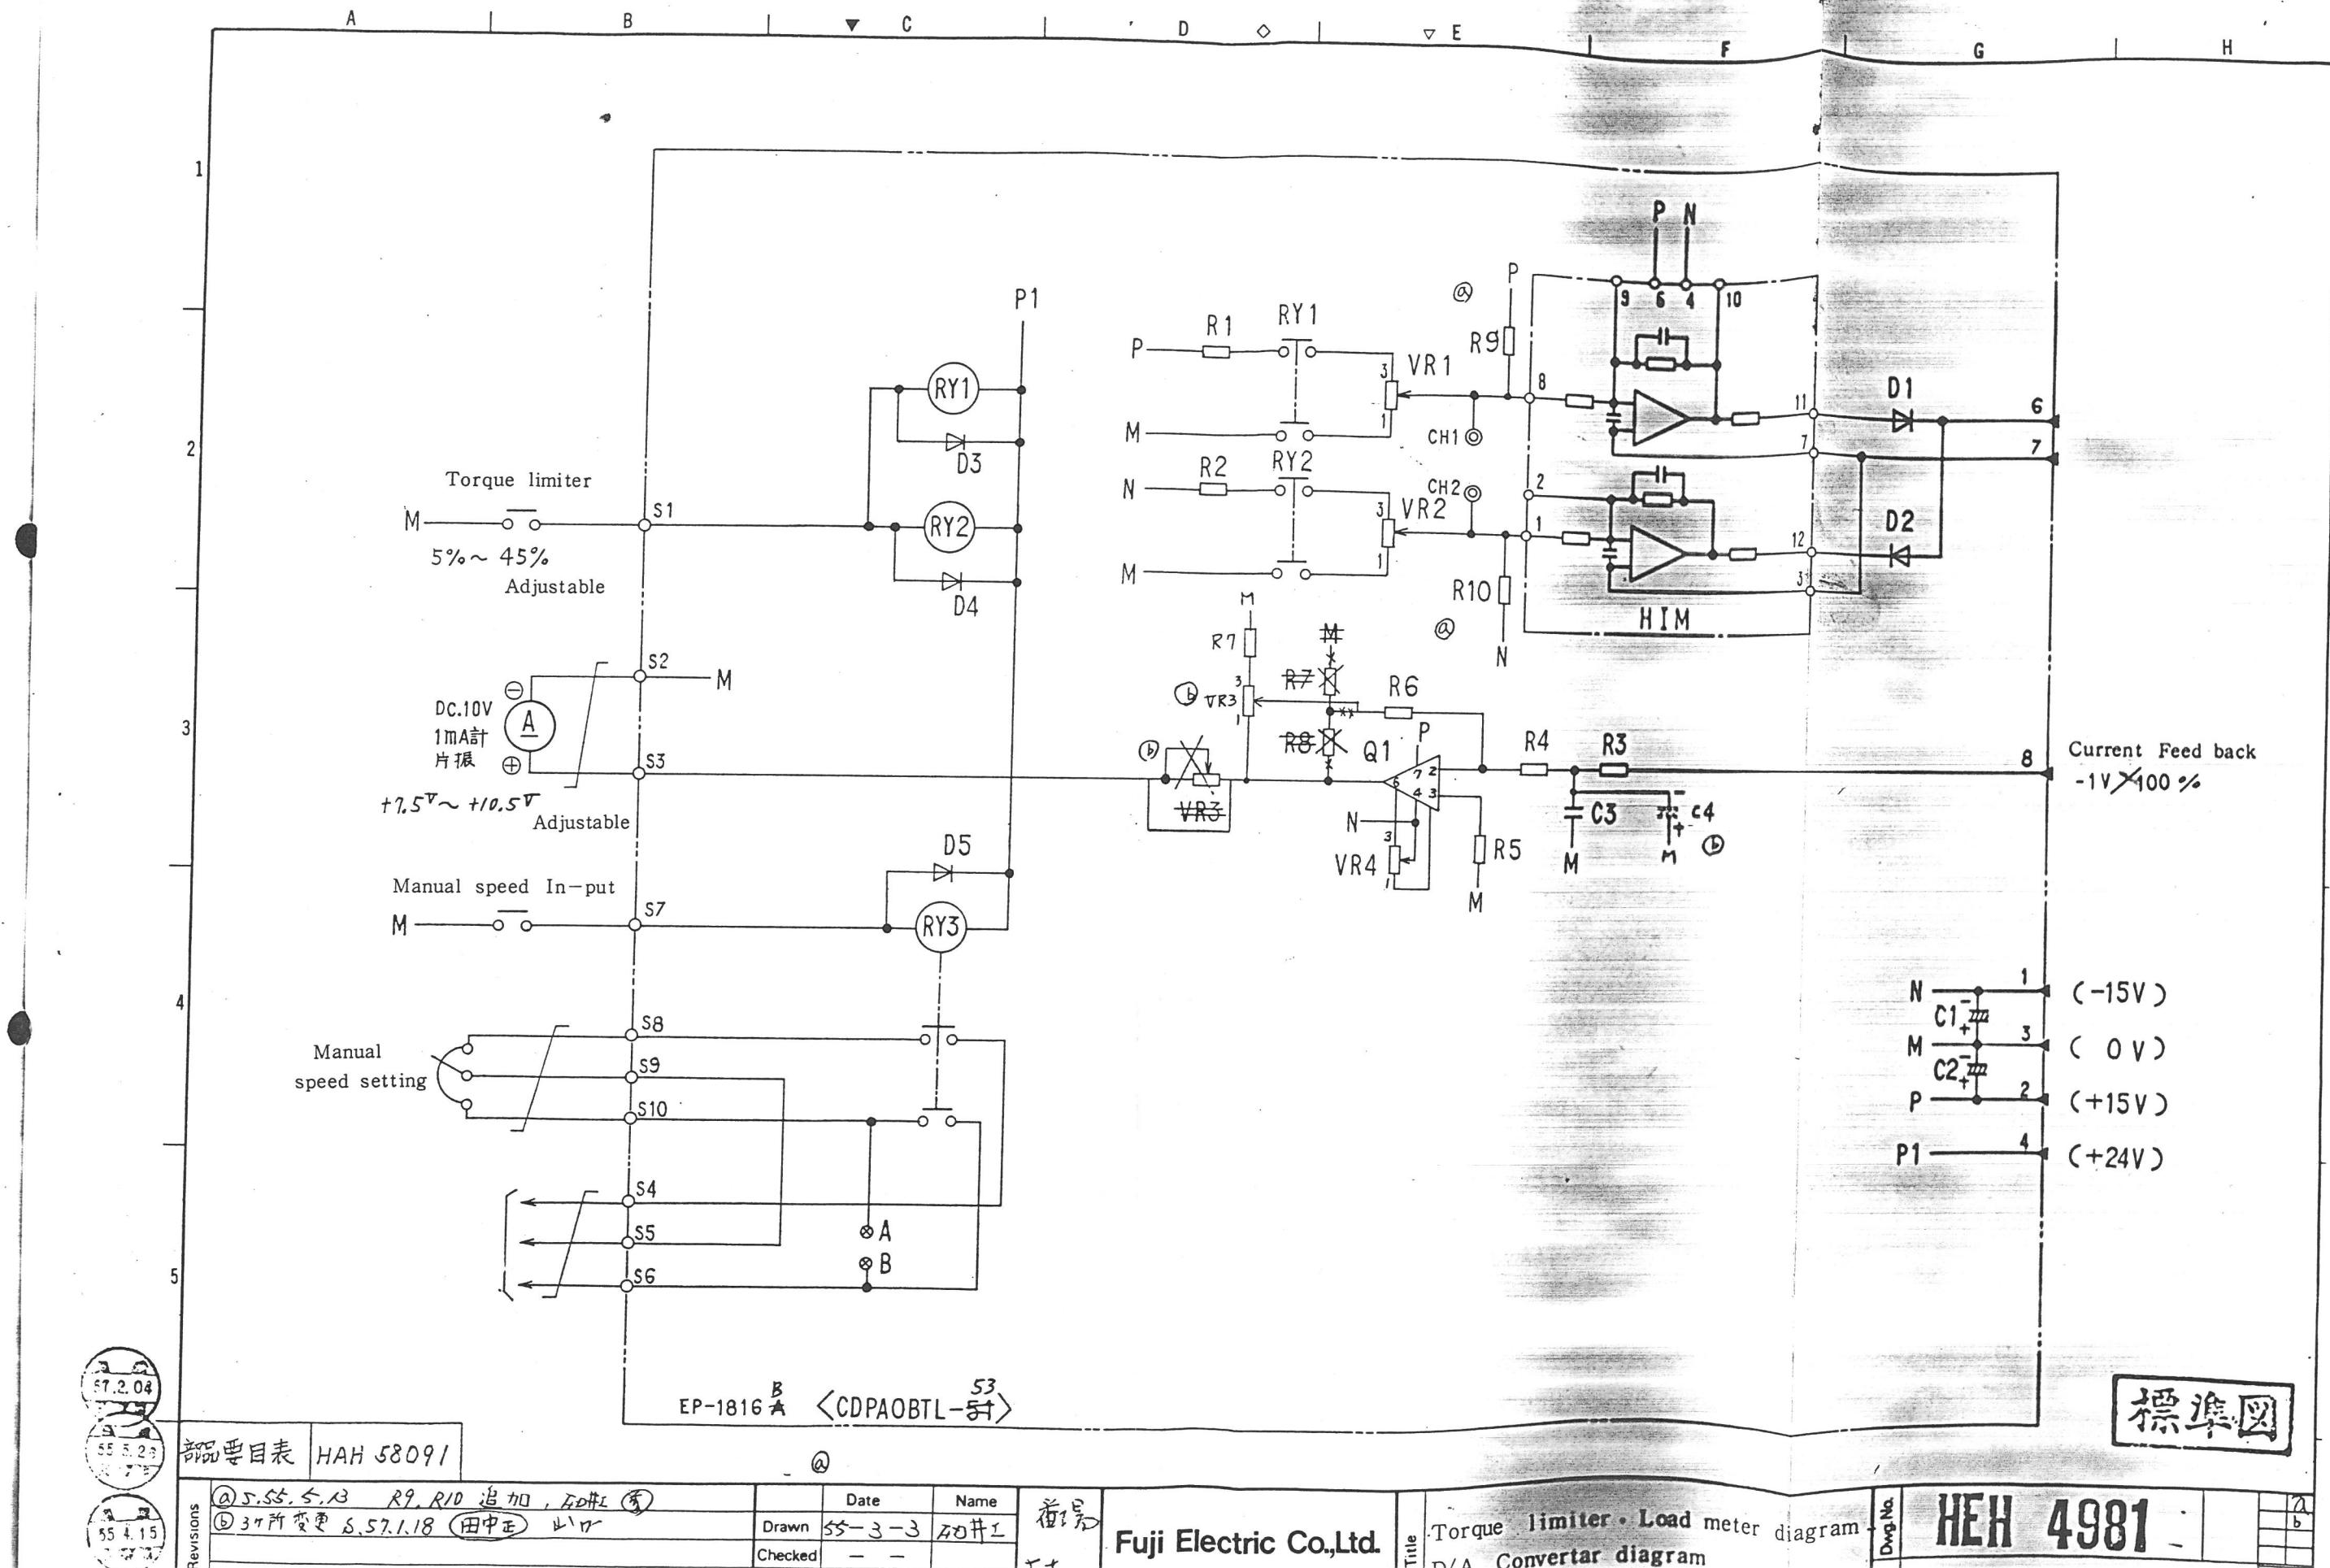

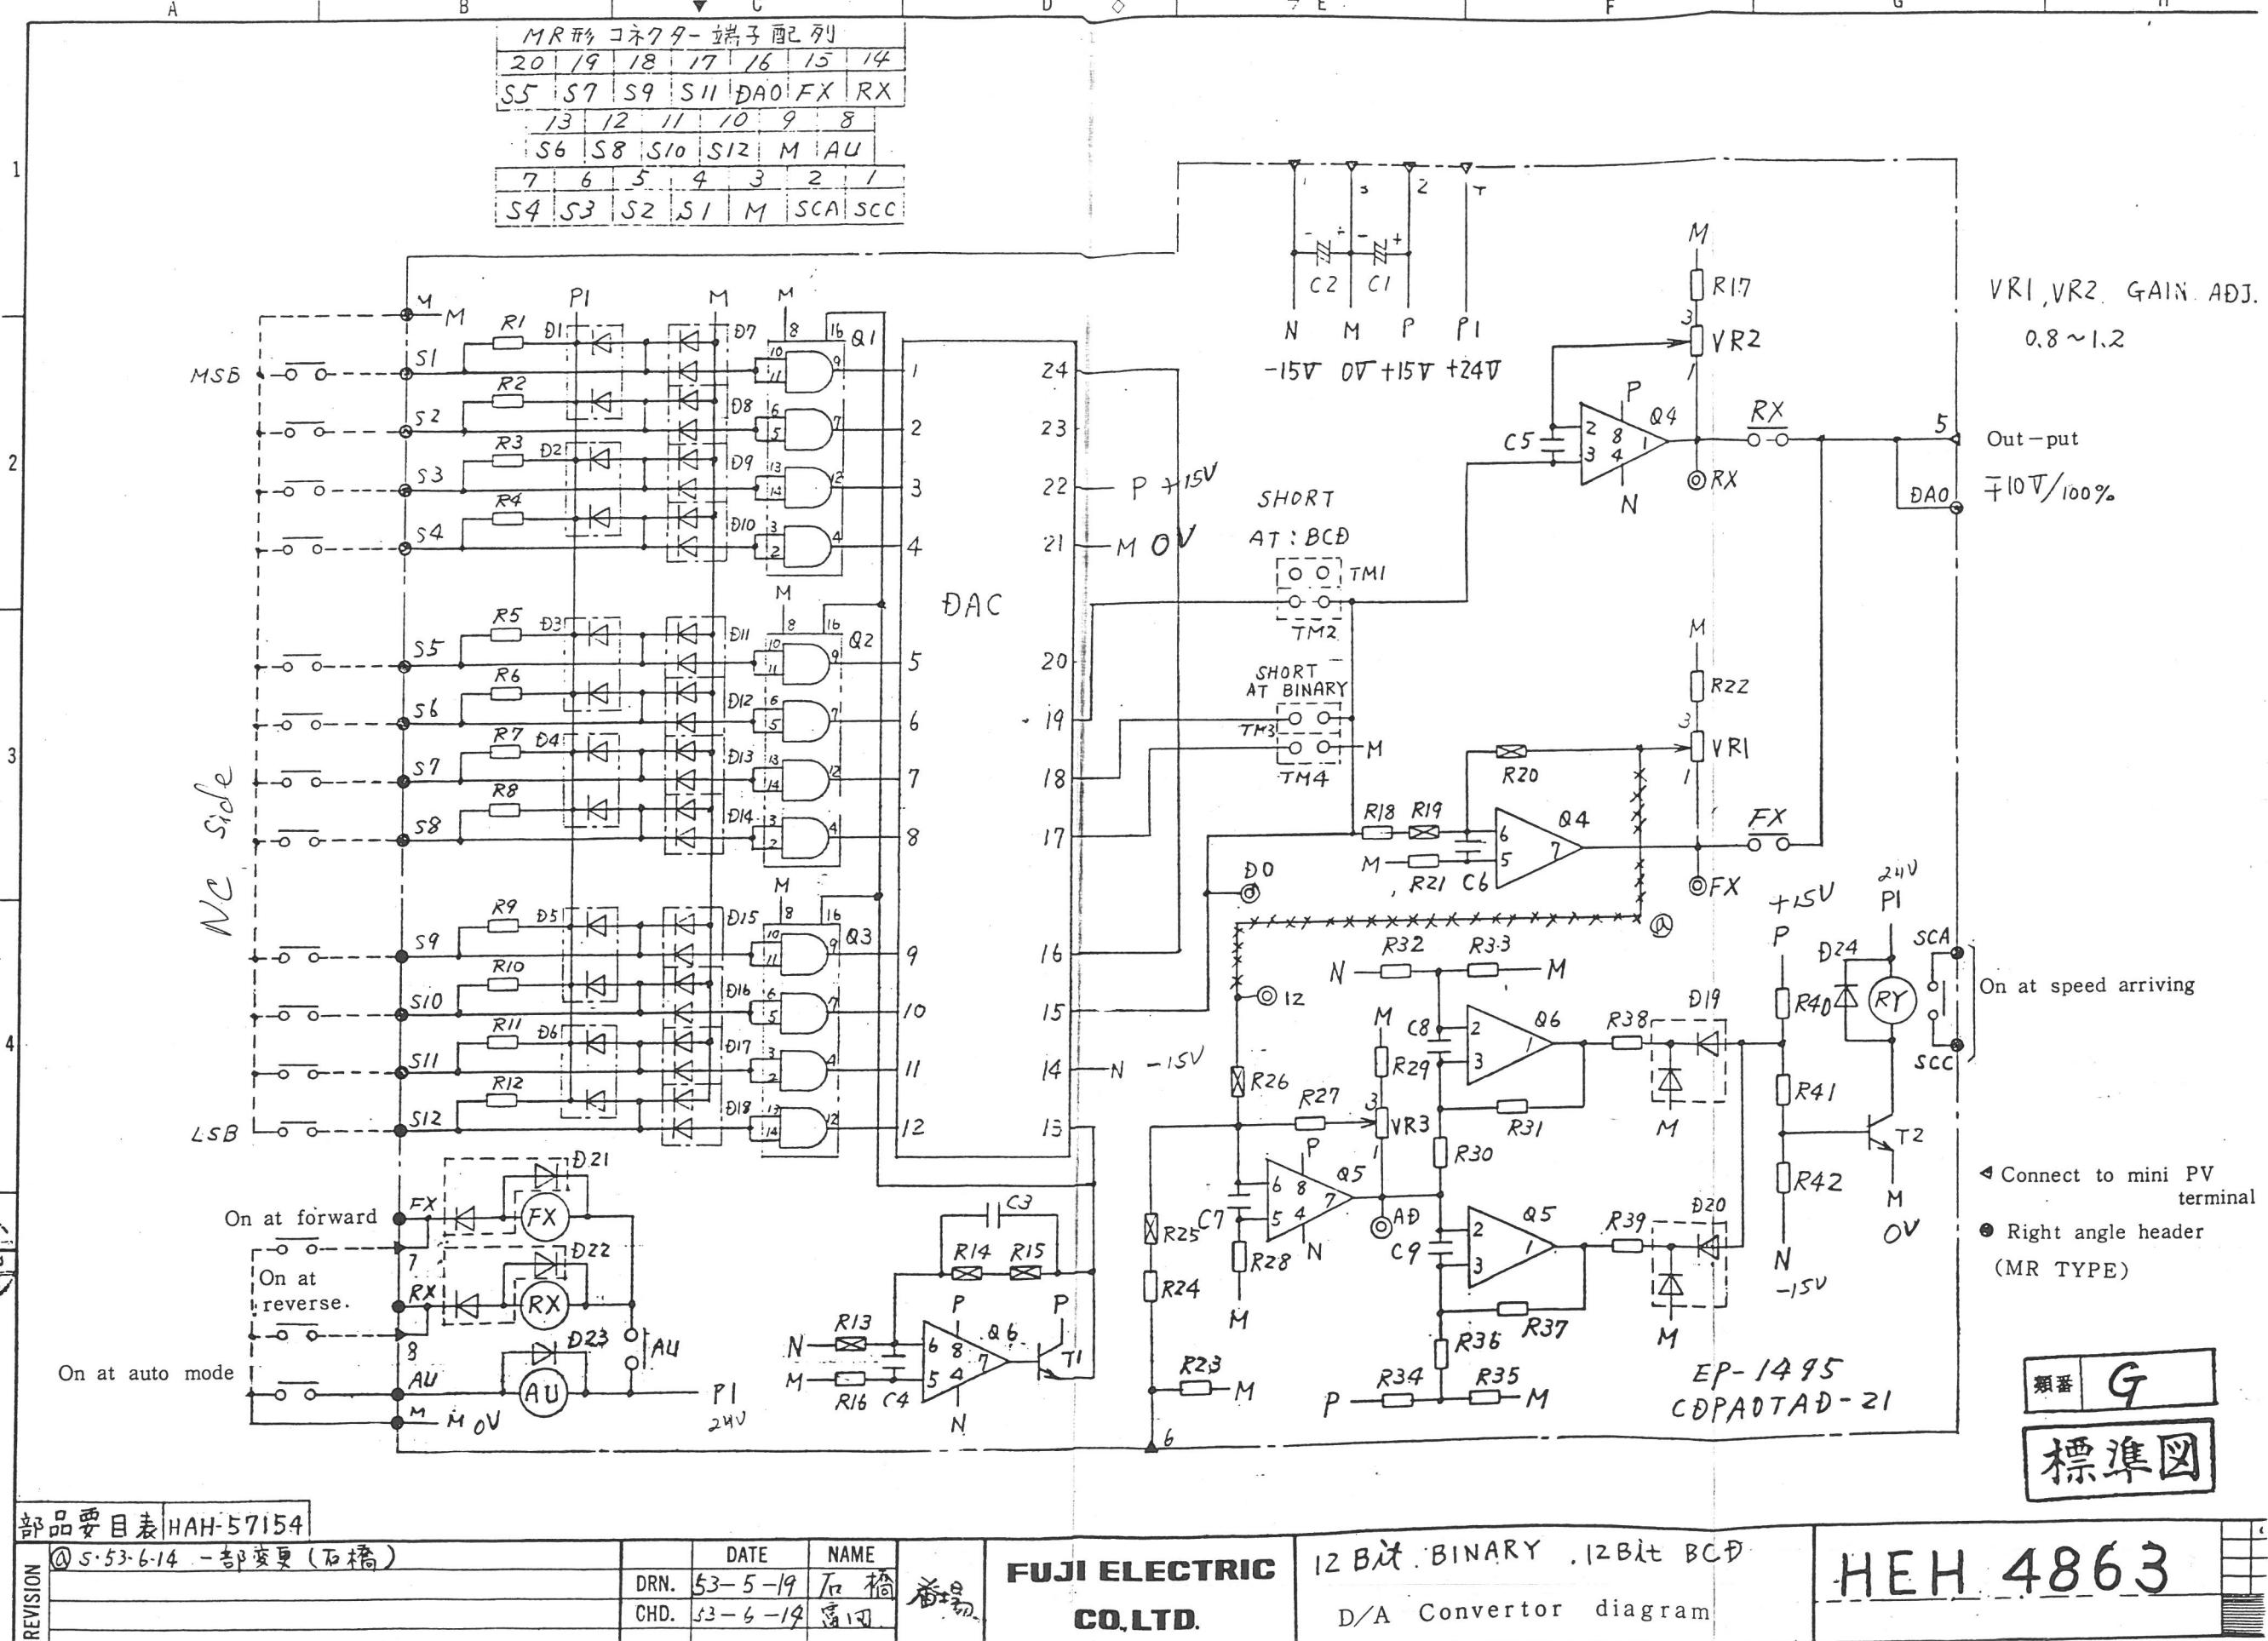


This material and the information herein is the property of Fuji Electric Co., Ltd. They shall be neither reproduced, copied, lent, or disclosed in any way whatsoever for the use of any third party, nor used for the manufacturing purposes without the express written consent of Fuji Electric Co., Ltd.

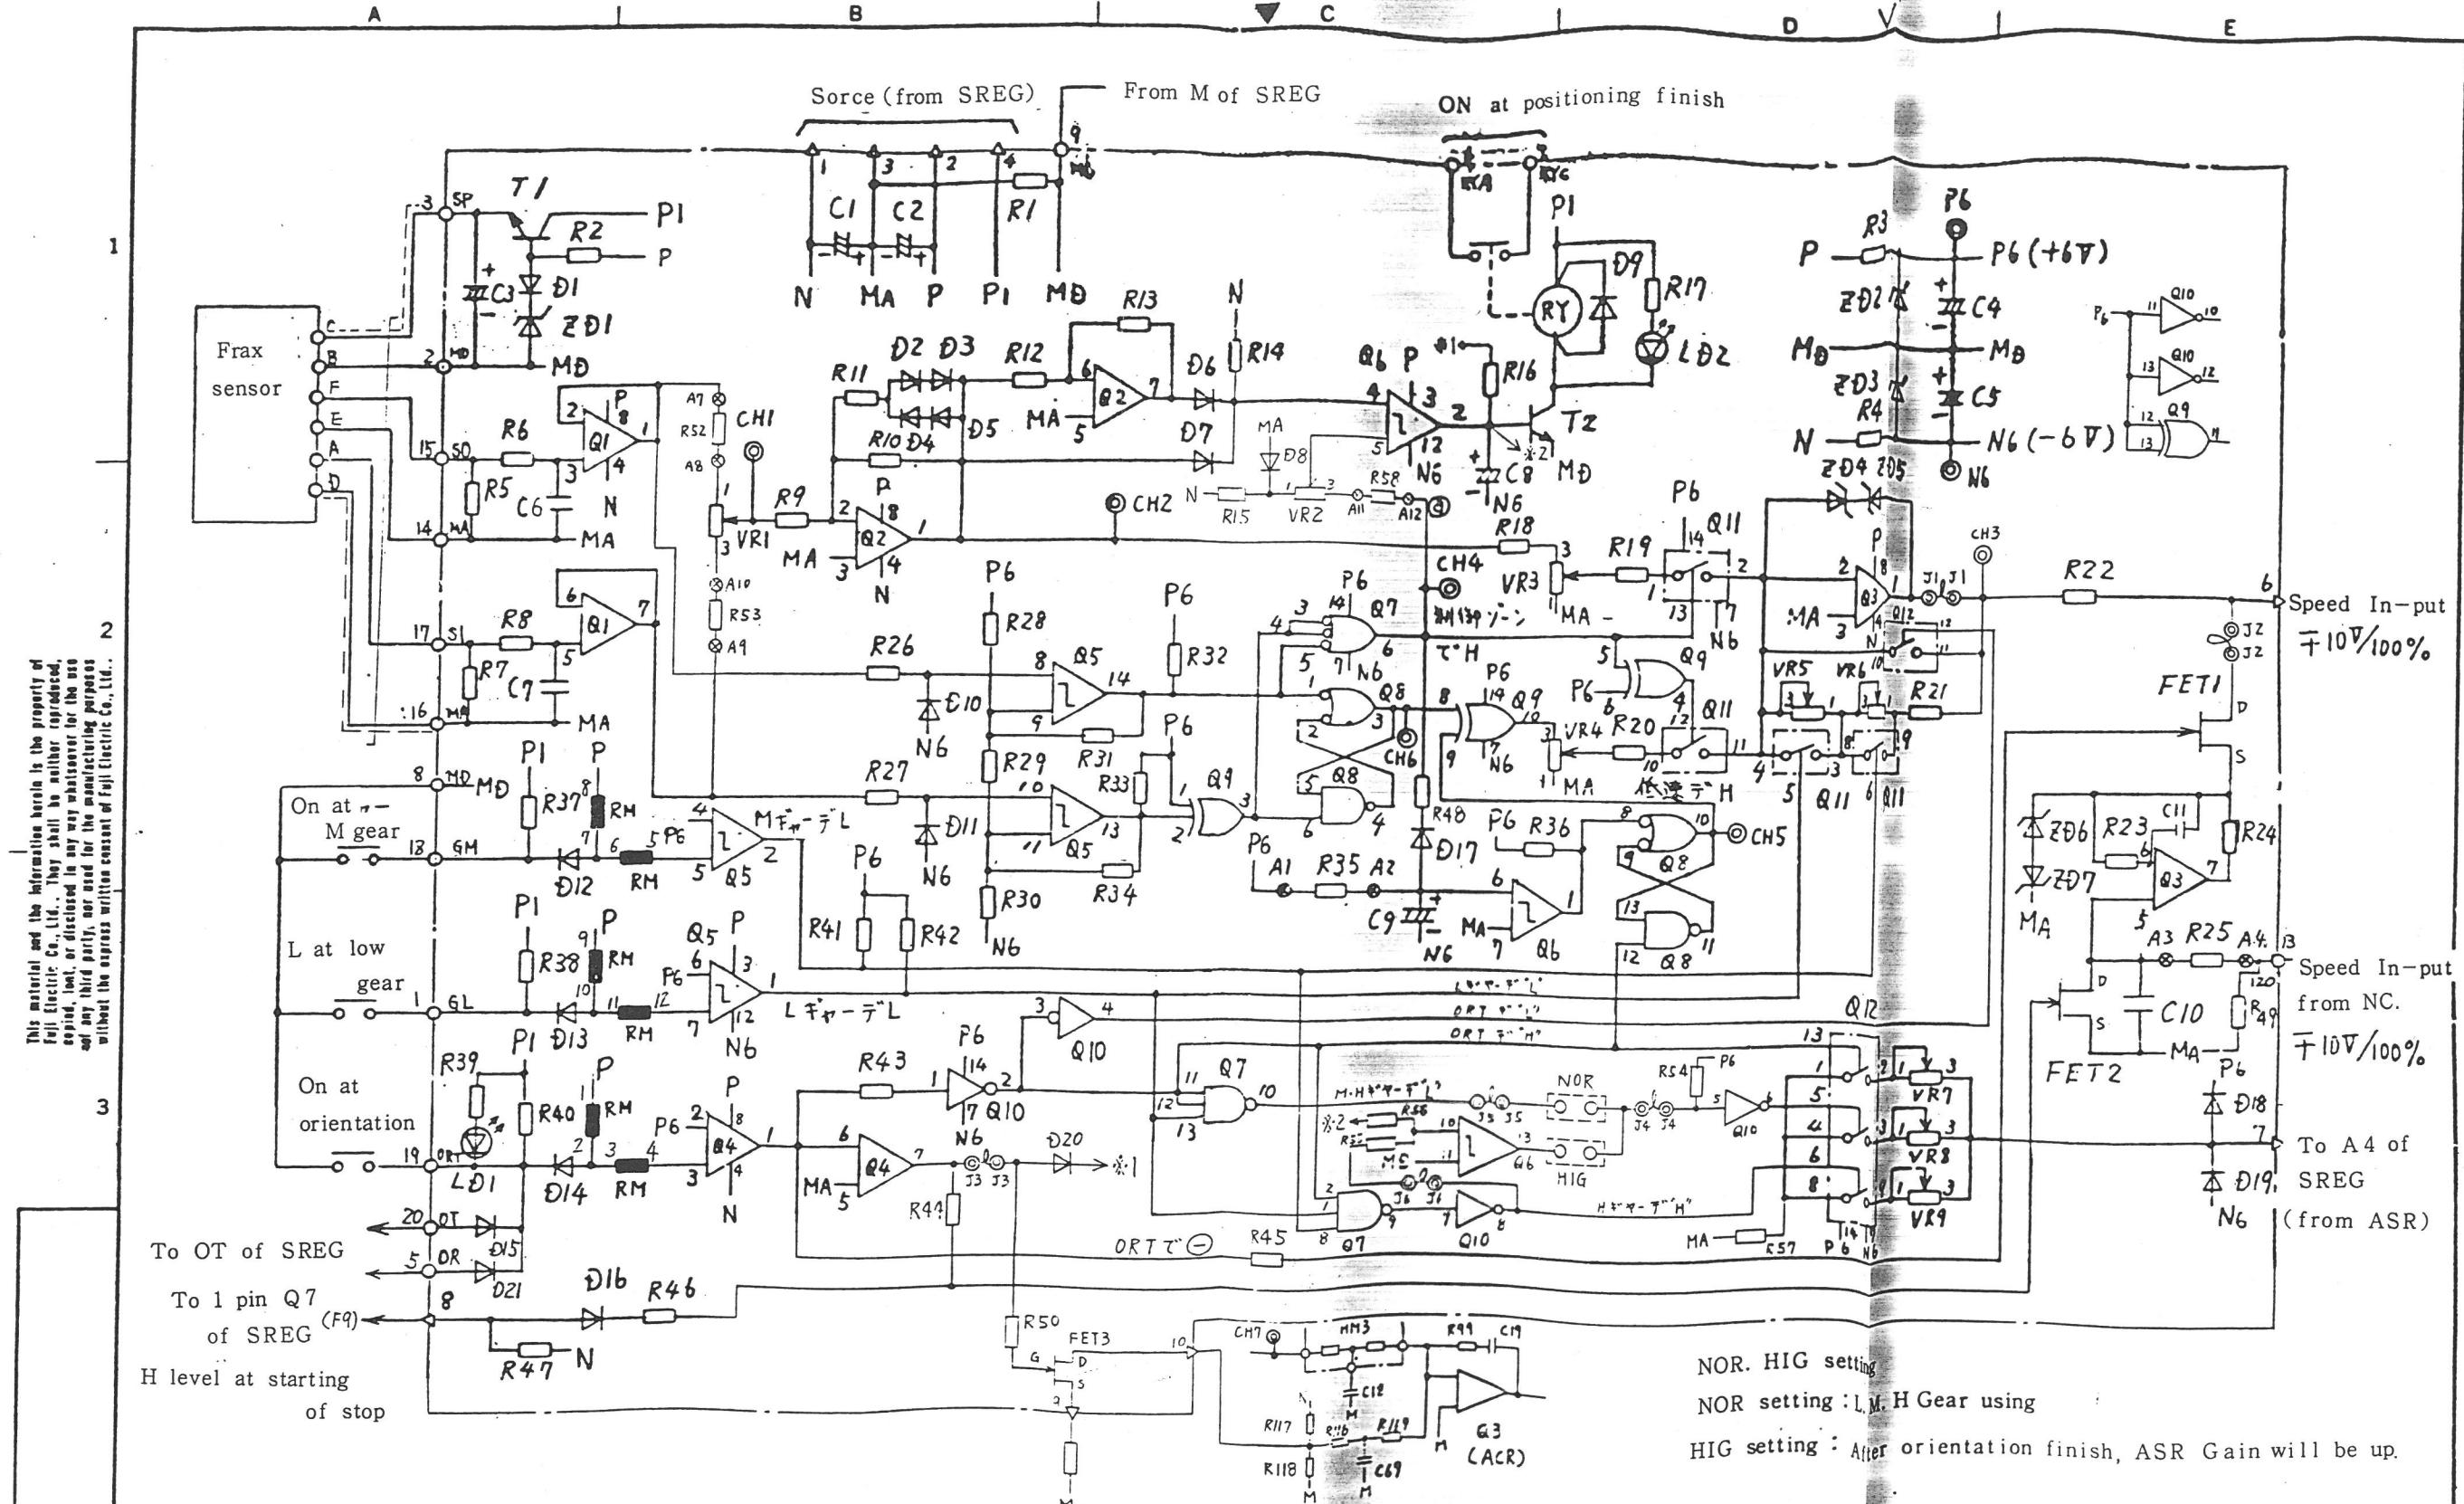


HAH 42999

標準

シガス NO.	外部設定値
ES1	2° 1
ES2	2' 2
ES3	2'' 4
ES4	2''' 8
ES5	2'''' 16
ES6	2''''' 32
ES7	2'''''' 64
ES8	2'''''' 128
ES9	2'''''' 256
ES10	2'''''' 512
ES11	2'''''' 1024
ES12	2'''''' 2048

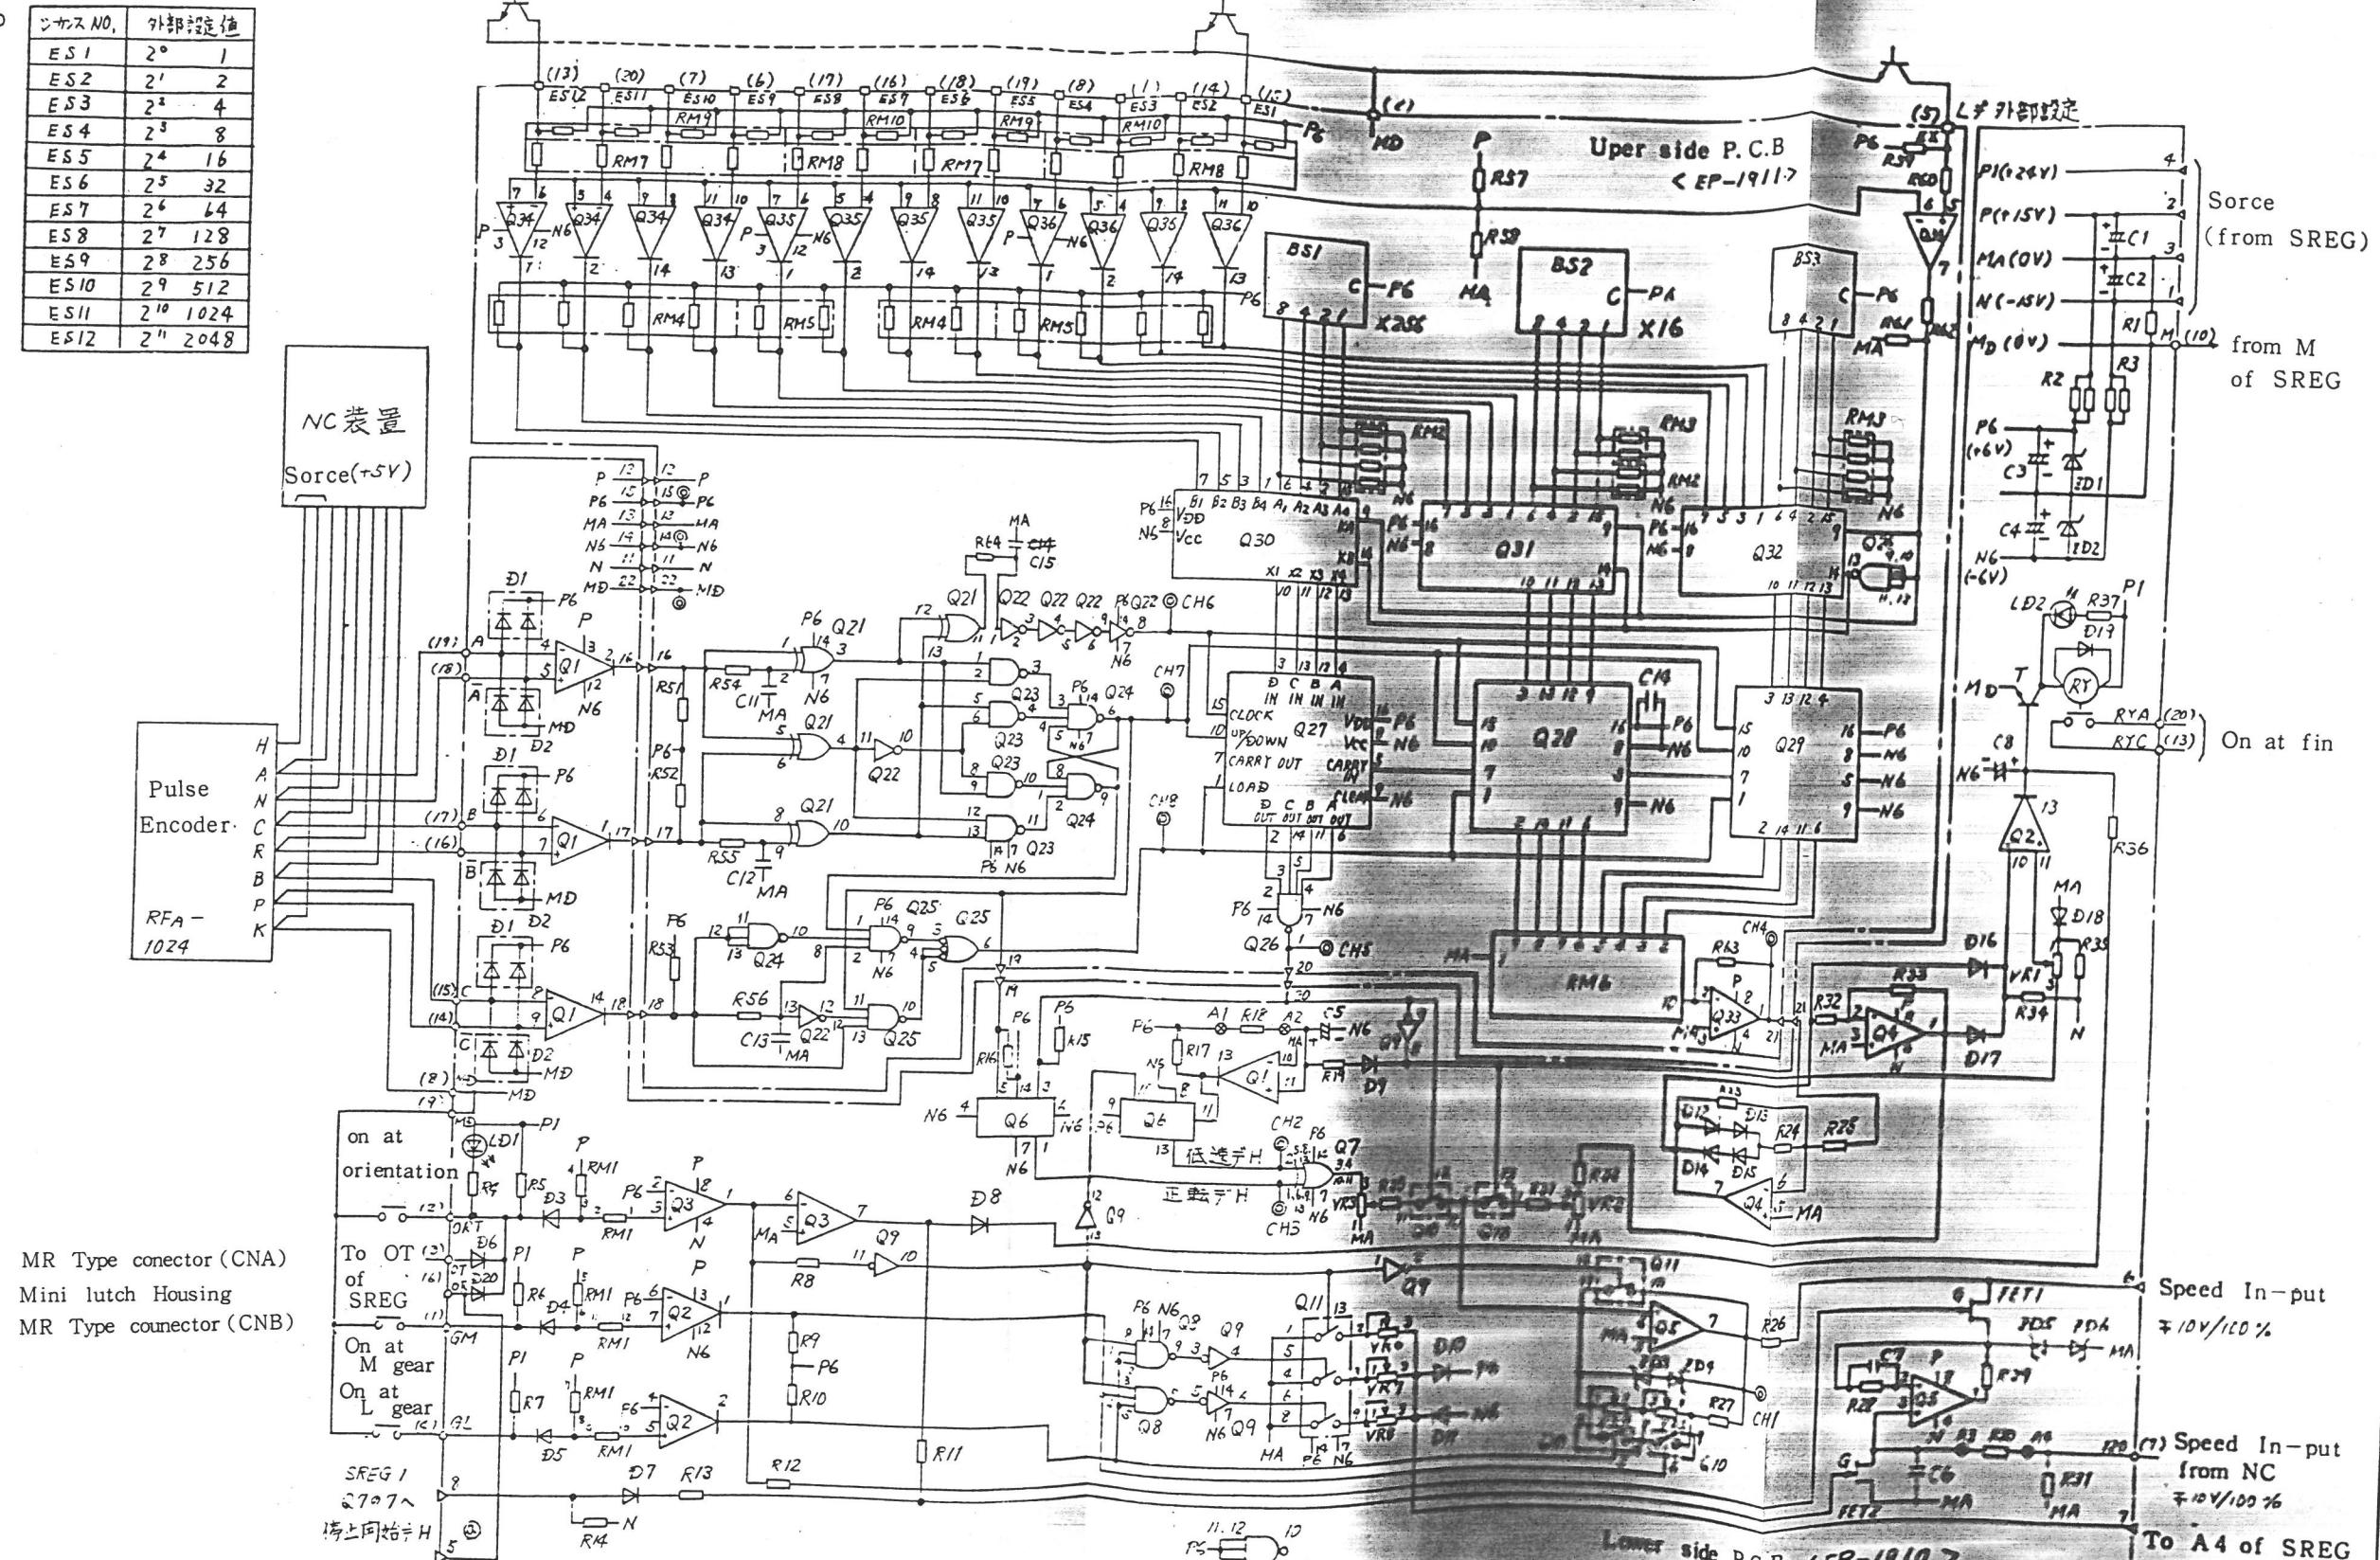

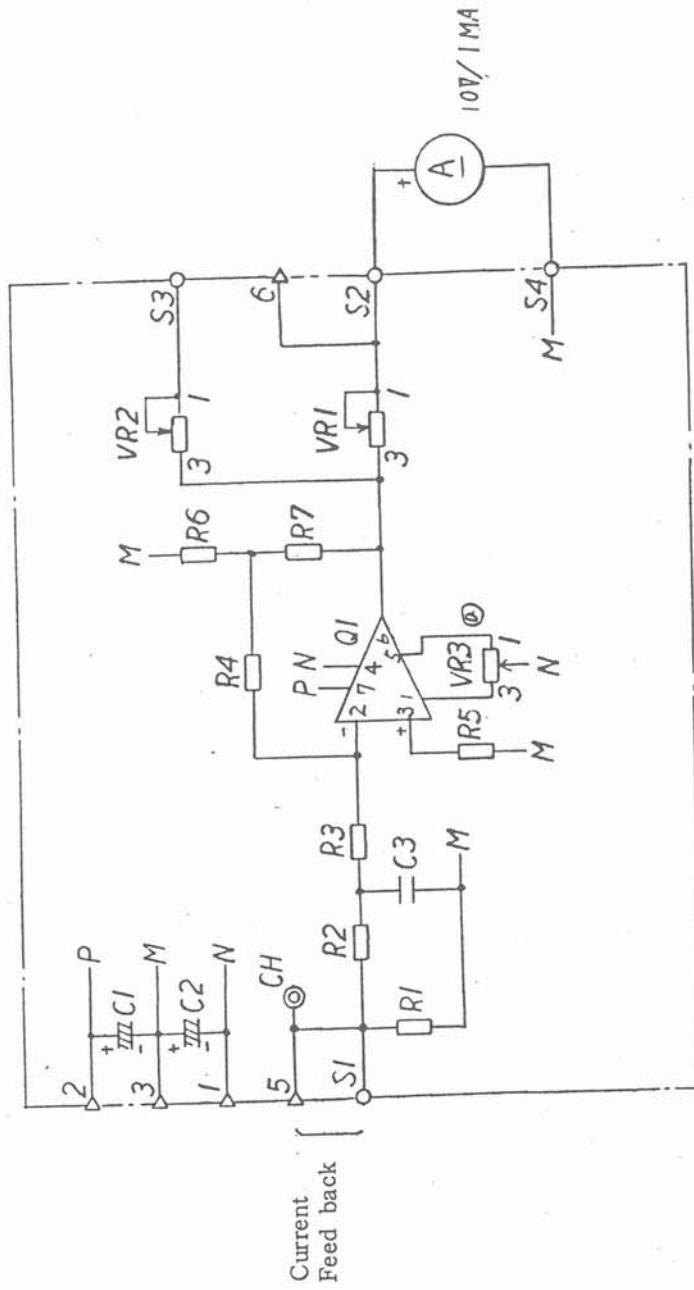

標準図

部品要目表 | 11AH 58033a

変更 | ④ VR3 実装寸寸 S56.6.12. (田中) 欧洲会員

更

CDPA0AAC-11

Lood meter diagram



製図	日付	署名
調査	昭55-1-5	高立
	昭 - -	会員

第1号
日本

第三角法

富士電機製造株式会社

HEH 5339




4. Adjusting and maintenance

4-1 Confirmation of Outer Wirings


- (1) Connections and species of wires are correct or not according to the "total circuit diagram"
- (2) Especially, the sign in drawings means shielded or twisted wires
 - cf) Sufficiently note the treatment of the shielded wire ends

Don't make loop in shielding parts and connect them to the M terminal of the D.S.R. unit. The opposite of shielding parts are to be treated so as not to be grounding or not to touch other wires.

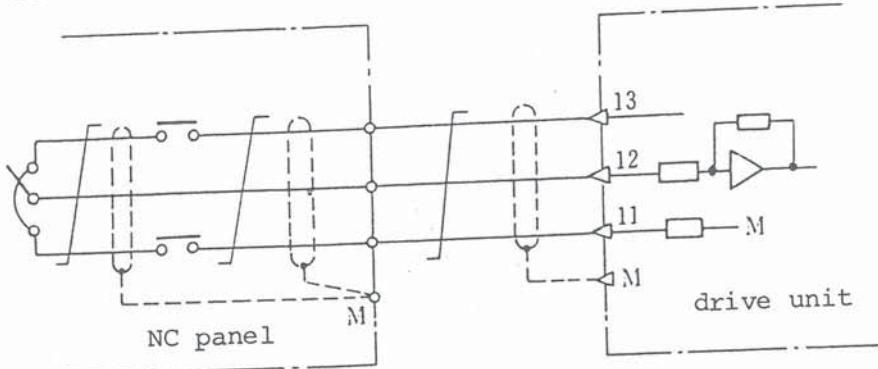

When twisting pitch of wires are too long, it is not effective

 Example



Sectional Area mm ²	Twisted 2	Twisted 3
0.3	16 ~ 24 mm	21 ~ 29
1.25	30 ~ 45	39 ~ 54


- (3) It is possible to examine the resistances of armature, field, TG and PTC windings according to the specification.

The order of resistance values is following

armature resistance < field resistance
< TG winding's resistance < PTC resistance

- cf) Checking the P.T.C. circuit, use DIGITAL METER,
Don't use MULTIMETER (TESTER), it'll be burn out

- (4) Separate wires of the speed setting circuit and the tacho generator from main circuits and other's power supply windings as far as possible not to accept electrical noise influences.
- (5) Insert spark killers into all noise generating sources, such as relays, coils of magnetic valves, auxiliary motors and fluorescent lamps.
- (6) Don't connect the M terminals of the SREG P.C.B. and the field regulating P.C.B.
- (7) Check the circuits without three phase main power supply not to be in earth.

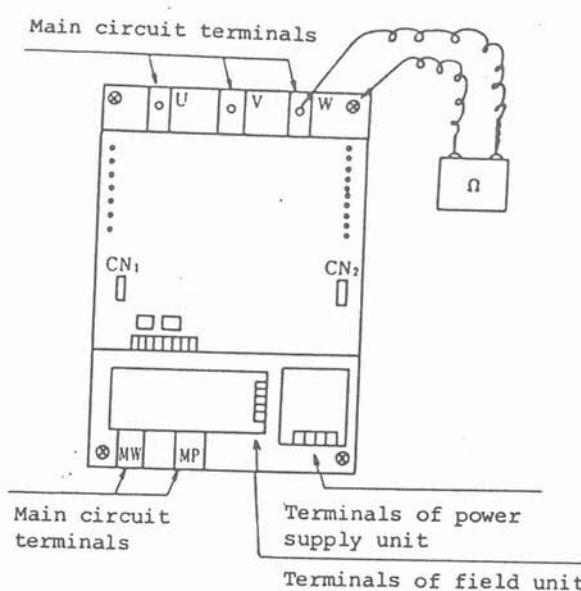

Check points (the following terminals to earth)

1. Main circuit terminals
UVM, MP, MN
2. Terminals of power supply unit
 U_1 V_1 W_1
3. Terminals of field unit
UF VF MJ MK
4. Check pins on the SREG
P.C.B.
 P_1 P M N


Check them with TESTER and confirm their values over $500\text{ k}\Omega$, it is necessary to examine their causes and to certify the hindrance of operation.

cf) Don't use the insulation resistance meter of DC 500 v.

Usually insulation resistance meter of DC 500 v is used for measurement of insulation resistance. But without special cases avoid it because of destroy of electronic parts by using it and applying the big voltage to the electronic circuits.

4-2 Confirmation of the Motor Preparation

- (1) To make sure, check the conditions of brushes contact.
- (2) Sufficiently take care of the conditions of the loaded machine to keep the safety of motor rotation.
- (3) Confirm there is an alien or not in the motor (oil dust etc.)
- (4) Take care the rocking screw of middle capacity motor (over 20 kW) for safe transportation.

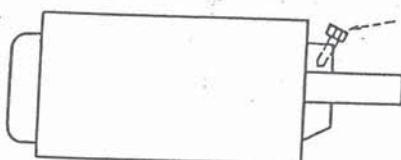

Take off the red mark screw and change another be attached to

- (5) Confirm items (1) and (3) about the tacho generator, too.

About others, refer to "motor manuals" in detail.

4-3 Confirmations of Power Supply Capacity and Voltage


- (1) Minimum of power supply capacity is follows.

Power supply capacity (KVA) \geq twice of motor rating output (kW)

- (2) Confirm the power supply voltage within $\pm 10\%$ of rated voltage.

4-4 Confirmations of Power Supply Phase Rotation and Frequency



- (1) Confirm the phase rotation at the power supply terminals with phase detector. Without phase detector, it is possible to use oscilloscope as below. When the wave form of CH₁ is delayed from those of CH₂.

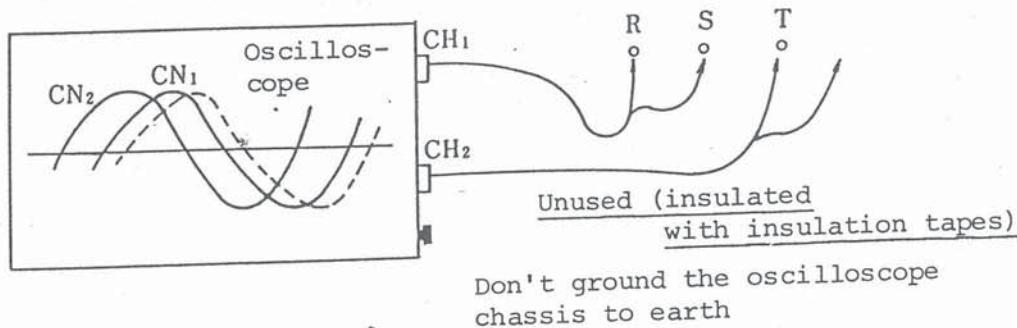

cf) 1) When discriminating above clearly, it is easy to see to shift one of the waves a little as to be shown in dotted line.

cf) 2) Insulate one of the G lines without fail or the serious short circuiting fault of power supply are occurred by connecting both G lines to S and T phase in error.

- (2) Change over the switch on the P.C.B. according to power supply.

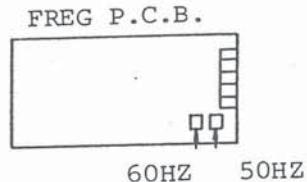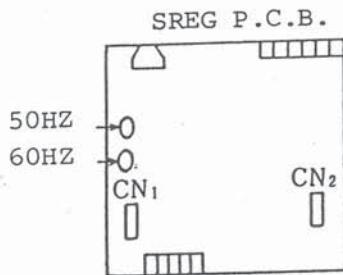

To change over the switch for 50 or 60 Hz frequency using, replace the mini jump socket from one side to another (The mini jump socket, what is called a switch, is used for frequency changing).

- 4-5 Examine Terminals, Loosen Screws and Existances of Something Aliens in the Contactors and Others.


Especially in the case of exportations, take care of rusting.

4-6 Confirmations before the Motor Operation

4-6-1 Preparations

- (1) Separate the ends of amature circuit from D.C. out put terminals (outside terminals) or from connection terminals on the terminal box so as not to rotate the motor.

Another mean, not to rotate the motor is to take off the flat cables on the SREG P.C.B. those are connected to the pulse trans P.C.B. (In the case of recovery, check carefully correct insertion of cables or the pulse trans P.C.B. will be burn out)

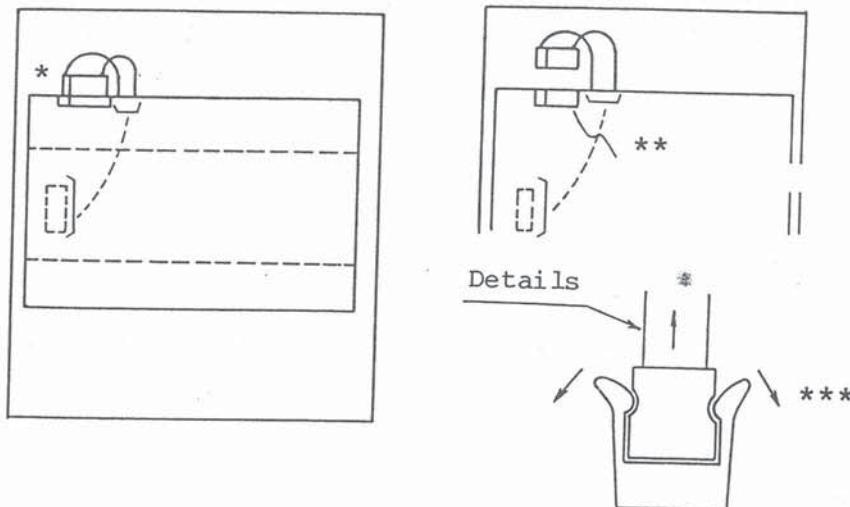


* Align correctly the red marks

** It shows the condition of taking out, and consists of locking mechanism

** Open the both locks and pull the flat cable towards the arrow mark


- (2) Surpress the start-up-delay circuit on the SREG P.C.B. so as not to display the start-up-delay fault (Sometimes necessity of above depends upon the outer circuit)

A. CDPB3CPS-62

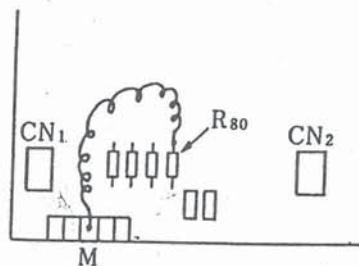

Make short circuit with the jumping wire between the end of R80 and the M terminal as illustrated on the left.

B. CDPB3CPS-82, 83

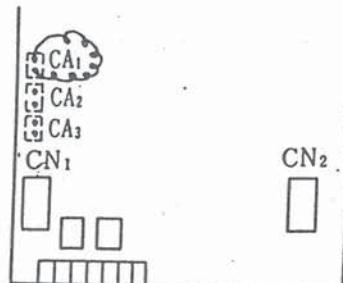

Make short circuit the pins CA_1 with a jumping wire as illustrated on the left.

With the mini jump that is used for frequency changing, it is also possible for short circuiting CA.


4-6-2 Power acceptance (to throw the magnetic contactor in a Service Wire)

Confirmation of input voltage in the unit (It is unnecessary to do when there is no voltage change by transformers)

- A. Main circuit terminal voltage (U-V, V-W, W-U) within $\pm 10\%$ of standard voltage
- B. Synchronous power supply voltage (U_1-V_1 , V_1-W_1 , W_1-U_1)
ditto
- C. Field power supply voltage (UF-VF)
ditto

4-6-3 Confirmation of power supply for the P.C.B.

Check voltages below, if abnormal, promptly throw off the magnetic contactor in a service wire, and examine the wiring of the control.

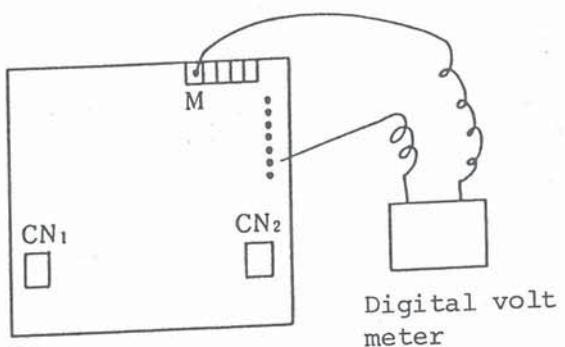

between P_1 and M, DC + 22~26 V

between P and M, DC + 14.8~
15.2 V

between N and M, DC - 14.8~
15.2 V


4-6-4 Confirmation of circuit sequences

- (1) Confirmation of the motor cooling fan rotation direction. On the motor there is the name plate indicating the cooling fan rotation direction.
- (2) Confirmations of sequence relations between running, stopping, jogging and forward, reverse rotation setting.
- (3) Confirmation of the faulty circuit

On the running condition, confirm the faulty circuit when the fault indicating lamps on the SREG P.C.B. are lit on, the relay 30 also on the SREG P.C.B. are acted (At that time, the contactor for outer usage 30A-30C are on) and the main contactor in the electric cubicle are off.

Check the faults of the circuits as follows:

Items	Fault indicating lamps	How to check (refer to the SREG P.C.B. below)
a	37FL	Make short circuit between Terminals 37 and M on the SREG P.C.B.
b	SFL	Take out the jumping wire of the item 3-1-(2) (It puts on about 1.0 second later)
c	OSL	Make short circuit check pins between N and CH5 (It puts on at 115 ~ 120% of rated speed)
d	88L	Make short circuit the terminals between 88 MF and M
e	PTCL	Take out the connector CN ₂ from the SREG P.C.B. (It puts on at 3.2 ~ 3.8 kΩ and recovers at about 2.0 kΩ of the PTC resistance.)

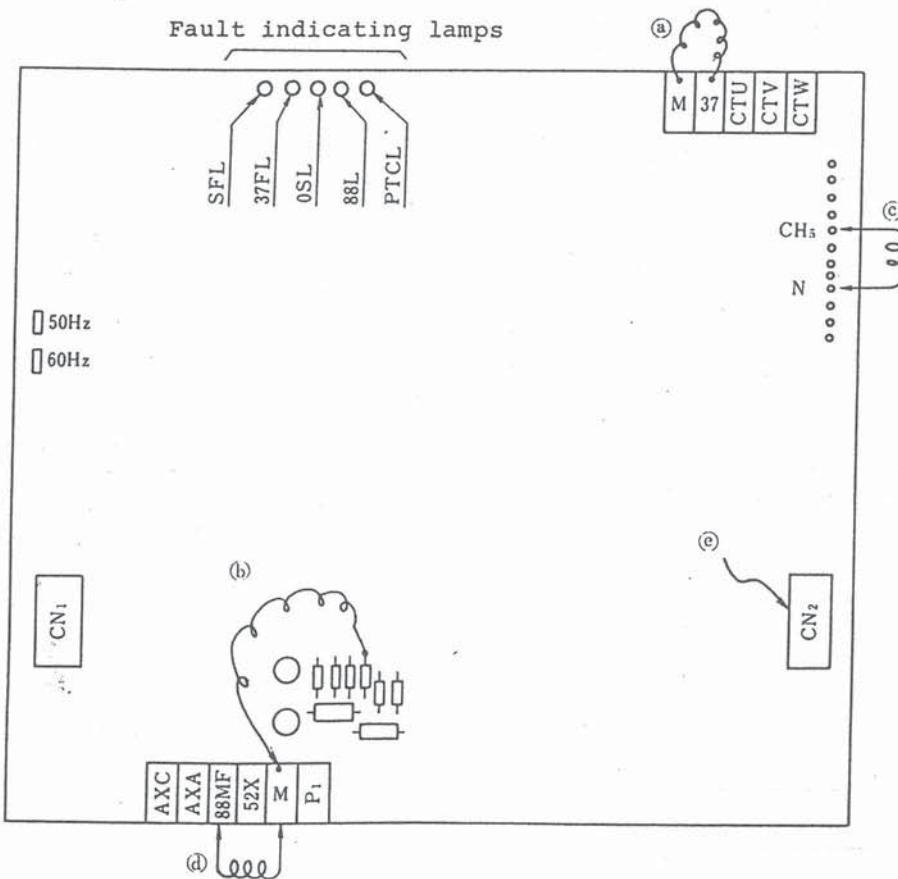

24
23
29


IED PRODUCTS



PRINTED IN USA

B. CDPB3CPS-82
(CDPB3CPS-83)


Items	Fault indicating lamps	How to check (refer to the SREG P.C.B. below)
a	37FL	Make short circuit between terminals 37 and M on the SREG P.C.B.
b	SFL	Take out the jumping wire and operate the DSR unit (to give it the forward or reverse and speed setting voltage). This lamp puts on about 0.2 second later
c	SFL	Make short circuit CA2 and operate it (to give it the forward or reverse and speed setting voltage). This lamp puts on about 2 to 10 second later.
d	OSL	Make short circuit between check pins N and CH5 (This lamp puts on at 115 ~ 120% of the rated speed.)
e	88L	Make short circuit the terminals between 88 MF and M
f	PTCL	Take out the connector CN ₂ from the SREG P.C.B. (It puts on at 3.2 ~ 3.8 kΩ and recovers at about 2.0 kΩ of the PTC resistance)
g	OCL	Supply over -2 volt to the pin CH6 (It puts on.)

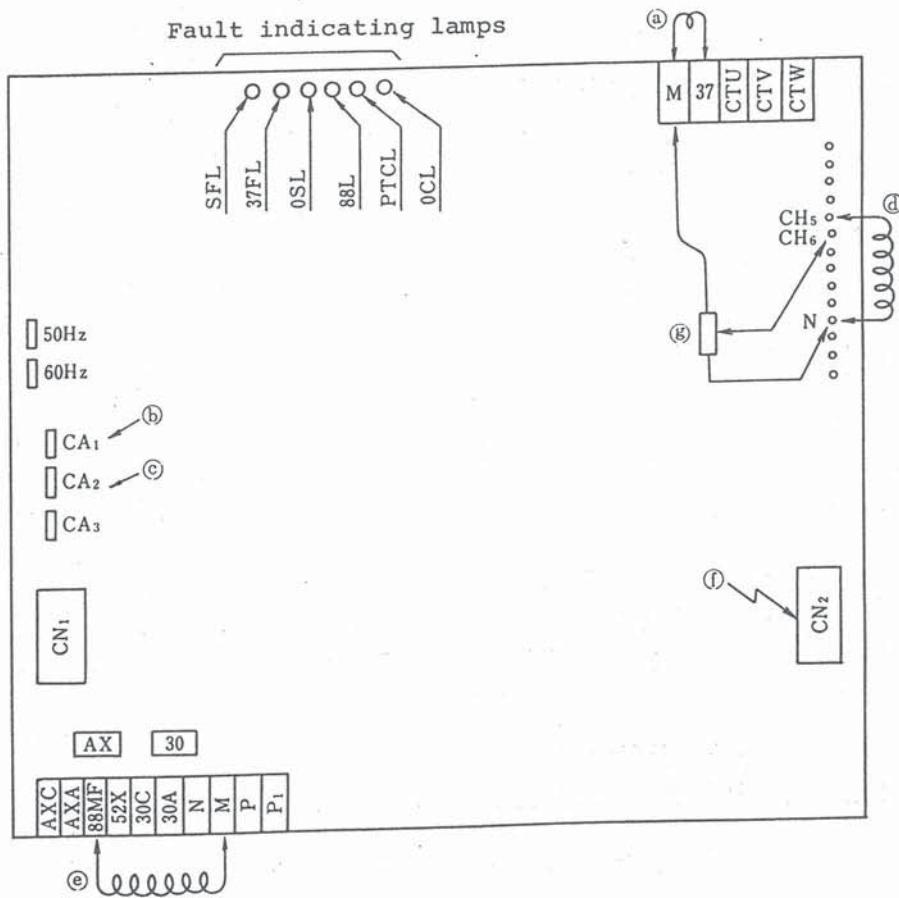

4-6-5 Confirmation of field current

- (1) Confirm the field current in accordance with the motor test report (or the motor specification)


A. FREG-10C and -10E

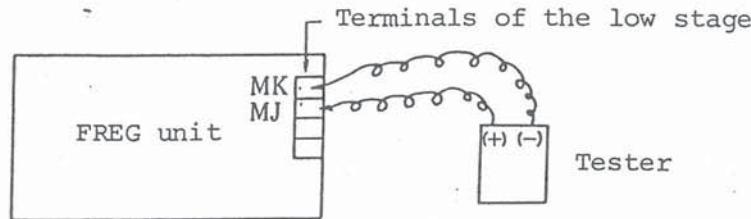

As the field voltage is calculated as to multiply the normal field current by the field resistance of hot condition and regulated, the current of cold windings or of just power supply's throwing-in condition is up by 10 to 30% more than the rated current.

Don't touch the regulating volume resistance VR_4 on the FREG P.C.B. and the initial current becomes the normal one in accordance with the temperature rise of filed windings. Refer to the specification, page 18.

B. FREG-10D

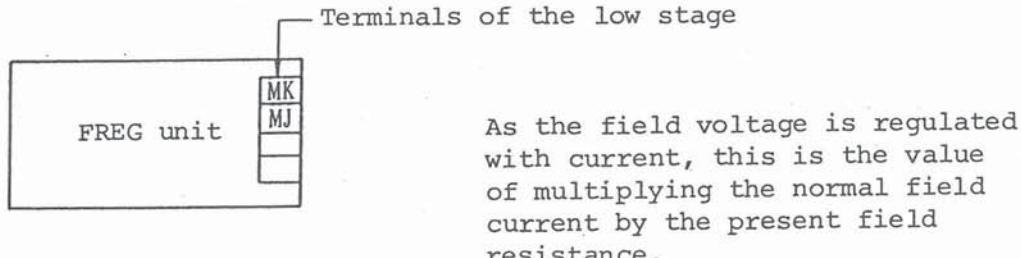

Don't touch the regulating volume resistance VR_4 on the FREG P.C.B. despite the difference, 10 to 30% of the voltage between hot and cold conditions.

$$\begin{aligned} \text{Field Voltage} &= \text{Field Amps} \times \text{Field Resistance} \\ 100.2 &= 8.2 \times 12.2 \end{aligned}$$

Example DC Spindle drive system manufacturing specification


Orderer	Messrs JIS, JEC JEM technical standards	Mfg. No. numbers
Warranty term	Within 1 year after shipping of the factory	

Specifications

Items	Specification	Remarks
Machine name	_____ type NC lathe	Mechanical specifications
usage	Main spindle	
Range of load variation	10 ~ 100%	
load GD ²	kg-m ²	
Starting frequency		
base torque	kg-m	
Load counter torque	kg-m	
The name of system	FSD- _____ D	
Type	GGN 3138G	
Output power	5.5 kW/cont. 7.5 kW/30 30 Min	
Base speed/maximum speed	1150 RPM/3450 R.P.M.	Motor specifications
Range of speed controlling	34.5 ~ 3450 R.P.M.	
Voltage controlling	34.5 ~ 1150 R.P.M.	
Field controlling	1150 ~ 3450 R.P.M.	
Armature voltage	DC 220V'	
Armature current	31A/5.5kW 42A/7.5kW	
Armature resistance	1.26Ω at 75°C	
Field voltage	112V at 1150 RPM	
Field current	Max 43A normal 3.7A at 1150 RPM Nor 0.92A at 3450 RPM Min 0.78A (say)	
Field resistance	30.8Ω at 75°C	
Cooling fan	87/120W, 200/220V 50/60Hz, 0.42/0.47A	
Tacho generator	KGD-03C DC20V at 1000 RPM PFM 25/1.2-24 AC 115V at 1800 R.P.M.	
P.T.C. thermister	Existence (standard) Nonexistence	
GD ²	0.45 kg-m ²	

(2) Observation with a oscilloscope

When terminals M and FS of FREG unit are "on", the output voltage is about 120 volt.

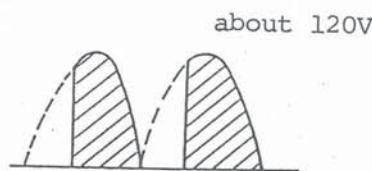

When "off", it is about 20 volt




The voltage of some P.C.B. shows the half of above.

It is also unnecessary to adjust the other VR_S on the FREG P.C.B.

cf) When the field winding resistance of a motor is more than 100 KΩ, connect the resistance for discharge between terminals MJ and MK.

4-6-6 Checking of generated voltage polarities of motor and T.G.

For above, measure the generated voltage, when the rotor is rotated towards one side by hands.

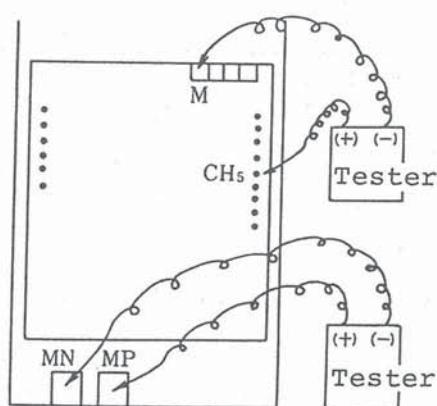

The portion of motor generated voltage measurement	measuring range
between MP and MN	DC about 10V
The portion of T.G. generated voltage measurement	measuring range
between CH5 and M	DC about 1V

It is correct the polarities MP of motor generated voltage and CH₅ of T.G. generated voltage are same.

When the polarities are different, the motor runs away and is uncontrollable.



4-6-7 Confirmation of speed setting input voltage

- (1) Confirm the speed setting input voltages of manuals, automatics (using D/A converter, NC equipment) and jogging, between M and CH₁ or M and CH₂, when operating (forward and reverse). (Refer to sequences which the terminal CH₁ or CH₂ is used.)

The voltage shows about 10V at the max. speed written in the manufacturing specification. (If correct, it is between ±9.95 and ±10.05V) Other rotating speeds are proportional to the speed setting input voltage.

Example.

If the rotating speed is 3000 RPM, and speed setting input voltage is 10.0V, it shows 5.0V when 1500 RPM. and RPM shows 1.0V.

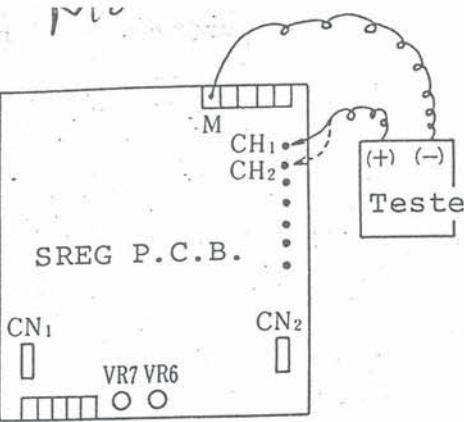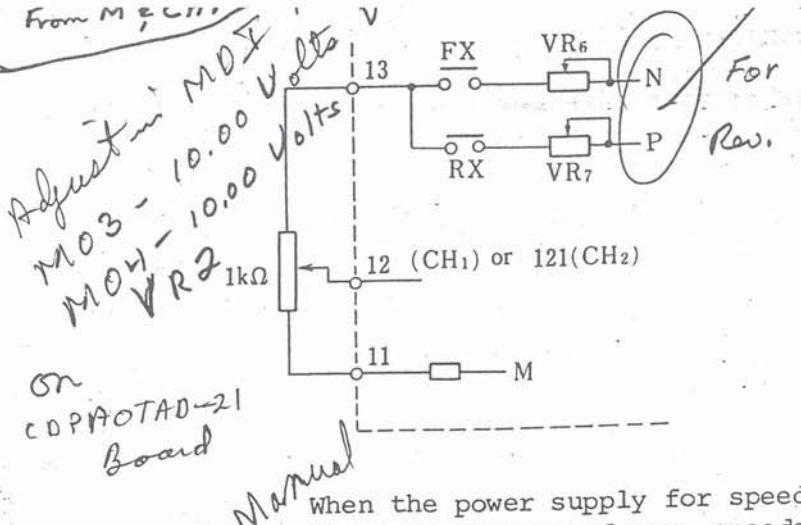

In Manual Mode

When the power supply for speed setting is illustrated above, the fine adjustments of max. speeds are regulated with VR_6 for forward and VR_7 for reverse.

To the contrary in the case of a D/A connector or NC equipment those input comes from the outside, adjust it on the outside. Refer to the items of options, when options are equipped on the D.S.R. unit.

- (2) When the over ride P.C.B. is equipped, confirm the speed setting voltage variation of percentage against the original one.

4-6-8 Confirmation of the basic behaviors of P.C.B.s.

- (1) Confirm the behavior of each part according to the reference "the voltage and wave form on check pins".
- (2) Confirmation of α min, γ min of the phase shifter (with an oscilloscope)

In operation α min is from 18 to 25°


In stoppage γ min is from 28.5 to 31.5°

Basic waveforms and VRs for adjustment are as follows.


VR_{10} is for standard wave forms of U phase between U and W ,also for standard wave forms of X phase between W and V

VR_{11} is for standard wave forms of V phase between V and U ,also for standard wave forms of Y phase between U and V

VR_{12} is for standard wave forms of W phase between W and V ,also for standard wave forms Z phase between V and W

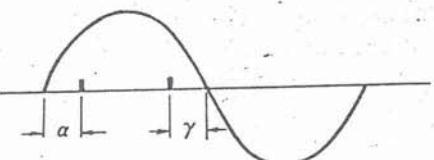

- cf) To confirm the phases of the phase shifter, insulate the standard wave forms with the insulation transformer.

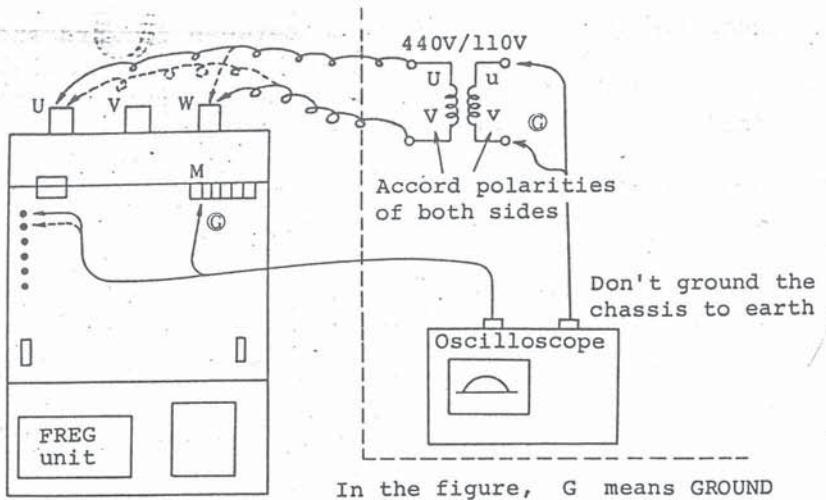

Example. The connection shows confirmation of a V phase pulse with real lines (With dotted lines shows a X phase pulse.)

Moreover refer to the reference data page 31 ~ 34 of check pins behaviors on the SREG P.C.B. and the FREG P.C.B.

4-6-9 Recoveries

- (1) Conduct operations after throwing off the power supply (throwing off the contactor for the service line)
- (2) Recover the preparing operations of both items 3-1-(1) and 3-1-2 (2) to the original conditions.

4-7 Motor Operations

4-7-1 Confirmation of the motor rotation direction

- (1) Confirm the rotation direction, when jogging and setting manuals.
 - (Low speed setting)
 - o When the rotation direction is incorrect, reverse the polarities both connections field windings MJ-MK and tacho generator windings.
 - o When the speed is abnormally up, stop the motor immediately and examine TG circuits (3-5-(3)). If not recovered, it is necessary to examine again according to the trouble shooting.
 - (2) Confirm whether speed controlling is correct or not against the speed setting, on the low speed range.

4-7-2 Confirmation of motor max. speed

- (1) When indicating the max. voltage value (10.0V), adjust VR2 on the S.R.E.G. P.C.B to become the maximum speed in accordance with the specification.
 - cf) With measuring the motor speed on the machine side, by turning VR₂ gradually, take care of the over speed coming from the pulleywheel ratio, gear ratio and belt slip. etc.

(Reference)

When there is the difference between forward and reverse speed, (although the accuracy of speeds is within $\pm 1\%$ of max. speed if wanted the accordance of reverse and forward speed), conduct as follows.

(Example)

If 3450 rpm at -10.00V of forward speed setting and 3420 rpm at +10.00V of reverse speed setting, adjust VR₂ as to be 3450 RPM in the condition (see 3-6-(1)) that forward speed setting becomes max. -9.95V at 3420 RPM.


4-7-3 Confirmation of the speed meter

After finishing the fine adjustment of the max. speed, correct VR₃ on the SREG P.C.D. in the max. speed state. Naturally do above both directions. (Already equipped the adjusting VR in the speed meter, it allows to correct either of them.) Adjusting band width of the speed meter is from 7 to 10.5V.

4-7-4 Confirmation of the motor terminal voltage

- (1) Confirm the terminal voltage in the conditions of max. speed and light load.

Motor terminal voltage \approx motor rated voltage - IR drop at 100% of rating.

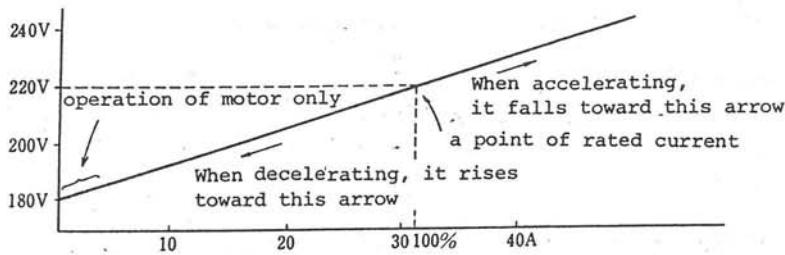

(Example)


If the case of the motor in accordance with the manufacturing specification for reference, above figure shows the relation voltage to current Equation is,

$$220V - (31A \times 1.26\Omega) \approx 181V$$

The answer means off load to the motor and then current is approximately 0A at 31A of rated current, the voltage rises to 220V.

Even if there is an error $\pm 5\%$ of voltage. Practically it is not problem. Adjust the terminal voltage with VR₁ on the FREG P.C.B.

(2) Confirm the output figures on an oscilloscope.

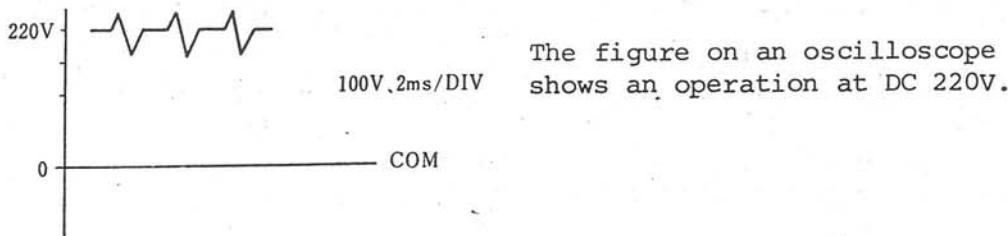

4-7-5 Confirmations of the current limit value and IR compensation

 
- (1) These are already set in the factory, therefore, confirm the current limit value with an ampere meter, when starting and stopping.

- A. When the accelerating time is short, try to repeat from forward max. speed to reverse max. one and vice versa or open circuit between terminals FS and M and repeat start and stop, it becomes clear. (Don't forget to restore the latter)
- B. If there is not an ampere meter, measure and calculate the voltage between outer terminals MM and MA on the FREG unit with an oscilloscope or a digital volt meter.

Example, in the motor case in accordance with the manufacturing specification for reference. By the Shunt resistance 50A/60mV and the current limit value 46.5V.


$$\frac{46.5}{50A} \times 60mV = 55.8mV$$

- C. When changing the current limit value, turn VR₄ on the SREG P.C.B.




The current limit value decreases with turning VR₄ to right (toward 6N)

 - (2) Confirmation of the output wave form on an oscilloscope



In the case off load operation

 

In the case the current limit-

ing or on load operation

4-7-6 Confirmation of system responses

- (1) Change the speed setting rapidly as follows
(From min low speed to max. high speed and vice versa,
stop \leftrightarrow max high speed
stop \leftrightarrow discretionary speed \leftrightarrow other discretionary
speed \leftrightarrow max. high speed, forward \leftrightarrow reverse, etc.)

- (2) Don't touch the VR of normal standard setting value for system response on the FREG unit.

on FREG-10C VR₅ is 2^N
on FREG-10A there is normally no VR for adjustment (VR₃)
on FREG-10E ditto



- cf) When requiring especially high accuracy and response of pseed, it does not satisfy the specifications without changing constant numbers on P.C.Bs, the VR₁ notch and the accuracy of motor and tachogenerator all the more.

4-7-7 Others



Confirm the full satisfactions with the actions of optional P.C.Bs when there are optional P.C.Bs on the D.S.R. unit.

4-8 Voltage figures of check pins
SREG Printed Circuit Board

The voltages and wave forms on checkpins (motor stops) - (take out the flat cable connected to the pulse P.C.B.)

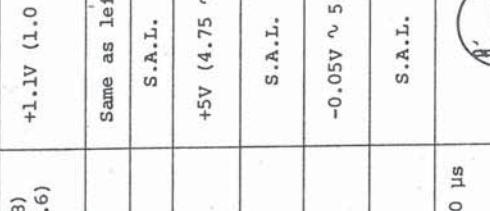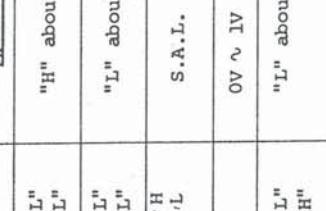Operation Modes Check point	Stop	Forward in acceleration (Changing the setting)	Steady state in forward	Forward in deceleration (Changing the setting)	Reverse in acceleration (Changing the setting)	Steady state in reverse	Reverse in deceleration (Changing the setting)
CH1 Standard input voltage	o usually 0V o 0 to 10 V depending	-0.1V ~ 10.1V standard 10.0V/100%	S.A.L.	S.A.L.	+0.1V ~ 10.1V	S.A.L.	S.A.L.
CH2 Auxiliary input voltage	upon machines				standard 10.0V/100%		
CH3 ASR output	0V	+5V (4.7 ~ 5.25)	S.A.L.	S.A.L.	-5V (4.75 ~ 5.25V)	S.A.L.	S.A.L.
CH4 ACR output for orientation O.T	+7.5 ('7.2 ~ 7.8) +6.3V (6.0 ~ 6.6)	+1.1V (1.0 ~ 1.2)	S.A.L.	S.A.L.	+1.1V (1.0 ~ 1.2)	S.A.L.	S.A.L.
CH5 Speed feedback	0V	Same as left	S.A.L.	S.A.L.	0V	S.A.L.	S.A.L.
CH6 Current feedback	0V	S.A.L.	S.A.L.	S.A.L.	0V	S.A.L.	S.A.L.
CH7 ASR output (rectification)	0V	+5V (4.75 ~ 5.25)	S.A.L.	S.A.L.	+5V (4.75 ~ 5.25)	S.A.L.	S.A.L.
CH8 Speed feedback (rectification)	0V	S.A.L.	S.A.L.	S.A.L.	0V	S.A.L.	S.A.L.
CH9 Standard input (limiter)	0V	-0.05V ~ 5.4V	S.A.L.	S.A.L.	+0.05V ~ 5.4V	S.A.L.	S.A.L.
CH10 Speed feedback (auxiliary)	0V	S.A.L.	S.A.L.	S.A.L.	0V	S.A.L.	S.A.L.
PHU , Pulse signal PHZ	band width is 500 μ s		S.A.L.	S.A.L.	S.A.L.	S.A.L.	S.A.L.
FG Logic output choice of forward reverse	forward + stop "L" reverse + stop "L"	"H" about 14V	S.A.L.	S.A.L.	"L"	S.A.L.	S.A.L.
RG Logic output choice of reverse forward	forward + stop "L" reverse + stop "L"	"L" about 0V	S.A.L.	S.A.L.	"M"	S.A.L.	S.A.L.
* OSC Oscillation frequency		S.A.L.	S.A.L.	S.A.L.	S.A.L.	S.A.L.	S.A.L.
SM Y shift	-7V ~ -9V	0V ~ 1V	S.A.L.	S.A.L.	S.A.L.	S.A.L.	S.A.L.
TOD IC output for torque discrimination	forward + stop "L" reverse + stop "H"	"L" about 0V	S.A.L.	S.A.L.	"H"	S.A.L.	S.A.L.

The voltages and wave forms on check pins (motor runs)


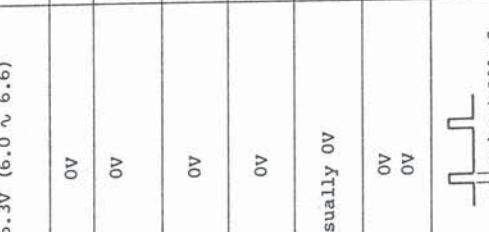
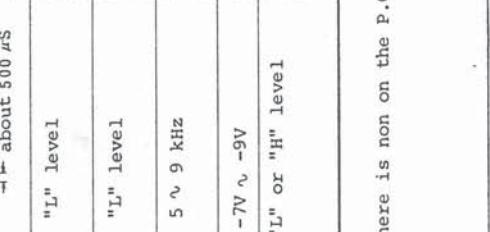
Operation Modes Check point	Stop	Forward in acceleration (Changing the setting)	Steady state in forward	Forward in deceleration (Changing the setting)	Reverse in acceleration (Changing the setting)	Steady state in reverse	Reverse in deceleration (Changing the setting)
CH1 Standard input voltage	usually 0V 0 to 10 V depending	-0.1V ~ 10.1V	S.A.L.	+0.1V ~ +10.1V	S.A.L.	S.A.L.	S.A.L.
CH2 Auxiliary input voltage	upon machines						
CH3 ASR output	0V	0V ~ +5.25V	S.A.L.	0V ~ -5.25V	S.A.L.	S.A.L.	0V ~ +5.25V
CH4 ACR output for orientation O.T	+7.2V ~ +7.8V +6.3V (6.0 ~ 6.6)	min. +1.1V ~ 7.8V	S.A.L.	S.A.L.	S.A.L.	S.A.L.	S.A.L.
CH5 Speed feedback	0V	+0.1V ~ 10.1V max. 0 ~ -1.0V	S.A.L.	S.A.L.	-0.1V ~ -10.1V	S.A.L.	S.A.L.
CH6 Current feedback	0V	0V ~ +5.25V	S.A.L.	S.A.L.	S.A.L.	S.A.L.	S.A.L.
CH7 ASR output (rectification)	0V	+0.1V ~ +10.1V	S.A.L.	S.A.L.	S.A.L.	S.A.L.	S.A.L.
CH8 Speed feedback (rectification)	0V	+0.01V ~ +1.1V	S.A.L.	S.A.L.	0.05V ~ +5.4V	S.A.L.	S.A.L.
CH9 Standard input (limiter)	usually 0V	-0.05V ~ 5.4V	S.A.L.	S.A.L.	-0.01V ~ -1.1V	S.A.L.	S.A.L.
CH10 Speed feedback (auxiliary)	0V 0V	between α min ~ γ min 	S.A.L.	between α min ~ γ min 	S.A.L.	S.A.L.	S.A.L.
PHU PHZ	"L" level	"H" level	S.A.L.	"L" level	S.A.L.	S.A.L.	"H" level
FG	Logic output choice of forward	"L" level	"L" level	"H" level	S.A.L.	S.A.L.	"L" level
RG	Logic output choice of reverse	"L" level	"H" level	S.A.L.	S.A.L.	S.A.L.	S.A.L.
* OSC	Oscillation frequency	5 ~ 9 kHz	S.A.L.	S.A.L.	S.A.L.	S.A.L.	S.A.L.
SH	shift	-7V ~ -9V	0 ~ +1V	S.A.L.	S.A.L.	S.A.L.	S.A.L.
TOD	IC output for torque discrimination	"L" or "H" level	"L" level	"H" level	S.A.L.	S.A.L.	"L" level



Controlling power supply on P.C.Bs

	P1 - M	P - M	N - M
SREG P.C.B. CDPB3CPS-62	+22 ~ 26V	+14.8 ~ 15.2V	-14.8 ~ 15.2V
" -82	"	"	"
FREG P.C.B. CDPB1CAF-31	-	+15.0 ~ 17.5V	-15.0 ~ 17.5V
" -42	+21 ~ 30V	+11.2 ~ 13.1V	-11.2 ~ 13.1V
" -	"	"	"

The voltage wave forms of checkpins on FREG P.C.B.

 A. CDPB1CAF-31

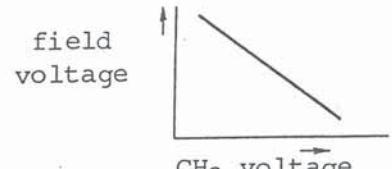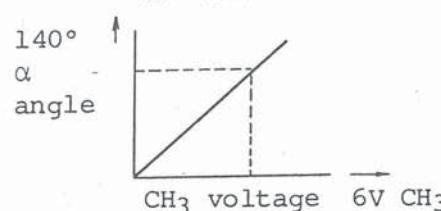	Stop	Operation	Remarks
CH1 Comparation of voltage weakening circuit	0V	0 ~ -12V	detections of armature voltage and current
CH2 Setting volt voltage of strengthening the field (at VR4)	+1 ~ 6.5V min 10 ~ 55V max 160~180V	same as left column	the voltage changes according to the field voltage setting value  field voltage ↑ CH2 voltage →
CH3 AFR output	+1 ~ 8V	same as left	at standard 6V $\alpha = 140^\circ$  140° ↑ α angle CH3 voltage → 6V CH3
CH4 Standard voltage of weakening circuit	+10 ~ 12V	same as left	
CH5 Synchronous signal			
CH6 Pulse signal	about 0.2V 	same as left	

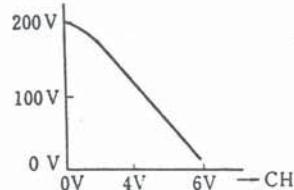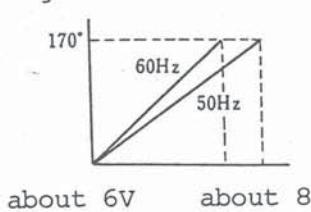	Stop	Operation	Remarks
CH1 Comparison of voltage weakening circuit (armature voltage and current feed back)	0V	0 ~ 6V	about -6V/100%
CH2 Input voltage of current feed back	Strengthened current about -5V/100%	-5 ~ 0V	
CH3 Phase regulating voltage	Strengthened current 1.5 ~ 3.5V (different in each motor specification)	0 ~ 8V	 <p style="text-align: center;">α angle</p> 

4-9 List of Adjusting Volumes and Their Usage

SREG P.C.B. (CDPB3CPS-82)

(" -62)

(" -83)

RPM

Sym-bols	Usage	Standard setting	Remarks
VR1	ASR gain for adjustment	.5~7N	It varies with optimum value of each machine.
VR2	Speed feed back "	-	It differes in each specification
VR3	Speed meter "	7.5~9N	When an meter has full scale of 10V
VR4	Current limiting "	-	It differs in each specification
VR5	Not used	-	Usually not used
VR6	Upper limit of forward speed setting "	3~4.5N	Use 1KΩ for adjustment, when max 10V is set.
VR7	Upper limit of reverse speed setting "	3~4.5N	"
VR8	ASR 0 point adjustment	0~6V	
VR9	Not used	-	-
VR10	Phase shift angle (U, X phase) "	0~6N	-
VR11	" (V, Y phase) "		-
VR12	" (W, Z phase)		-
VR13	Adjustment of speed feed back quantity	6N	
VR14	"	0~6N	
VR15	Detective point of over current for adjustment	2~4N	
VR16	Detective angle of tacho loss "	2~4N	


Without o marked VRs don't touch them because of finishing setting

cf) On the P.C.B. CDPB3CPS-62 type there is not VR₁₄, VR₁₅ and VR₁₆.

UNDER RE-GENERATING
MOTOR VOLTAGE FOR → REV.

回生中

電機子電圧 正転から逆転に設定変更した途中

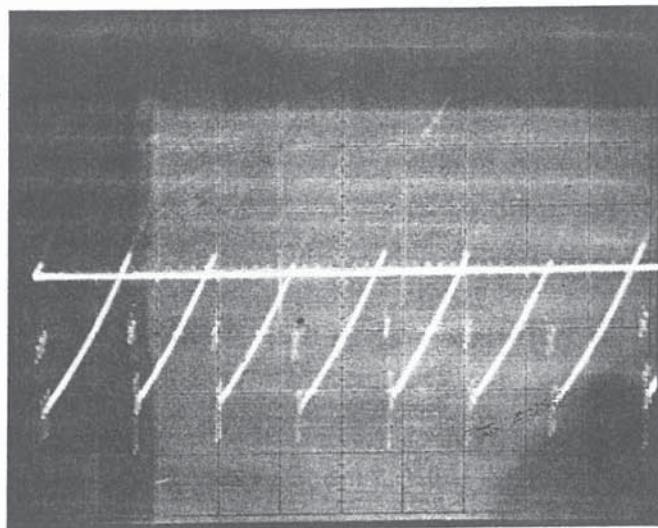



100V, 2ms/DIV

UNDER RE-GENERATING
MOTOR VOLTAGE REV.→ FOR.

回生中

電機子電圧 逆転から正転に設定変更した途中

2 MS Sweep Time

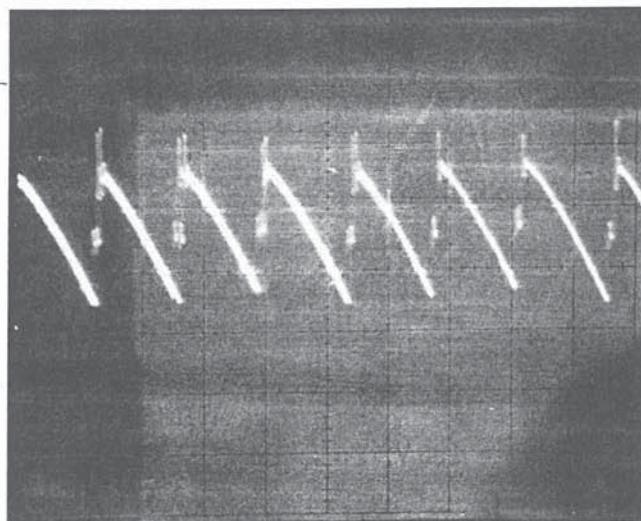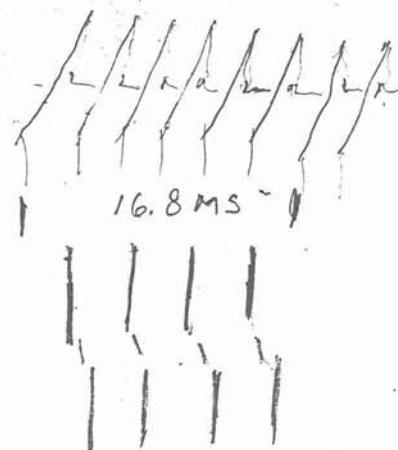


100V, 2ms/DIV

NOTE : MEASURE BETWEEN TERMINAL MP AND MN

注 : 端子MP, MN間で測定

MOTOR CURRENT, NO LOAD


電機子電流（無負荷運転）

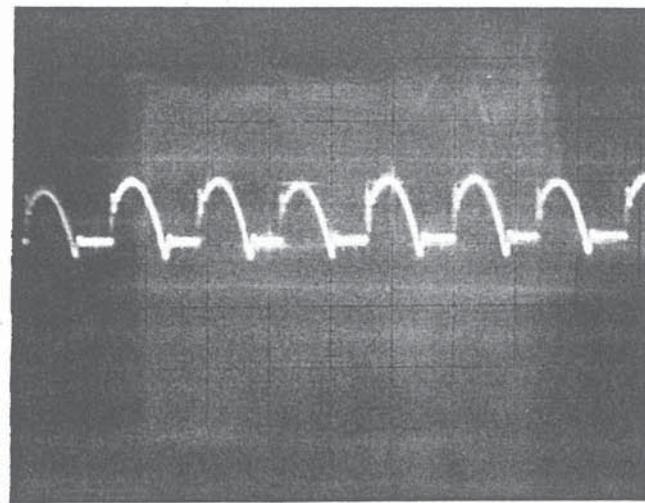

1 V, 2 ms/DIV

MOTOR CURRENT, ON LOAD

電機子電流（負荷）

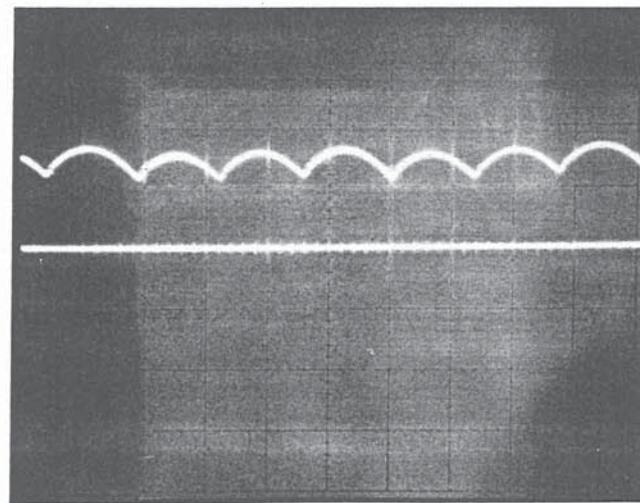


10 V, 2 ms/DIV

BETWEEN TERMINAL P1 AND M

ON SREG. P.C.B

P1電源 (SREGプリント板P1-M)

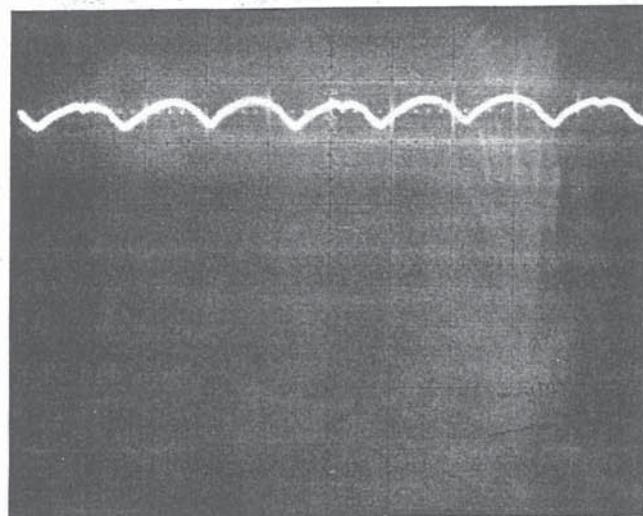


10V, 2ms/DIV

BETWEEN TERMINAL P, N AND M

ON SREG. P.C.B

P, N電源 (SREGプリント板P-M, N-M)

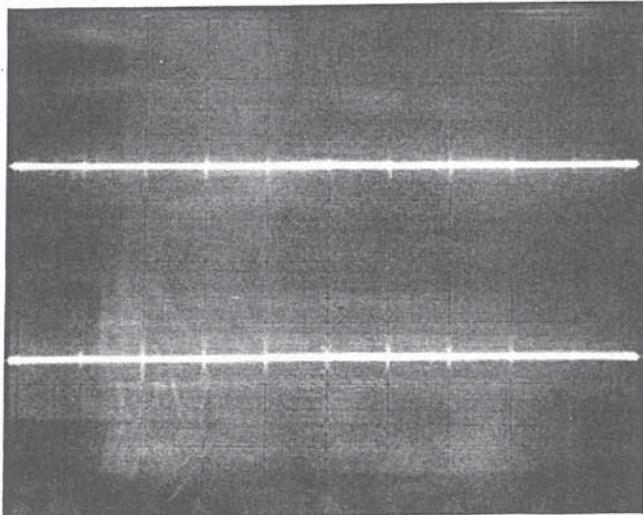

10V, 2ms/DIV

Comes from C14, C15, ...
BETWEEN CHECK TERMINAL CH₆ AND M
ON NO LOAD (ON SREG. P.C.B.)


2MS Sweep Time

無負荷運転 (SREGプリント板 CH₆-M)


check Both forward & Rev. for wave form

looks like this

~~~~~  
a thyristor or  
the Board that  
Drive the thyristor  
is Bad

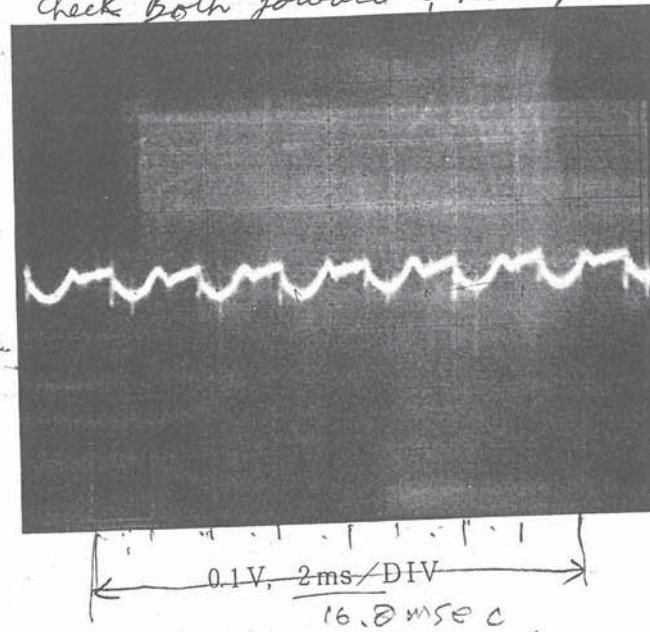


Look more Like

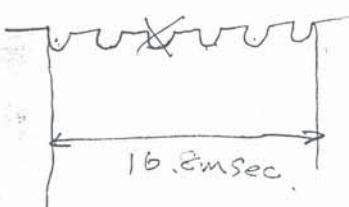


like



BETWEEN CHECK TERMINAL CH<sub>6</sub> AND M  
ON ACCELERATING (ON SREG. P.C.B.)  
電流制限加速中 (SREGプリント板 CH<sub>6</sub>-M)

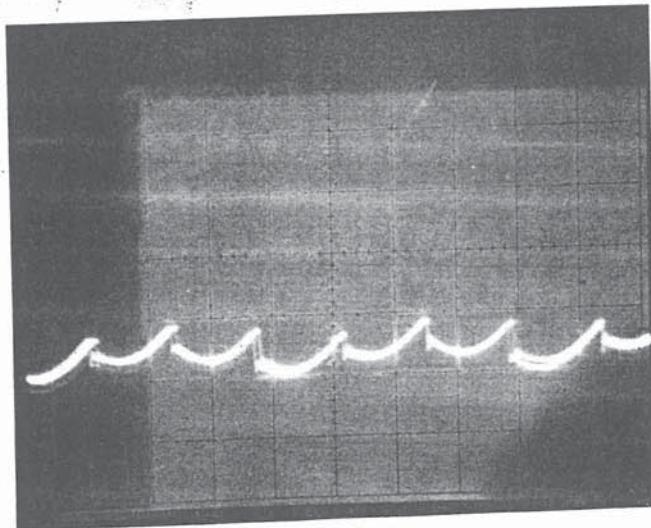

GATE PULS (AT GATE OPEN)  
ゲートパルス (サイリスタゲートオープン) GU1-KU1

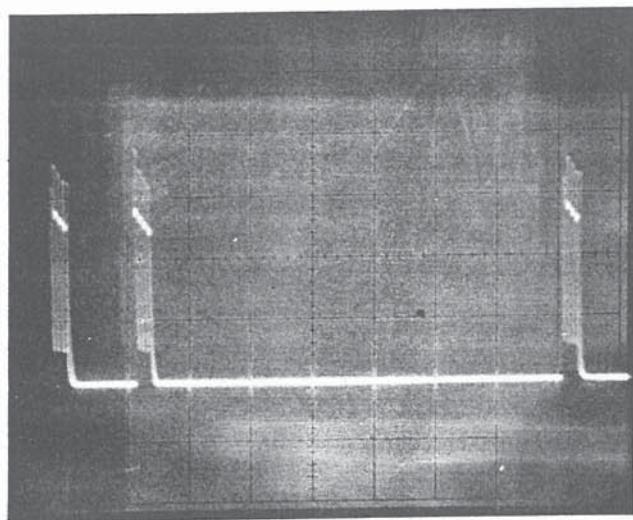

2 V, 2 ms/DIV

## 5. Trouble shootings

| Fault conditions                                                              | Check points                        | Check items                                                                                                                                                                     | Judgement of failures                                                                                                                                                                                                                                       | Treatments                                                                           |
|-------------------------------------------------------------------------------|-------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------|
| Motor doesn't move                                                            | Wire connections<br>D.C. alarm      | Is there wrong connections?<br>Is D.C. alarm LED on?                                                                                                                            | Certify wire connections.<br>Refer to the item of D.C. alarm check points.                                                                                                                                                                                  | Correct wire connections                                                             |
| Thyristor convertor unit                                                      | Is the aux. control voltage normal? | Check the voltage between check pins N, P, P <sub>1</sub> and M terminal.<br>N-M -15V±1.5V<br>P-M +15V±1.5V<br>P <sub>1</sub> -M +24V±2.0V                                      |                                                                                                                                                                                                                                                             | Same as left<br>Power supply                                                         |
|                                                                               | Is the field current applied?       | Is the voltage between MJ and MK DC 105 ~ 120V?                                                                                                                                 |                                                                                                                                                                                                                                                             | Power supply                                                                         |
|                                                                               | Is the speed setting signal in?     | Check the voltage between check pins CH <sub>1</sub> , CH <sub>2</sub> and M terminal.<br>DC±10V is max. speed<br>- sign means forward rotation<br>+ sign does reverse rotation |                                                                                                                                                                                                                                                             | Speed setting circuit<br>(around a NC equipment or V.R.)                             |
| Motor rotates but the speed is not uncontrollable                             | Wire connections<br>Drive unit      | Is there wrong connections?<br>Is the speed setting voltage normal?                                                                                                             | Certify wire connections.<br>Is the voltage between check pins CH <sub>1</sub> , CH <sub>2</sub> and M terminal changeable according to the speed setting voltage?<br>DC±10V is max. speed<br>- sign means forward rotation<br>+ sign does reverse rotation | Correct wire connections<br>Speed setting circuit<br>(around a NC equipment or V.R.) |
| For the speed setting voltage, the motor speed is considerably unproportional | Drive unit<br>Motor                 | Is the adjustment of VR <sub>2</sub> slipped off?                                                                                                                               | Turning VR <sub>2</sub> to the right, it becomes slow, and to the left, it does high.                                                                                                                                                                       | Adjustment                                                                           |
|                                                                               | Tacho generator                     | How about the abrasion of brushes of T.G.?                                                                                                                                      |                                                                                                                                                                                                                                                             | Changing brushes                                                                     |
|                                                                               | Drive unit                          | Is it correct in the drive unit?                                                                                                                                                |                                                                                                                                                                                                                                                             | Changing over                                                                        |
|                                                                               | Power supply                        | Is the power supply phase order R-S-T correct?                                                                                                                                  |                                                                                                                                                                                                                                                             | Changing wire connections                                                            |
|                                                                               | Phase lack                          | Is the three phases of power supply applied?                                                                                                                                    |                                                                                                                                                                                                                                                             | Power supply                                                                         |
| Actual speed and meter indication are different.                              | Wire connections<br>Drive unit      | Is there wrong connections?<br>Adjustment of VR <sub>3</sub>                                                                                                                    | Certify wire connections.<br>Turning VR <sub>3</sub> to the right, meter indication value becomes high, and to the left, it does low.                                                                                                                       | Correct wire connections<br>Adjustment                                               |

## 6. Alarm

- 1) LED (Light Eliminate Diode) for indicator of D.C. spindle alarm.

Thyristor convertor unit have 6 LED, and each LED light at such a following troubles.


- o SFL (Start-up delay circuit)  
Start up delay is to protect over speed in case there was no feedback voltage of tacho generator (for example connecting wire is link-out), and to detect field current loss due to field burn-out.
- o 37FL (Thyrisfuse blowing out)  
The fuse is blown out due to some case; short-circuit, thyristor fault and commutation failure or thyristor misfiring.
- o OSL (Motor over speed)  
Over speed detector circuit act at the motor speed more than 115% of rating.
- o 88L (Motor cooling fan overload)  
In case of overload of the cooling fan for the reason that bearings are in abnormal position, fan impellers are touching some portion, or something like that, thermal relay connected with cooling fan motor in series operate immediately, and turn off D.C. spindle motor.
- o PTCL (Motor overheat)  
In case of continuous overload of the motor or its locking state, motor winding temperature may rise and insulation may be deteriorated in some cases. In order to prevent these cases, thermistors are to be added to the stator side inside the motor, and the temperature rise is to be detected.
- o OCL (Over current)  
Over current detecting circuit act at 200% over load of spindle motor rating.

Above 6 LED are mounted on printed circuit board shown in Fig. 1 [11].

- 2) How to check when LED lights

### 2)-1 SFL

|   | CHECK POINT                                                                                                                                                                             | TREATMENT                                                                                        |
|---|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------|
| 1 | Does field current flow or not, you can check field voltage instead of current between thermal MJ and MK mounted on field regulator.<br>Standard value of field voltage is 105V ~ 120V. | Make sure AC power source.<br>It's usual, the voltage between terminal UF and VF is 190V ~ 240V. |
| 2 | Tacho-brushes turn out.                                                                                                                                                                 | Change brushes according to turn out condition.                                                  |
| 3 | Is the spindle, connected to a motor, locked by over biting of bite with work.                                                                                                          | Reset                                                                                            |
| 4 | Tacho-loss by linking out of lead wire.                                                                                                                                                 | Correct connection.                                                                              |

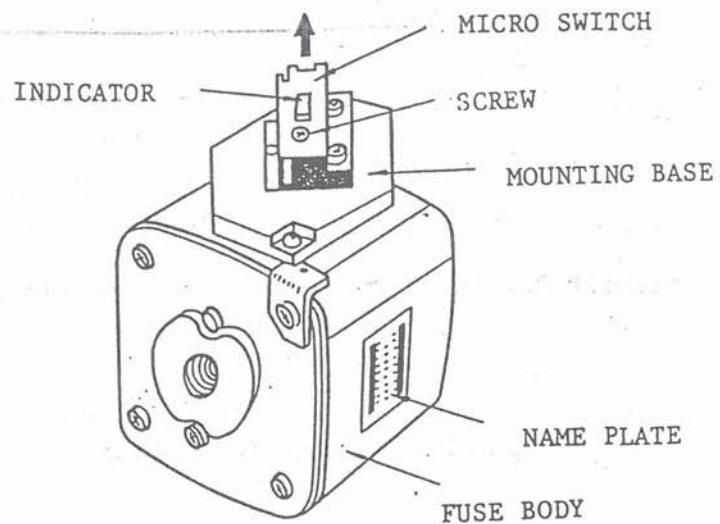

The fuse is connected between S.C. power source, U, V, and W phase, and thyristor in series to protect the thyristor from heavy current. If the fuse is blown out, indicator of micro switch installed at the top of the fuse body shows trouble. In above case, you have to change the fuse. Though the fuse is pushed on the mark, it is of no use against blowing off. (When changing fuse, please make sure current and type of fuse appeared on label covered fuse body.

|   | CHECK POINT                                                                                                                                                                                                                                                              | TREATMENT                                                                                     |
|---|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------|
| 1 | Make sure frequency change 50Hz or 60 Hz.                                                                                                                                                                                                                                | Set the correct frequency.<br>(Refer to Fig. 2 and Fig. 3)                                    |
| 2 | Is the AC power source's phase rotating correct? (R → S → T).                                                                                                                                                                                                            | Make sure and connect correctly.                                                              |
| 3 | Is there a lack of a phase?                                                                                                                                                                                                                                              |                                                                                               |
| 4 | Is the A.C. power supply voltage kept at normal value?                                                                                                                                                                                                                   |                                                                                               |
| 5 | Does an electricity failure occur?                                                                                                                                                                                                                                       | Change fuse.                                                                                  |
| 6 | Is there short circuit?<br>Put off the power supply, check the terminals of the unit main circuit over 500 kΩ.<br>Check points between U and V, V and W, W and U, U and MP (MN), V and MP (MN), W and MP (MN), U and ground, W and ground, MP and ground, MN and ground. | Repair the short circuit.<br>Changing the thyristor because of it's failure.<br>Change fuses. |




|   | CHECK POINT                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     | TREATMENT                                                                                        |
|---|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------|
| 1 | Is lead wire of tacho-generator or motor's filed connected in correct polarity.                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |                                                                                                  |
|   | <p>1 Put off the power supply [breaker] and take off the secondary wire connections of a main magnet contactor 52.</p> <p>2 Put on the power supply [breaker] and certify the fan motor rotation. [Don't apply the start signal.]</p> <p>3 Under the conditions 2 , certify the accordance of two polarities by checking the output terminal MP and the check pin CH5 with a tester by rotating the motor manually.<br/>When the polarities are different, change the connections MJ and MK of a field unit after putting off power supply.</p> | When the motor rotating direction is wrong, change the connections MJ - MK and TDP - TDN of T.G. |

|   | CHECK POINT                                                                      | TREATMENT                      |
|---|----------------------------------------------------------------------------------|--------------------------------|
| 1 | Is the thermal setting value of the cooling fan motor for spindle motor correct? | Thermal reset.                 |
| 2 | Is the blade of a cooling fan struck or rubbed anywhere?                         | Removal of an alien substance. |
| 3 | Is single phase operation occurred?                                              |                                |
| 4 | Is power supply normal?                                                          |                                |
| 5 | Is the resistances of fan motor balanced?                                        | Change fan motor.              |

|   | CHECK POINT                                                                                                                                                                                                                   | TREATMENT  |
|---|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|
| 1 | Is motor frame in very hot condition?<br>(If PTCL light at motor frame cooling condition, it may be trouble on linking out of lead wire of PCT thermistor element. In this case, please make shorted circuit it's lead wire.) | Over load. |
| 2 | Is the rotating direction of fan motor correct.                                                                                                                                                                               |            |
| 3 | Is ventilation inlet of cooling fan motor dusty.                                                                                                                                                                              | Clean up.  |

|   | CHECK POINT                                                           | TREATMENT                   |
|---|-----------------------------------------------------------------------|-----------------------------|
| 1 | Is the adjusting volume VR <sub>1</sub> set at extreme max. position? | Turn it to the left.        |
| 2 | Others are same as the cases of 37FL.                                 | Refer to the table of 37FL. |


## IV. D.C. Motor

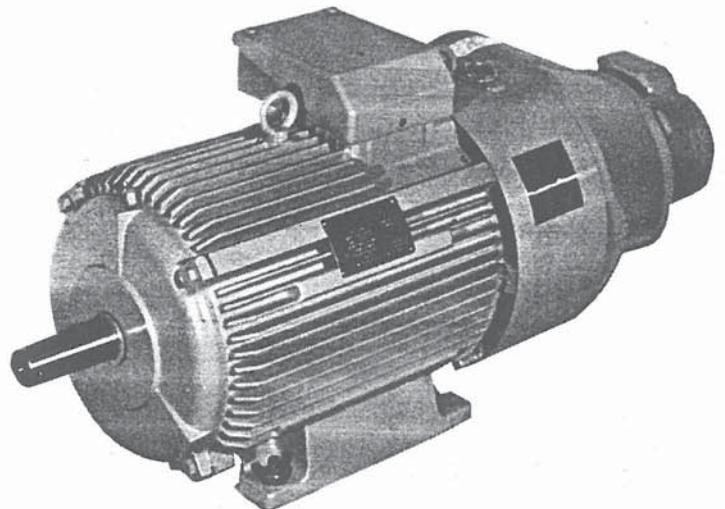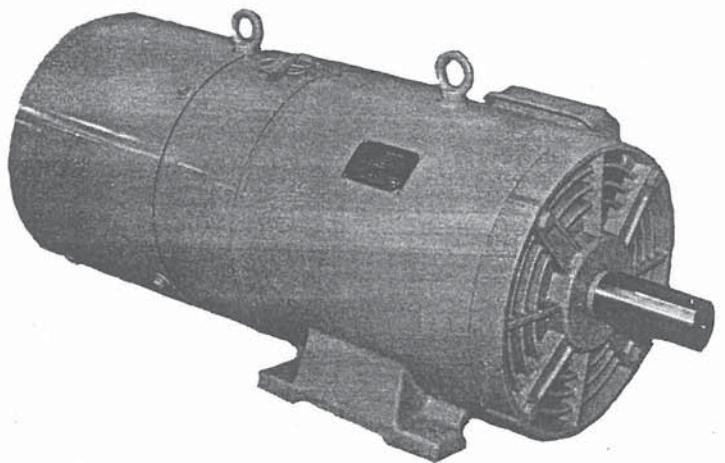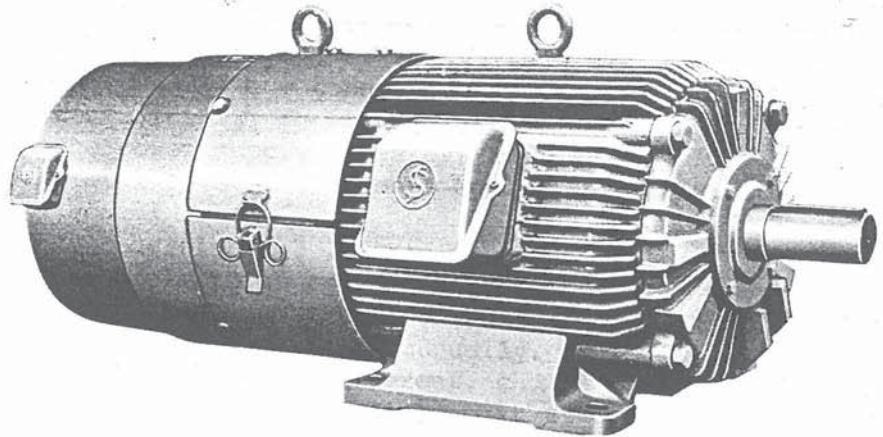

## Structure


### 1-1 Open Type Motor

[1] GGN type: with axial fan

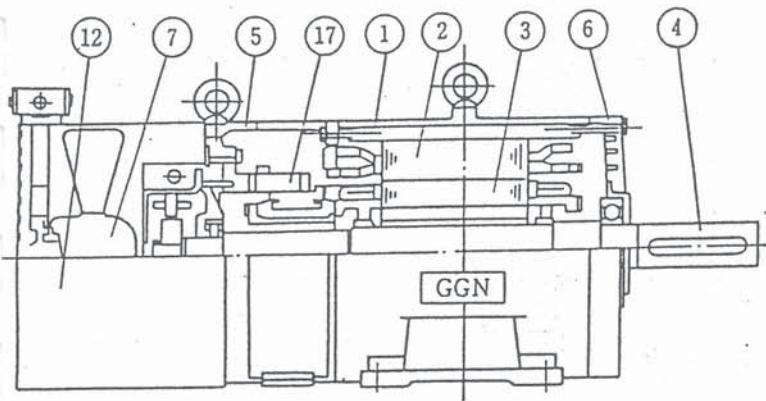


| No. | Part list              |
|-----|------------------------|
| 1   | Frame                  |
| 2   | Stator                 |
| 3   | Armature               |
| 4   | Shaft                  |
| 5   | Commutator side shield |
| 6   | Drive side shield      |
| 7   | Axial Fan              |
| 8   | Build-in Fan           |
| 9   | Mount Fan              |
| 10  | Ventilation cover      |
| 11  | Inspection cover       |
| 12  | Fan cover              |
| 13  | A.C. Tacho-Generator   |
| 14  | D.C. Tacho-Generator   |
| 15  | Terminal Box           |
| 16  | Brash rocker           |
| 17  | Brush spindle          |
| 18  | Brush holder           |
| 19  | Brush                  |
| 20  | Commutator             |
| 21  | Air guide              |

[2] GGG type: with build-in fan

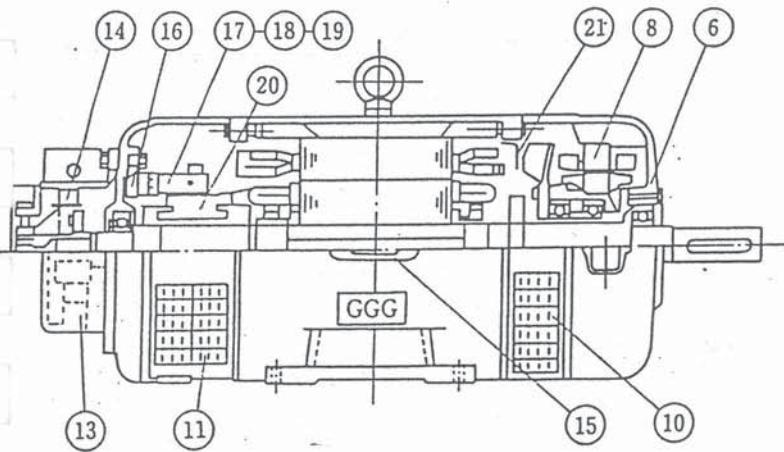


[3] GGF type: with mount fan

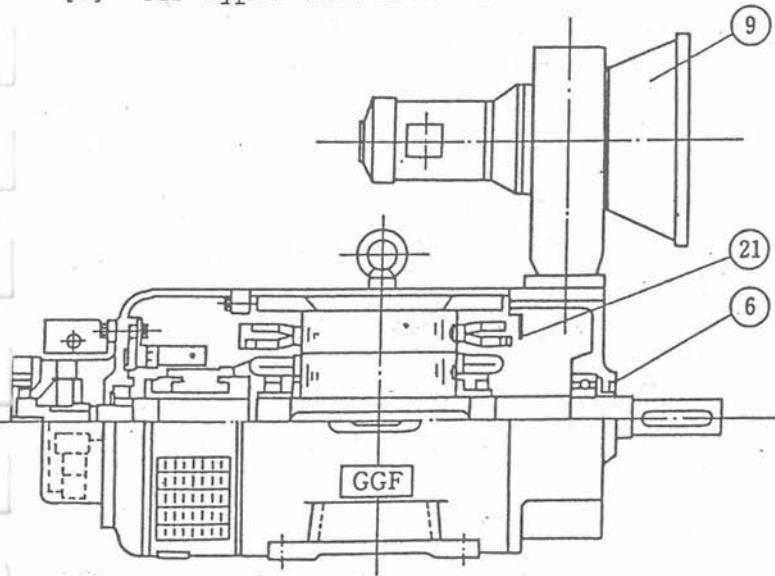

1-2 Close Type Motor


D.C. MOTOR TYPE I.

GHP6138      GHP6166      GHP6168  
GHP6184      GHP6188

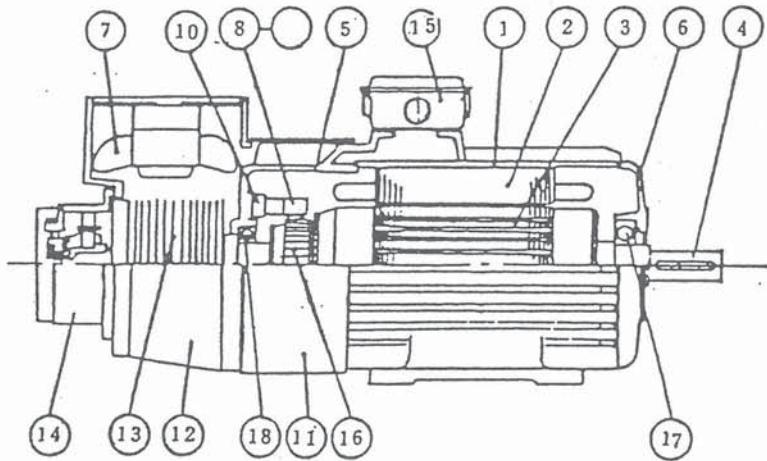

D.C. MOTOR TYPE II.

GHP6134  
GHP6164

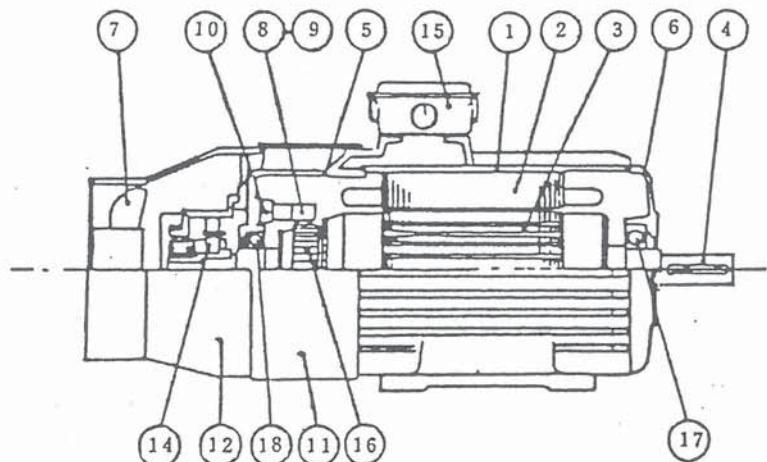

| No. | Part list               |
|-----|-------------------------|
| 1   | Frame                   |
| 2   | Stator                  |
| 3   | Armature                |
| 4   | Shaft                   |
| 5   | Commutator side shield  |
| 6   | Drive side shield       |
| 7   | Axial Fan               |
| 8   | Brush holder            |
| 9   | Brush                   |
| 10  | Brush rocker            |
| 11  | Inspection cover        |
| 12  | Fan cover               |
| 13  | Cooling Fin             |
| 14  | D.C. Tacho Generator    |
| 15  | Terminal Box            |
| 16  | Commutator              |
| 17  | Drive side bearing      |
| 18  | Commutator side bearing |

#13 Brush Holder 3E.212.5

## 2. 外形寸法図

### 2-1 Open type (G3 TYPE) Motor

#### Mount Foot Type (F 11)

Diagram A



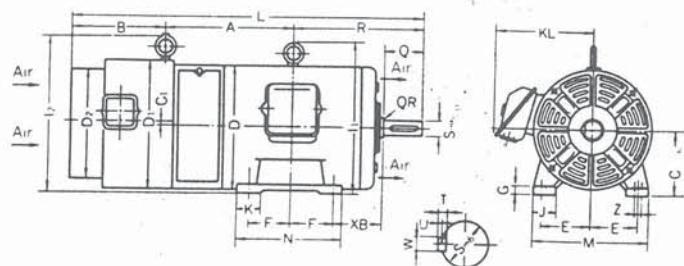


Diagram B

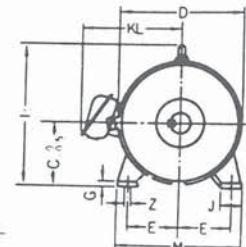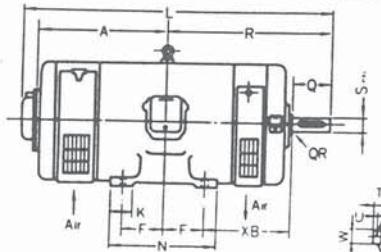

[Unit:mm]

| Type     | A     | B   | C   | D    | D <sub>2</sub> | E   | F   | G     | I <sub>1</sub> | I <sub>2</sub> | J   | K   | KL | L <sup>*</sup> | M   | N      | R   | XB  | Z     | Q   | QR | S   | T   | U  | W  | Bearing |              | Wt.    | GD <sup>2</sup>     | Fan motor         |       |         |         |         |   |   |
|----------|-------|-----|-----|------|----------------|-----|-----|-------|----------------|----------------|-----|-----|----|----------------|-----|--------|-----|-----|-------|-----|----|-----|-----|----|----|---------|--------------|--------|---------------------|-------------------|-------|---------|---------|---------|---|---|
|          |       |     |     |      |                |     |     |       |                |                |     |     |    |                |     |        |     |     |       |     |    |     |     |    | DS | BS      | Capacity [W] |        | (kgm <sup>2</sup> ) | Power voltage (V) | Poles | Diagram |         |         |   |   |
| GGN3134A | 216   | 301 | 132 | 0    | 260            | 265 | 214 | 108   | 70             | 17             | 311 | 311 | 45 | 50             | 210 | 756    | 250 | 180 | 239   | 89  | 12 | 80  | 1   | 32 | 8  | 4       | 5            | 10     | 6307ZZ              | 6207ZZ            | 80    | 0.13    | 80/120  | 200/220 | 2 | A |
| GGN3138A | 235   |     |     |      |                |     |     |       | 89             |                |     |     |    |                |     | 794    |     | 212 | 258   |     |    |     |     |    |    |         |              |        |                     | 95                | 0.17  |         |         |         |   |   |
| GGN3164A |       |     |     |      |                |     |     |       |                |                |     |     |    |                |     |        |     |     |       |     |    |     |     |    |    |         |              |        |                     |                   |       |         |         |         |   |   |
| GGN3168A | 304.5 | 276 | 160 | 0    | 310            | 315 | 315 | 127   | 105            | 18             | 376 | 376 | 50 | 63             | 275 | 903.5  | 300 | 250 | 323   | 108 | 15 | 110 | 1   | 42 | 8  | 4       | 5            | 12     | 6310ZZ              | 6208ZZ            | 135   | 0.38    | 50/80   | 200/220 | 4 | A |
| GGN3184A | 343   | 298 | 180 | 7.5  | 350            | 365 | 365 | 139.5 | 120.5          | 20             | 425 | 425 | 75 | 75             | 295 | 992.5  | 350 | 292 | 351.5 | 121 | 15 | 110 | 2   | 55 | 10 | 5       | 15           | 6312ZZ | 6209ZZ              | 210               | 0.81  | 80/120  | 200/220 | 4       | A |   |
| GGN3188A | 362   |     |     |      |                |     |     |       | 139.5          |                |     |     |    |                |     | 1030.5 |     | 330 | 370.5 |     |    |     |     |    |    |         |              |        | 235                 | 0.91              |       |         |         |         |   |   |
| GGN3204A | 428.5 | 306 | 200 | 12.5 | 400            | 415 | 415 | 159   | 152.5          | 22             | 475 | 475 | 80 | 85             | 390 | 1160   | 390 | 360 | 425.5 | 133 | 19 | 140 | 2   | 60 | 10 | 5       | 15           | 6213ZZ | 6211ZZ              | 310               | 1.6   | 150/220 | 200/220 | 4       | A |   |
| GGN3208A |       |     |     |      |                |     |     |       |                |                |     |     |    |                |     |        |     |     |       |     |    |     |     |    |    |         |              |        | 340                 | 1.9               |       |         |         |         |   |   |
| GGG3226A | 456.5 | -   | 225 | -    | 450            | -   | -   | 178   | 178            | 30             | 526 | -   | 80 | 92             | 420 | 1190   | 436 | 430 | 623   | 305 | 19 | 140 | 1.5 | 65 | 12 | 6       | 18           | 6314ZZ | 6212ZZ              | 460               | 2.8   | 260/450 | 200/220 | 4       | B |   |
| GGG3228A |       |     |     |      |                |     |     |       |                |                |     |     |    |                |     |        |     |     |       |     |    |     |     |    |    |         |              |        | 495                 | 3.2               |       |         |         |         |   |   |

#### Flange type (L 51)

Diagram C



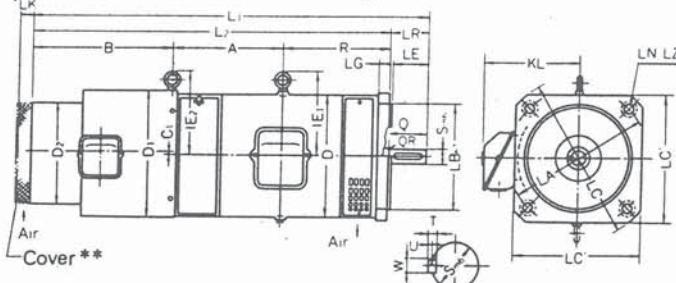


Diagram D

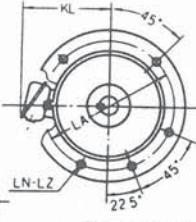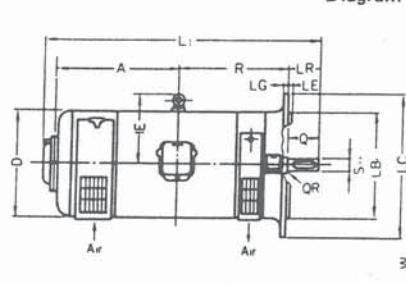

[Unit:mm]


| Type     | LA  | LB  | LC  | LC' | D   | D <sub>2</sub> | A   | B     | C <sub>1</sub> | R    | LR    | L <sub>1</sub> <sup>*</sup> | L <sub>2</sub> <sup>*</sup> | IE <sub>1</sub> | IE <sub>2</sub> | KL    | LZ  | LN (ea.) | LG | LE | Q | QR  | S   | T  | U  | W   | Bearing |              | Wt.    | GD <sup>2</sup>     | Fan motor         |       |         |         |         |   |   |
|----------|-----|-----|-----|-----|-----|----------------|-----|-------|----------------|------|-------|-----------------------------|-----------------------------|-----------------|-----------------|-------|-----|----------|----|----|---|-----|-----|----|----|-----|---------|--------------|--------|---------------------|-------------------|-------|---------|---------|---------|---|---|
|          |     |     |     |     |     |                |     |       |                |      |       |                             |                             |                 |                 |       |     |          |    |    |   |     |     |    |    | DS  | BS      | Capacity [W] |        | (kgm <sup>2</sup> ) | Power voltage (V) | Poles | Diagram |         |         |   |   |
| GGN3134G | 300 | 230 | 350 | 270 | 260 | 265            | 214 | 216   | 301            | 0    | 212.5 | 80                          | 809.5                       | 729.5           | 178.5           | 178.5 | 202 | 19       | 4  | 25 | 4 | 80  | 1   | 32 | 8  | 4   | 5       | 10           | 11     | 6209ZZ              | 6207ZZ            | 85    | 0.13    | 80/120  | 200/220 | 2 | C |
| GGN3138G |     |     |     |     |     |                |     |       | 235            |      | 231.5 |                             | 847.5                       | 767.5           |                 |       |     |          |    |    |   |     |     |    |    |     |         | 100          | 0.17   |                     |                   |       |         |         |         |   |   |
| GGN3164G | 350 | 280 | 400 | 320 | 310 | 315            | 315 | 304.5 | 305            | 0    | 267.5 | 110                         | 987                         | 877             | 205             | 205   | 267 | 19       | 4  | 25 | 5 | 110 | 1   | 42 | 8  | 4   | 5       | 12           | 7      | 6310ZZ              | 6208ZZ            | 145   | 0.38    | 50/80   | 200/220 | 4 | C |
| GGN3168G | 400 | 350 | 450 | 380 | 350 | 365            | 365 | 343   | 303            | 7.5  | 286   | 110                         | 1042                        | 932             | 245             | 245   | 282 | 19       | 4  | 25 | 5 | 110 | 2   | 55 | 10 | 5   | 15      | 130          | 6312ZZ | 6209ZZ              | 225               | 0.81  | 80/120  | 200/220 | 4       | C |   |
| GGN3184G | 400 | 350 | 450 | 380 | 350 | 365            | 365 | 343   | 303            | 7.5  | 305   | 1080                        | 970                         |                 |                 |       |     |          |    |    |   |     |     |    |    | 170 | 0.45    |              |        |                     |                   |       |         |         |         |   |   |
| GGN3188G | 450 | 400 | 500 | 430 | 400 | 415            | -   | 428.5 | -              | 12.5 | 362.5 | 140                         | 1242                        | 1102            | -               | 275   | 390 | 24       | 4  | 25 | 5 | 140 | 2   | 60 | 10 | 5   | 15      | 120          | 6213ZZ | 6211ZZ              | 325               | 1.6   | 150/220 | 200/220 | 4       | C |   |
| GGN3204G | 450 | 400 | 500 | 430 | 400 | 415            | -   | 428.5 | -              | 12.5 | 362.5 | 140                         | 1242                        | 1102            | -               | 275   | 390 | 24       | 4  | 25 | 5 | 140 | 2   | 60 | 10 | 5   | 15      | 120          | 6213ZZ | 6211ZZ              | 355               | 1.9   | 150/220 | 200/220 | 4       | C |   |
| GGG3226G | 500 | 450 | 550 | -   | 450 | -              | -   | 456.5 | -              | -    | 483   | 140                         | 1154                        | -               | 301             | -     | 420 | 19       | 8  | 22 | 5 | 140 | 1.5 | 65 | 12 | 6   | 18      | -            | 6314ZZ | 6212ZZ              | 460               | 2.8   | 260/450 | 200/220 | 4       | D |   |
| GGG3228G |     |     |     |     |     |                |     |       |                |      |       |                             |                             |                 |                 |       |     |          |    |    |   |     |     |    |    |     |         | 495          | 3.2    |                     |                   |       |         |         |         |   |   |

Notes : L dimension of mount foot type, L<sub>1</sub>, L<sub>2</sub> and flange type

L<sub>1</sub>, L<sub>2</sub> are included tachogenerator (KGD-02C)

## 2 - 2 Close type (G6 TYPE) Motor

### Mount Foot Type

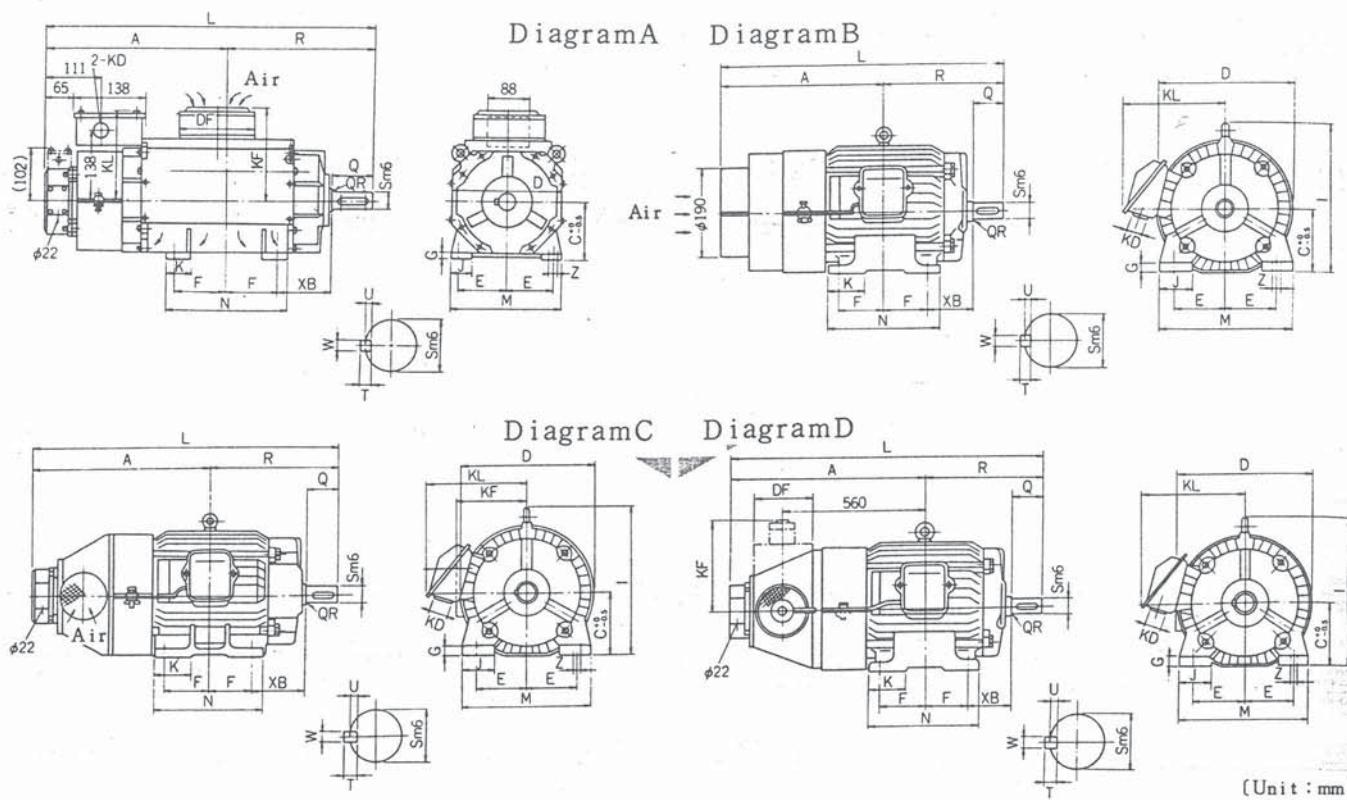


(Unit : mm)

| Type     | A     | C   | D   | E     | F     | G  | I   | J  | K  | KD | DF  | KF  | KL  | L      | M   | N   | R     | XB  | Z  |
|----------|-------|-----|-----|-------|-------|----|-----|----|----|----|-----|-----|-----|--------|-----|-----|-------|-----|----|
| GHP6114A | 314   | 112 | 234 | 95    | 70    | 12 | —   | 40 | 50 | 34 | 120 | 164 | 178 | 572    | 224 | 175 | 258   | 108 | 12 |
| GHP6116A | 372.5 | 112 | 234 | 95    | 101.5 | 12 | —   | 40 | 50 | 34 | 120 | 164 | 178 | 662    | 224 | 238 | 289.5 | 108 | 12 |
| GHP6118A | 372.5 | 112 | 234 | 95    | 101.5 | 12 | —   | 40 | 50 | 34 | 150 | 182 | 178 | 662    | 224 | 238 | 289.5 | 108 | 12 |
| GHP6133A | 412.5 | 132 | 273 | 108   | 89    | 17 | 311 | 45 | 50 | 34 | —   | —   | 212 | 700.5  | 250 | 212 | 288   | 89  | 12 |
| GHP6137A | 497.5 | 132 | 273 | 108   | 89    | 17 | 311 | 45 | 50 | 34 | 197 | 175 | 212 | 785.5  | 250 | 212 | 288   | 89  | 12 |
| GHP6163A | 476   | 160 | 320 | 127   | 105   | 18 | 376 | 50 | 63 | 48 | —   | —   | 272 | 799    | 300 | 250 | 323   | 108 | 15 |
| GHP6165A | 561   | 160 | 320 | 127   | 105   | 18 | 376 | 50 | 63 | 48 | 197 | 185 | 272 | 884    | 300 | 250 | 323   | 108 | 15 |
| GHP6167A | 626   | 160 | 320 | 127   | 127   | 18 | 376 | 50 | 63 | 48 | 225 | 200 | 272 | 971    | 300 | 300 | 345   | 108 | 15 |
| GHP6183A | 675   | 180 | 380 | 139.5 | 120.5 | 22 | 433 | 75 | 83 | 48 | 225 | 210 | 307 | 1026.5 | 350 | 292 | 351.5 | 121 | 15 |
| GHP6187A | 675   | 180 | 380 | 139.5 | 120.5 | 22 | 433 | 75 | 83 | 48 | 225 | 210 | 307 | 1103.5 | 350 | 292 | 428.5 | 168 | 15 |
| GHP6205A | 773   | 200 | 410 | 159   | 152.5 | 25 | 468 | 80 | 85 | 48 | 228 | 300 | 340 | 1198.5 | 390 | 360 | 425.5 | 133 | 19 |

| Type     | Q   | QR  | S  | T  | U   | W  | Bearing |        | Wt<br>(kg) | GD <sup>2</sup><br>(kgm <sup>2</sup> ) | Fan motor |            |         | Dia<br>gram | Frame  |
|----------|-----|-----|----|----|-----|----|---------|--------|------------|----------------------------------------|-----------|------------|---------|-------------|--------|
|          |     |     |    |    |     |    | DS      | BS     |            |                                        | Capacity  | Power      | Voltage | Poles       |        |
| GHP6114A | 80  | 1   | 32 | 8  | 4.5 | 10 | 6307ZZ  | 6206ZZ | 75         | 0.092                                  | 20        | 1φ 200/220 | 2       | A           | 112M-6 |
| GHP6116A | 80  | 1   | 32 | 8  | 4.5 | 10 | 6307ZZ  | 6206ZZ | 91         | 0.12                                   | 20        | 1φ 200/220 | 2       | A           | 112B-6 |
| GHP6118A | 80  | 1   | 32 | 8  | 4.5 | 10 | 6307ZZ  | 6206ZZ | 92         | 0.13                                   | 40        | 1φ 200/220 | 2       | A           | 112B-6 |
| GHP6133A | 110 | 0.5 | 42 | 8  | 4.5 | 12 | 6309ZZ  | 6009ZZ | 100        | 0.2                                    | 80        | 1φ 200/220 | 2       | B           | 132M-3 |
| GHP6137A | 110 | 0.5 | 42 | 8  | 4.5 | 12 | 6309ZZ  | 6009ZZ | 115        | 0.2                                    | 80        | 1φ 200/220 | 2       | C           | 132M-3 |
| GHP6163A | 110 | 1   | 55 | 10 | 5   | 15 | 6312ZZ  | 6212ZZ | 155        | 0.55                                   | 80        | 1φ 200/220 | 2       | B           | 160M-3 |
| GHP6165A | 110 | 1   | 55 | 10 | 5   | 15 | 6312ZZ  | 6212ZZ | 170        | 0.61                                   | 80        | 1φ 200/220 | 2       | C           | 160M-3 |
| GHP6167A | 110 | 1   | 55 | 10 | 5   | 15 | 6312ZZ  | 6212ZZ | 200        | 0.7                                    | 100       | 1φ 200/220 | 2       | C           | 160L-3 |
| GHP6183A | 110 | 1   | 55 | 10 | 5   | 15 | 6312ZZ  | 6215ZZ | 270        | 1.4                                    | 100       | 1φ 200/220 | 2       | C           | 180M-3 |
| GHP6187A | 140 | 1   | 65 | 12 | 6   | 18 | 6314ZZ  | 6215ZZ | 300        | 1.6                                    | 100       | 1φ 200/220 | 2       | C           | 180M-6 |
| GHP6205A | 140 | 1   | 65 | 12 | 6   | 18 | 6314ZZ  | 6215ZZ | 400        | 2.2                                    | 80/120    | 3φ 200/220 | 2       | D           | 200L-3 |

Flange type

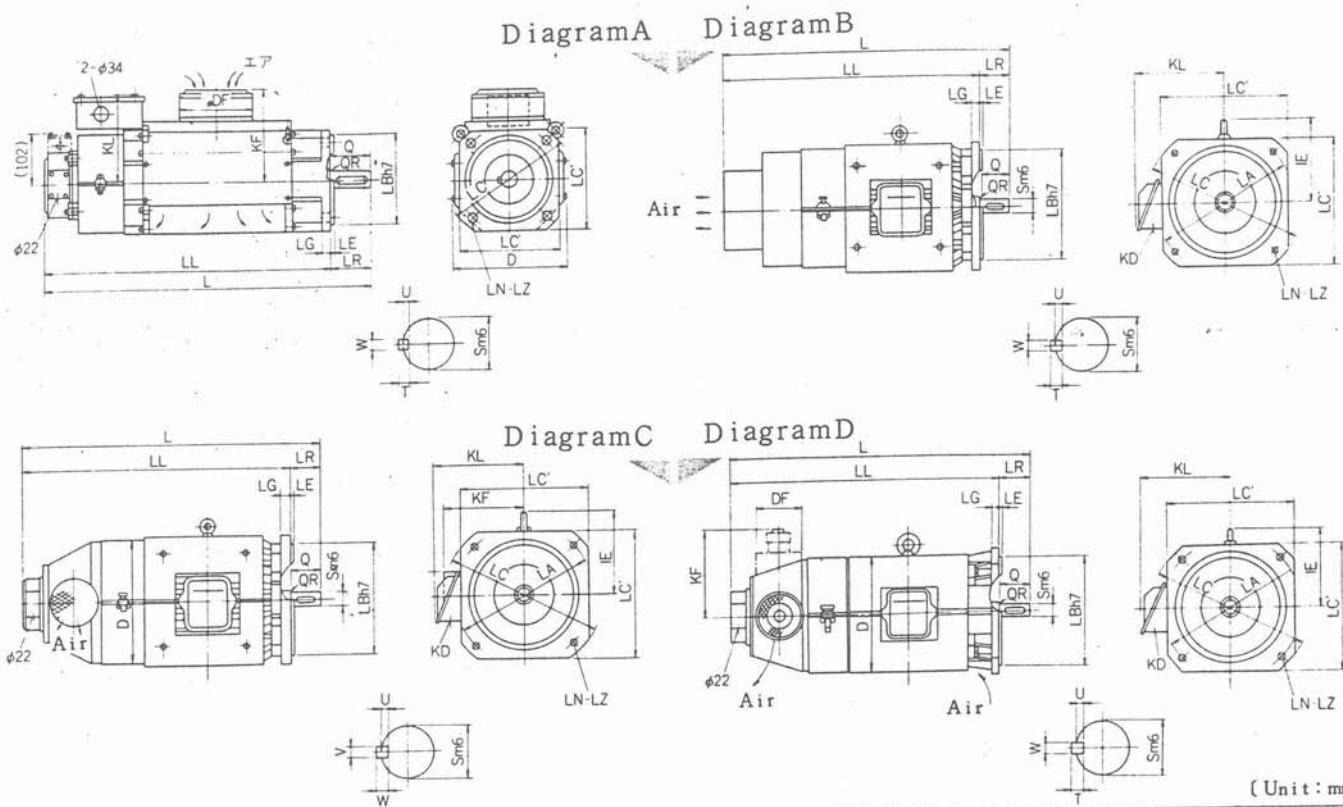

(Unit : mm)

|     | XB  | Z  |
|-----|-----|----|
| 38  | 108 | 12 |
| .5  | 108 | 12 |
| .5  | 108 | 12 |
| 89  | 89  | 12 |
| 89  | 89  | 12 |
| 108 | 108 | 15 |
| 108 | 108 | 15 |
| 108 | 108 | 15 |
| 121 | 121 | 15 |
| 168 | 168 | 15 |
| .5  | 133 | 19 |

| ram | Frame  |
|-----|--------|
|     | 112M-6 |
|     | 112B-6 |
|     | 112B-6 |
|     | 132M-3 |
|     | 132M-3 |
|     | 160M-3 |
|     | 160M-3 |
|     | 160L-3 |
|     | 180M-3 |
|     | 180M-6 |
|     | 200L-3 |

| Type     | LA  | LB  | LC  | LC  | D   | IE  | L      | LL    | LR  | LZ | LN | LG | LE | KL  | KD | DF  | KF  |
|----------|-----|-----|-----|-----|-----|-----|--------|-------|-----|----|----|----|----|-----|----|-----|-----|
| GHP6114G | 215 | 180 | 250 | 200 | 234 | —   | 572    | 492   | 80  | 15 | 4  | 18 | 5  | 178 | —  | 120 | 164 |
| GHP6116G | 215 | 180 | 250 | 200 | 234 | —   | 662    | 582   | 80  | 15 | 4  | 18 | 5  | 178 | —  | 120 | 164 |
| GHP6118G | 215 | 180 | 250 | 200 | 234 | —   | 662    | 582   | 80  | 15 | 4  | 18 | 5  | 178 | —  | 150 | 182 |
| GHP6133G | 300 | 230 | 350 | 270 | 273 | 179 | 700.5  | 590.5 | 110 | 19 | 4  | 25 | 4  | 201 | 34 | —   | —   |
| GHP6137G | 300 | 230 | 350 | 270 | 273 | 179 | 785.5  | 675.5 | 110 | 19 | 4  | 25 | 4  | 201 | 34 | 197 | 175 |
| GHP6163G | 350 | 280 | 400 | 320 | 320 | 216 | 799    | 689   | 110 | 19 | 4  | 25 | 5  | 262 | 48 | —   | —   |
| GHP6165G | 350 | 280 | 400 | 320 | 320 | 216 | 884    | 774   | 110 | 19 | 4  | 25 | 5  | 262 | 48 | 197 | 185 |
| GHP6167G | 350 | 280 | 400 | 320 | 320 | 216 | 971    | 861   | 110 | 19 | 4  | 25 | 5  | 262 | 48 | 225 | 200 |
| GHP6183G | 400 | 350 | 450 | 380 | 380 | 253 | 1026.5 | 916.5 | 110 | 19 | 4  | 25 | 5  | 300 | 48 | 225 | 210 |
| GHP6187G | 400 | 350 | 450 | 380 | 380 | 253 | 1103.5 | 963.5 | 140 | 19 | 4  | 25 | 5  | 300 | 48 | 225 | 210 |
| GHP6205G | 450 | 400 | 500 | 430 | 415 | 268 | 1243   | 1103  | 140 | 19 | 4  | 25 | 5  | 340 | 48 | 228 | 300 |

| Type     | Q   | QR  | S  | T  | U   | W  | Bearing |        | Wt<br>(kg) | GD <sup>2</sup><br>(kgm <sup>2</sup> ) | Fan motor |       |         | Dia<br>gram | Frame |        |
|----------|-----|-----|----|----|-----|----|---------|--------|------------|----------------------------------------|-----------|-------|---------|-------------|-------|--------|
|          |     |     |    |    |     |    | DS      | BS     |            |                                        | Capacity  | Power | Voltage | Pole        |       |        |
| GHP6114G | 80  | 1   | 32 | 8  | 4.5 | 10 | 6307ZZ  | 6206ZZ | 75         | 0.092                                  | 20        | 1φ    | 200/220 | 2           | A     | 112M-6 |
| GHP6116G | 80  | 1   | 32 | 8  | 4.5 | 10 | 6307ZZ  | 6206ZZ | 91         | 0.12                                   | 20        | 1φ    | 200/220 | 2           | A     | 112B-6 |
| GHP6118G | 80  | 1   | 32 | 8  | 4.5 | 10 | 6307ZZ  | 6206ZZ | 92         | 0.13                                   | 40        | 1φ    | 200/220 | 2           | A     | 112B-6 |
| GHP6133G | 110 | 0.5 | 42 | 8  | 4.5 | 12 | 6309ZZ  | 6009ZZ | 105        | 0.2                                    | 80        | 1φ    | 200/220 | 2           | B     | 132M-3 |
| GHP6137G | 110 | 0.5 | 42 | 8  | 4.5 | 12 | 6309ZZ  | 6009ZZ | 120        | 0.2                                    | 80        | 1φ    | 200/220 | 2           | C     | 132M-3 |
| GHP6163G | 110 | 1   | 55 | 10 | 5   | 15 | 6312ZZ  | 6212ZZ | 165        | 0.55                                   | 80        | 1φ    | 200/220 | 2           | B     | 160M-3 |
| GHP6165G | 110 | 1   | 55 | 10 | 5   | 15 | 6312ZZ  | 6212ZZ | 180        | 0.61                                   | 80        | 1φ    | 200/220 | 2           | C     | 160M-3 |
| GHP6167G | 110 | 1   | 55 | 10 | 5   | 15 | 6312ZZ  | 6212ZZ | 210        | 0.7                                    | 100       | 1φ    | 200/220 | 2           | C     | 160L-3 |
| GHP6183G | 110 | 1   | 55 | 10 | 5   | 15 | 6312ZZ  | 6215ZZ | 280        | 1.4                                    | 100       | 1φ    | 200/220 | 2           | C     | 180M-3 |
| GHP6187G | 140 | 1   | 65 | 12 | 6   | 18 | 6314ZZ  | 6215ZZ | 310        | 1.6                                    | 100       | 1φ    | 200/220 | 2           | C     | 180M-6 |
| GHP6205G | 140 | 1   | 65 | 12 | 6   | 18 | 6314ZZ  | 6215ZZ | 420        | 2.2                                    | 80/120    | 3φ    | 200/220 | 2           | D     | 200L-3 |

### 3. Fan, Brush, Brushholder Application

|                                 |                                  |  |  |  |  |  |  |  |                             |
|---------------------------------|----------------------------------|--|--|--|--|--|--|--|-----------------------------|
| D.C. Motor<br>for Machine tools | Brush } Application Table<br>Fan |  |  |  |  |  |  |  | GHP6 Type<br>(close series) |
|---------------------------------|----------------------------------|--|--|--|--|--|--|--|-----------------------------|

| GHP6 (as usual type) |                          |             |                                       | GHP6 (New type) |                          |             |                                            | Brush |         | Brush holder |         |
|----------------------|--------------------------|-------------|---------------------------------------|-----------------|--------------------------|-------------|--------------------------------------------|-------|---------|--------------|---------|
| Type                 | Output (kW)<br>1150 rpm. |             | Fan type                              | Type            | Output (kW)<br>1150 rpm. |             | Fan type                                   | Qty.  | Type    | Qty.         | Type    |
|                      | 200V class               | other class |                                       |                 | 200V class               | other class |                                            |       |         |              |         |
| -                    | -                        | -           | -                                     | GHP6114         | 2.2                      | -           | TOBISHI HS4556L (1φ)                       | 4     | R8-A    | 4            | 3R8     |
|                      |                          |             |                                       | GHP6116         | 3.7                      | -           |                                            |       |         |              |         |
|                      |                          |             |                                       | GHP6118         | 5.5                      | -           | TOBISHI #6550 (1φ)                         |       |         |              |         |
| GHP6134              | 3.7                      | -           | TOBISHI 175P5                         | GHP6133         | 3.7                      | -           | TOBISHI 175P5                              | 4     | R12.5-A | 4            | 3R12.5  |
| GHP6138              | 5.5                      | -           | (1φ)                                  | GHP6137         | 5.5                      | -           | (1φ)                                       |       |         |              |         |
| GHP6164              | 7.5                      | 7.5         |                                       | GHP6163         | 7.5                      | 7.5         |                                            |       |         |              |         |
| GHP6166              | 11                       | 11          |                                       | GHP6165         | 11                       | 11          |                                            |       |         |              |         |
| GHP6168              | 15                       | 15          | special Fan SL-6 (PS. 8") (3φ) 265.40 | GHP6167         | 15                       | 15          | TOBISHI R 200 P 69 200959 SL-5 (1φ) 461.90 | 8     | R12.5-A | 4            | 3R12.5  |
| GHP6184              |                          |             |                                       | GHP6183         | 18.5                     | 18.5        |                                            |       |         |              |         |
| GHP6188              |                          |             |                                       | GHP6187         | 22                       | 22          |                                            |       |         |              |         |
| -                    | -                        | -           | -                                     | GHP6205         | -                        | 30          | special Fan (P6.8") (3φ)                   | 12    | R12.5A  | 4            | 7R212.5 |
|                      |                          |             |                                       | GHP6205         | 30                       | -           |                                            |       |         |              |         |

### 3. Fan, Brush, Brushholder Application

| D.C. Motor<br>for Machine tools |                          |                | Brush} Application Table<br>Fan                   |                 |                          |                |                                   |                                                        |       | GHP6 Type<br>(close series) |                 |         |  |
|---------------------------------|--------------------------|----------------|---------------------------------------------------|-----------------|--------------------------|----------------|-----------------------------------|--------------------------------------------------------|-------|-----------------------------|-----------------|---------|--|
| Type                            | GHP6 (as usual type)     |                |                                                   | GHP6 (New type) |                          |                |                                   | Fan type                                               | Brush |                             | Brush<br>holder |         |  |
|                                 | Output (kW)<br>1150 rpm. |                | Fan type                                          | Type            | Output (kW)<br>1150 rpm. |                | Fan type                          |                                                        | Qty.  | Type                        | Qty.            | Type    |  |
|                                 | 200V<br>class            | other<br>class |                                                   |                 | 200V<br>class            | other<br>class |                                   |                                                        |       |                             |                 |         |  |
| -                               | -                        | -              | -                                                 | GHP6114         | 2.2                      | -              | TOBISHI<br>HS4556L<br>(1φ)        | TOBISHI<br>#6550 (1φ)                                  | 4     | R8-A                        | 4               | 3R8     |  |
|                                 |                          |                |                                                   | GHP6116         | 3.7                      | -              |                                   |                                                        |       |                             |                 |         |  |
|                                 |                          |                |                                                   | GHP6118         | 5.5                      | -              |                                   |                                                        |       |                             |                 |         |  |
| GHP6134                         | 3.7                      | -              | TOBISHI<br>175P5                                  | GHP6133         | 3.7                      | -              | TOBISHI<br>175P5                  | TOBISHI<br>R200P69<br>200959<br>SL-5<br>(1φ)<br>461.90 | 4     | R12.5-A                     | 4               | 3R12.5  |  |
| GHP6138                         | 5.5                      | -              | (1φ)                                              | GHP6137         | 5.5                      | -              |                                   |                                                        |       |                             |                 |         |  |
| GHP6164                         | 7.5                      | 7.5            |                                                   | GHP6163         | 7.5                      | 7.5            |                                   |                                                        |       |                             |                 |         |  |
| GHP6166                         | 11                       | 11             |                                                   | GHP6165         | 11                       | 11             |                                   |                                                        |       |                             |                 |         |  |
| GHP6168                         | 15                       | 15             | special<br>Fan SL-6<br>(PS. 8")<br>(3φ)<br>265.40 | GHP6167         | 15                       | 15             | special<br>Fan<br>(P6.8")<br>(3φ) | TOBISHI<br>R200P69<br>200959<br>SL-5<br>(1φ)<br>461.90 | 8     | R12.5-A                     | 4               | 3R12.5  |  |
| GHP6184                         |                          |                | GHP6183                                           | 18.5            | 18.5                     |                |                                   |                                                        |       |                             |                 |         |  |
| GHP6188                         |                          |                | GHP6187                                           | 22              | 22                       |                |                                   |                                                        |       |                             |                 |         |  |
| -                               | -                        | -              | -                                                 | GHP6205         | -                        | 30             | GHP6205                           | TOBISHI<br>R200P69<br>200959<br>SL-5<br>(1φ)<br>461.90 | 12    | R12.5A                      | 4               | 7R212.5 |  |
|                                 |                          |                |                                                   | GHP6205         | 30                       | -              |                                   |                                                        |       |                             |                 |         |  |

D.C. Motor  
for Machine Tool

Brush } Application Table  
Fan

GGG3 Type  
(open build in Fan)

| Type    | Output (kW)<br>1150 rpm |                | Fan Type<br>(build-in Fan) | Brush |         | Brush holder |         |  |  |  |  |
|---------|-------------------------|----------------|----------------------------|-------|---------|--------------|---------|--|--|--|--|
|         | 200 V<br>class          | other<br>class |                            | Q'ty  | type    | Q'ty         | type    |  |  |  |  |
| GGG3132 | 2.2                     | -              | aPRK41/1.9-2<br>(φ205)     | 4     | R12.5-A | 4            | 7R12.5  |  |  |  |  |
| GGG3134 | 3.7                     | -              |                            |       |         |              |         |  |  |  |  |
| GGG3138 | 5.5                     | -              |                            |       |         |              |         |  |  |  |  |
| GGG3164 | 7.5                     | -              | aPRK61/1.9-2<br>(φ220)     |       |         |              |         |  |  |  |  |
| GGG3168 | -                       | 11             |                            |       |         |              |         |  |  |  |  |
|         | 11                      | -              |                            |       |         |              |         |  |  |  |  |
| GGG3184 | 15                      |                | aPRK81/1.9-2<br>(φ250)     | 8     | R12.5-A | 4            | 7R212.5 |  |  |  |  |
| GGG3188 | 18.5                    | 18.5           |                            |       |         |              |         |  |  |  |  |
| GGG3222 | 22                      | -              | aPRK131/1.9-4<br>(φ350)    | 8     | T16-A   | 8            | 7T16    |  |  |  |  |
| GGG3224 | 30                      | -              |                            |       |         |              |         |  |  |  |  |
| GGG3226 | 37                      | -              |                            |       |         |              |         |  |  |  |  |
| GGG3228 | -                       | 45             |                            |       |         |              |         |  |  |  |  |
|         | 45                      |                |                            |       |         |              |         |  |  |  |  |
|         |                         |                |                            | 12    |         | 12           | 7T16    |  |  |  |  |

D.C. Motor  
for machine tool

Brush } Application Table  
Fan

GGG3 Type  
(open axcial Fan)

| Type         | Output (kW)<br>1150 rpm |                | Fan Type<br>(axcial Fan)             | Brush  |         | Brush holder |         |
|--------------|-------------------------|----------------|--------------------------------------|--------|---------|--------------|---------|
|              | 200 V.<br>class         | other<br>class |                                      | Q'ty   | Type    | Q'ty         | Type    |
| GGN3134      | 3.7                     | -              | Special Fan<br>(8" for PS)           | 4      | R12.5-A | 4            | 7R12.5  |
| GGN3138      |                         |                |                                      |        |         |              |         |
| GGN3164      | 7.5                     | -              | Outer Rotor<br>VAS303<br>(8" for PS) | 8      | R12.5-A | 4            | 7R212.5 |
|              | -                       | 11             |                                      |        |         |              |         |
| GGN3184      | 15                      | -              | VAS355<br>(Outer Rotor)              | 12     | R12.5-A | 4            | 7R312.5 |
|              | 18.5                    | 18.5           |                                      |        |         |              |         |
| GGN3204      | -                       | 22             | 747.06<br>VAS405<br>(Outer Rotor)    | 570.40 | R12.5-A | 4            | 7R312.5 |
|              | 22                      | -              |                                      |        |         |              |         |
| GGN3208 LL-7 | 30                      | 30             |                                      |        |         |              |         |

D.C. Motor  
for machine ToolBrush } Application Table  
Fan }GGF3 Type  
(open mount Fan)

|         | Output (kW)<br>1150 rpm |                | Fan Type<br>(mount Fan)<br>(3φ)              | Brush |         | Brush holder |         |
|---------|-------------------------|----------------|----------------------------------------------|-------|---------|--------------|---------|
|         | 200 V<br>class          | other<br>class |                                              | Q'ty  | Type    | Q'ty         | Type    |
| GGF3134 | 3.7                     | -              | CS-Al-MK<br>or<br>VCM1202S                   | 4     | R12.5-A | 4            | 7R12.5  |
| GGF3138 | 5.5                     | -              |                                              |       |         |              |         |
| GGF3164 | 7.5                     | -              | VCM1202S<br>or<br>special Fan<br>(8" for PS) |       |         |              |         |
| GGF3168 | -                       | 11             |                                              |       |         |              |         |
| GGF3184 | 15                      | -              |                                              | 8     | R12.5-A | 4            | 7R212.5 |
| GGF3188 | 18.5                    | 18.5           |                                              |       |         |              |         |
| GGF3204 | 22                      | 22             | VCM1252S                                     | 12    | R12.5-A | 4            | 7R312.5 |
| GGF3208 | 30                      | 30             |                                              |       |         |              |         |
| GGF3226 | 37                      | -              |                                              | 8     | T16-A   | 8            | 7T16    |
| GGF3228 | -                       | 45             |                                              |       |         |              |         |
|         | 45                      | -              |                                              | 12    | T16-A   | 12           | 7T16    |

## 4. Instruction of motor (open and close)

### 4-1 General

To operate the motors efficiently, be sure to carefully read every page of these instruction.

### 4-2 Confirming the Product

When the motors are delivered to the site, check the following.

- 1) Check the motors for rated output, voltage, speed, rating, mounting method, and dimension.
- 2) Check the motors for any damage possibly incurred during shipment.
- 3) Should the motors be stored over a long period, isolate the commutator surface from the brushes with paper to protect the commutator against corrosion. (Fig. 1)

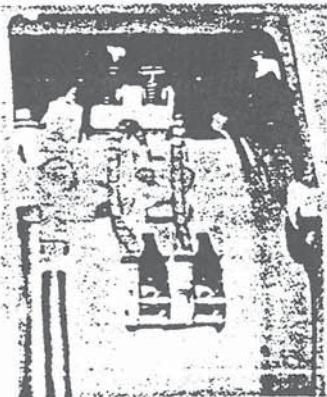


Fig. 1

### 4-3 Installation

#### A. Location

- 1) Exhaust air should never be recircled to the suction side.
- 2) Provide space of over 50 cm between the motor and wall surface.
- 3) When the space of over 50 cm cannot be provided, provide ventilation hole on the wall.
- 4) Don't provide a cover to disturb ventilated air.

#### B. Foundation

Preferably, the motor should be installed on a concrete foundation. Where a concrete foundation is not possible due to the driven machine and the environmental condition, the motor base should be mounted on a reinforcing bar with foundation bolts.

When installing the motor directly on a floor surface, the motor base should be slightly raised over the floor surface to facilitate water discharge.

#### C. Coupling with driven machine

##### 1) Direct-coupling operation

- When the motor is directly coupled with the driven machine, both shafts must be correctly centered as follows.
- a) Insert the liners below the motor base to adjust the shaft center height.
  - b) Connect with a single bolt the both half couplings in order to run them together and provide checking mark on the coupling surfaces.
  - c) Firmly set a dial guage feeler against one half coupling surface (see Fig. 2B).
  - d) Bring the checking mark of the coupling to the top, and measure size "g" and "h" shown on Fig. 2 at four points evenly spaced around the circumference and record the results.
  - e) Turn the couplings at an interval of 90° and measure as stated in Item d).
  - f) Continue measurements until the checking mark appears again on the top.
  - g) Conduct adjustments with liners so that the difference between the maximum and the minimum measurements can be held, with 0.03 mm for size "g" and "h".

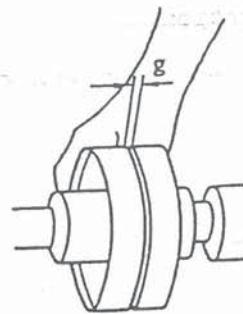


Fig. 2A

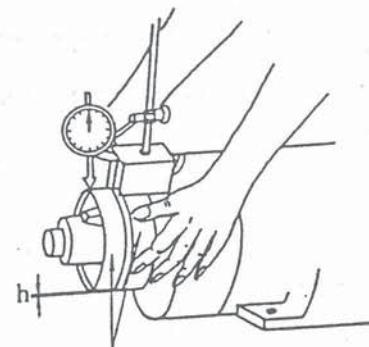


Fig. 2B

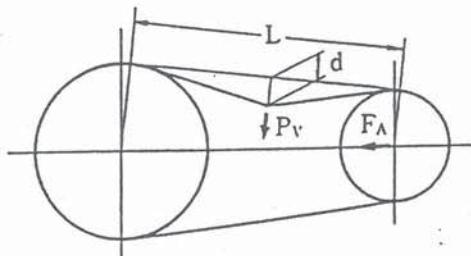


Fig. 3

| Velt<br>Type | Recommended Belt Tension                   |                   |
|--------------|--------------------------------------------|-------------------|
|              | Belt Center<br>Depressing Force<br>Pv (kg) | Deflection<br>(d) |
| A            | 4                                          | (0.039~0.046)L    |
| B            | 4                                          | (0.028~0.031)L    |
| C            | 4                                          | (0.016~0.019)L    |
| D            | 8                                          | (0.019~0.028)L    |
| E            | 8                                          | (0.015~0.018)L    |

Table 1

#### 4-4 Electrical Connection

##### A. Motor

Connect the supply cable conductors in accordance with the diagram shown in the terminal box. (Fig. 4)

##### B. Grounding


Since a ground terminal is provided within the terminal box, be sure to correctly install a ground cable to prevent a shock hazard.

##### C. Fan motor

Provide an appropriate sequence so that the fan motor is actuated prior to switch on the motor and is interrupted after switching off the motor.

##### D. Tachogenerator

A tachogenerator must be connected with a shield cable. The shield cable should never be installed within the same duct as a power cable which carries a heavy current. When the motor rotates counterclockwise viewed from the load side, positive voltage of the D.C. tachogenerator is applied to terminal TA, and negative voltage is applied to terminal TB, be sure to correctly connect.

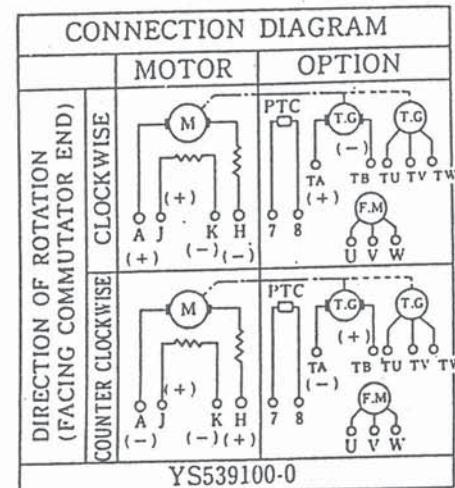

#### 4-5 Precaution to be Effected Prior to Operation

Prior to switch on the motor, be sure to check the following items.

- 1) Decouple the motor from the driven machine, turn the motor shaft by hand, and make sure that the rotating parts do not graze with the stator parts.
- 2) Check the connection between the motor and the power supply, polarity of the tachogenerator, and grounding condition.
- 3) Check the sequence circuit for normal operation

If all of the above-mentioned items are satisfactory, independently operate the motor to check on vibration, noise, and rotating direction. Then couple the motor with the driven machine.

#### 4-6 Inspection and Maintenance

To ensure long term, trouble-free motor operation, periodically inspect and maintain the motor.

| Frequency | Inspection items          | Check points                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
|-----------|---------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Monthly   | 1. Abnormal noise         | Check the motor as to whether or not any abnormal noise is audible from the motor bearing.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
|           | 2. Commutator and brushes | <ol style="list-style-type: none"><li>a) Check whether or not sparks produced during commutation are larger than those of the previous inspection.</li><li>b) Check the commutator surface for gloss color, threading, dirt, and/or abrasion.</li><li>c) Check the brushes for excessive abrasion. (Check the lower-limit stopper provided with a brush as to whether or not it is liable to contact the brush holder. Fig. 5) If the stopper is liable to contact a brush holder, replace the brush. (In this case, record the intervals of replacing defective brushes for future reference.)</li></ol> |

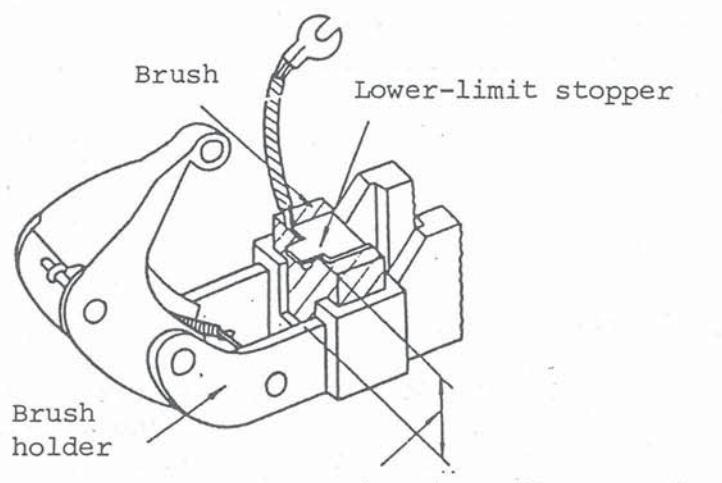


Fig. 5

| Frequency | Inspection items          | Check points                                                                                                                                                                                                                          |
|-----------|---------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Monthly   | 2. Commutator and brushes | d) Check brushes as to whether or not they are smoothly actuated within brush holders.<br>e) For further detailed inspection, refer to item VII (Maintenance Procedures for brushes and commutator.)                                  |
|           | 3. Cleaning               | Since deposited dirt may deteriorate the cooling effect, spray dry compressed air into the motor interior --- specifically the commutator and filter --- to remove deposited dirt, or clean the motor interior with a vacuum cleaner. |
|           | 4. Cooling fan            | Check the cooling fan for smooth operation.                                                                                                                                                                                           |
| Yearly    |                           | Inspect all items of the monthly inspection.<br>Check all screws and bolts for secure tightening.                                                                                                                                     |

List of Various Accidents for D.C. Motor (1)

| Causes                                                                                                         | Accidents             |                             |                                       |                                                                                 |                       |
|----------------------------------------------------------------------------------------------------------------|-----------------------|-----------------------------|---------------------------------------|---------------------------------------------------------------------------------|-----------------------|
|                                                                                                                | Motor doen not work.  | Motor speed uncontrollable. | When loaded speed remarkably reduced. | Current & Operating speed fluctuate, especially when field current is weakened. | Motor is overheated.  |
| Over load.                                                                                                     | <input type="radio"/> | <input type="radio"/>       | <input type="radio"/>                 | <input type="radio"/>                                                           | <input type="radio"/> |
| Controller trouble.                                                                                            | <input type="radio"/> | <input type="radio"/>       | <input type="radio"/>                 | <input type="radio"/>                                                           |                       |
| Misconnection with controller.                                                                                 | <input type="radio"/> | <input type="radio"/>       |                                       |                                                                                 |                       |
| Line cable or armature circuit is broken.                                                                      | <input type="radio"/> |                             |                                       |                                                                                 |                       |
| Brushes are not provided.                                                                                      | <input type="radio"/> |                             |                                       |                                                                                 |                       |
| Brush abrasion has reached limit.                                                                              | <input type="radio"/> |                             |                                       |                                                                                 |                       |
| Shunt field is too weak.                                                                                       | <input type="radio"/> |                             |                                       |                                                                                 |                       |
| Broken or wrong connection of shunt field.                                                                     | <input type="radio"/> |                             |                                       |                                                                                 |                       |
| Short-circuit of layer in armature coil or shunt field.                                                        | <input type="radio"/> | <input type="radio"/>       | <input type="radio"/>                 | <input type="radio"/>                                                           |                       |
| Broken of tacho generator.                                                                                     | <input type="radio"/> |                             | <input type="radio"/>                 |                                                                                 |                       |
| Too low terminal voltage.                                                                                      |                       |                             | <input type="radio"/>                 |                                                                                 |                       |
| Brush locker largely shifts from neutral point.                                                                |                       |                             | <input type="radio"/>                 | <input type="radio"/>                                                           |                       |
| Abnormal cooling fan motor. Clogged air circuit within motor interior. Temperature of cooling air is too high. |                       |                             |                                       | <input type="radio"/>                                                           | <input type="radio"/> |
| Clearance of bearing is too small.                                                                             |                       |                             |                                       |                                                                                 | <input type="radio"/> |
| Clearance of bearing is too large.                                                                             |                       |                             |                                       |                                                                                 | <input type="radio"/> |
| Defect on bearing rotating surface.                                                                            |                       |                             |                                       |                                                                                 | <input type="radio"/> |
| Improper assembling.                                                                                           |                       |                             |                                       |                                                                                 | <input type="radio"/> |
| Improper installation of motor. Belt tension is too high.                                                      |                       |                             |                                       | <input type="radio"/>                                                           |                       |
| Foreign matter is in bearing.                                                                                  |                       |                             |                                       |                                                                                 | <input type="radio"/> |

B. Commutator maintenance procedures

1) Maintenance for commutator surface

The commutator surface appears as a smooth, lustrous, chocolate color under normal condition, covered by lubricating film termed "oxidizing film."

The color of this film turns from copper to chocolate color according to the period of time elapsed. However, the color slightly varies depending upon the brush materials, temperatures, and various other environmental conditions. This film shall never be removed. Also, always keep the commutator surface clean and smooth without subjecting it to oil or chemical vapors. Should the commutator surface appear as lusterless black or partially black bars to sparks produced during commutation, wipe the surface with a dry cloth.

2) Grinding with emery paper or stone

When slight damage, black bars, or spots caused by sparks are observed on the commutator surface, correct with emery paper or grinding stone.

Repairable damage is as follows:

Emery paper: Damage up to approximately 0.3 mm deep.

When repairing a defective commutator surface, use a separate driving machine at approximately the DC motor rated speed. In this case, be sure to lift all brushes. When no appropriate driving machine is available, please grind it rotating after self-started and switch off the source. After applying emery paper or grinding stone, fully remove the copper powder and emery dust deposited on the commutator surface, under-cut portion, brush holders, and brushes.

3) Cutting

When eccentricity, high bars, low bars, and damage due to arcing are observed on commutator surface, repair the commutator surface with a cutting tool. The cutting tool used and their suitable speed, feeding and cutting depth are shown in Table 3. In case vibration is extremely large when touching the brush through insulating material during rotation, at first a dial gauge feeler is attached on the commutator surface to inspect eccentricity, high bar or low bar of the commutator, rotating the rotor slowly. Deflection is in general, limited below 0.03 mm in FUJI Electric.

| Kinds of cutting tools      | Peripheral speed<br>of commutator [m/mm] | Feeding<br>[mm/revolution] | Cutting depth<br>[mm] |
|-----------------------------|------------------------------------------|----------------------------|-----------------------|
| Superhardness alloy<br>tool | 60 ~ 200                                 | 0.1 ~ 0.15                 | 0.05 ~ 0.20           |
| Diamond tool                | 300 ~ 2000                               | 0.05 ~ 0.15                | 0.05 ~ 0.15           |

Table 3

4) Undercutting and chamfering

When depths of the slots on the commutator surface are excessively reduced due to abrasion or machining, undercut the segment micas of the commutator. Also, when chamfers have been used up, chamfer the segments. For undercutting, use a tool utilizing a metal saw as shown in the front in the Fig. 7-A. In this instance, initially the segment slots are to be cut without giving a force so much and after the slots have attained to a certain depth, they shall be normally cut, then under-cutting shall be performed comparatively easy without injuring the commutator surface. According it is recommended that under-cutting is made before the slots have become extremely shallow due to wearing of the commutator. As a tool for chamfering, a tool which has both blades as shown in the behind in Fig. 7-A, is used, and the commutator segments are chamfered as shown in Fig. 7-B. For recommended undercutting depths and chamfering dimensions, refer to Fig. 7-C.

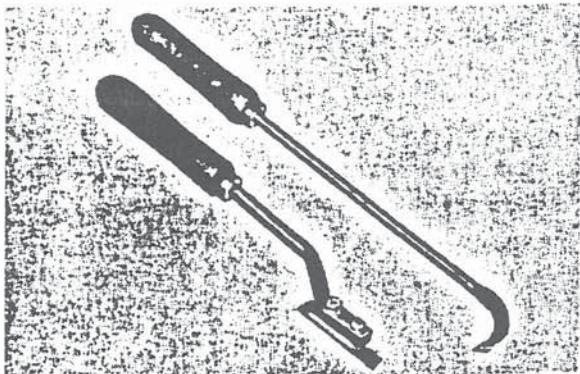


Fig. 7-A

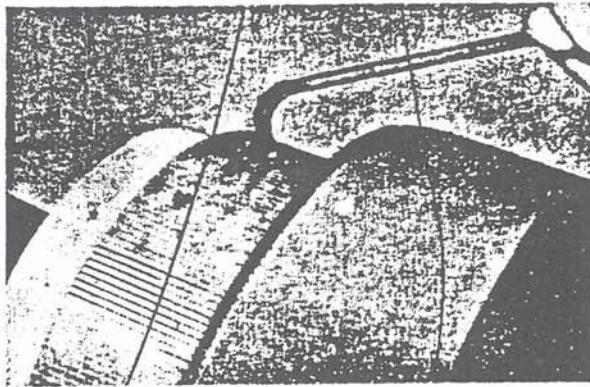


Fig. 7-B

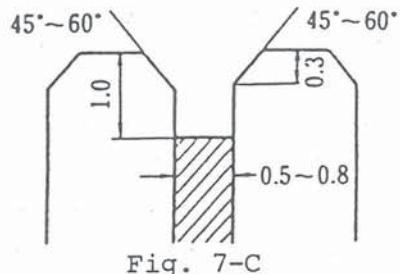


Fig. 7-C

| A<br>lent<br>f b<br>and commutator                                                                                     | Causes | Effect<br>ver load | Brush<br>abrasion. | Commutator<br>surface is<br>scratched.<br>overheated. | Br<br>it<br>surface is<br>broken edge or<br>broken connecting<br>lead). | Causes big noise,<br>black or is<br>damaged). |
|------------------------------------------------------------------------------------------------------------------------|--------|--------------------|--------------------|-------------------------------------------------------|-------------------------------------------------------------------------|-----------------------------------------------|
| effect of armature or interpole<br>inding.                                                                             |        |                    |                    |                                                       |                                                                         |                                               |
| rong position of brush rocker.                                                                                         |        |                    |                    |                                                       |                                                                         |                                               |
| eavy vibration of machine.                                                                                             |        |                    |                    |                                                       |                                                                         |                                               |
| mproper sliding of brush. On a commutator sliding surface oil is attached or upper is exposed. Brush sticks.           |        |                    |                    |                                                       |                                                                         |                                               |
| n suitable quality of brush.<br>ixture of different kinds of brushes.                                                  |        |                    |                    |                                                       |                                                                         |                                               |
| ear of brush holder. Brush pressure<br>pring is unsteady. Distance to commutator surface is too large. (1.5~2 mm max.) |        |                    |                    |                                                       |                                                                         |                                               |
| xial position of brush holder is<br>rong.                                                                              |        |                    |                    |                                                       |                                                                         |                                               |
| commutator surface is uneven, not round.<br>ica is high. The angle of commutator<br>egment is sharpened.               |        |                    |                    |                                                       |                                                                         |                                               |
| rush rocker is not fastened.<br>rush is hold too loose.                                                                |        |                    |                    |                                                       |                                                                         |                                               |
| umidity, dirt, oil, vapor, active gas or<br>team.                                                                      |        |                    |                    |                                                       |                                                                         |                                               |
| irt between commutator space.                                                                                          |        |                    |                    |                                                       |                                                                         |                                               |
| ong-time no load operation.<br>ry atmosphere or air containing<br>xidized iron.                                        |        |                    |                    |                                                       |                                                                         |                                               |
| ong-time light load operation.                                                                                         |        |                    |                    |                                                       |                                                                         |                                               |
| rush chattering.                                                                                                       |        |                    |                    |                                                       |                                                                         |                                               |

Table 3

## 5. Maintenances and inspections of a D.C.tacho-generator

A tachogenerator is a most important equipment in order to control the revolution of a D.C. motor. Therefore, please carry out the following periodical maintenances and inspections.

### 5-1 Instructions Every One Month

- 1) Make sure whether the screws of the speed feedback circuit are loosen and lead wires including those of the tachogenerator are braken or not. (Then, carry out after confirmation of shutting off power supply)
- 2) Make sure of keeping properly the relation between output voltage of the tachogenerator and the revolution of the motor. (or between command speed and actual one)
- 3) In the case, it arises the discord between command speed and actual one, firstly inspect the 1) and 2) of item 1 again. But, it has not yet been improved, so, carry out the following item 2 immediately.

### 5-2 Inspections and Cleanings Every Six Months

This component has the structure which allows cleaning with compressed air (for factory use) without disassembling.


Take off the cover of the tachogenerator on the rear of the motor and clean the tachogenerator every six months. And confirm below.

- 1) Is the brush in the brush holder moved smoothly or not?
- 2) Does the sliding surface area of each brush increase and reach more than 80% of each perfection.
- 3) Does the brush abrasion reach its limit? When not reaching, change the brush. Record the lengths of brushes at the periodical inspection and determine the intervals of replacing defective brushes for future reference.

### 5-3 Phenomena, cause by tachogenerator defects

A defect in the tachogenerator will be revealed in the bad operation of the motor. It is cause by poor condition of the brush-contacting section of the tachogenerator. The followings are conceivable as detailed causes. If the following troubles should occur, then inspect and clean the tachogenerator.

- 1 Electrical shortening between the commutator segments due to worn fragments or powder from the brush.
- 2 Movement of the brush in the guide hole of the brush holder has stiffened because of fragments or powder from the brush, resulting in poor contact between the brush and the commutator (the brush is not moved smoothly in the brush holder)
- 3 A film layer of carbon adheres to the commutator surface thickly, causing electrical contact resistance and ripple to increase.

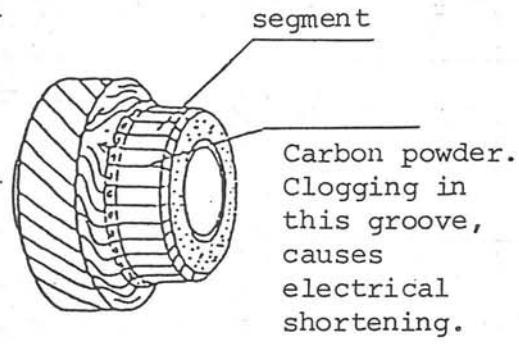

- 4 Cutting oil or other fluid adheres to the commutator surfaces, causing electrical contact resistance and ripple to increase also. Those defects from above are eliminated by cleaning the tachogenerator. In the same case mentioned in the head of (4) and if a large amount of oil enters, then it would be able to remove the oil completely. Therefore, the tachogenerator should be replaced by new one.
- 5 If the commutator surface is rough or rough threadings are appeared on it, the tachogenerator should be done as is mentioned above.

#### -4 Changing Brushes

- 1) Change the short brushes for new spare ones, when reaching the limit of their length. (see the table below)

| Tachogenerator type | Limit of length |
|---------------------|-----------------|
| TG - 20             | Under 6.5 mm    |
| TG - 21             |                 |
| TGD - 02C           | Under 7 mm      |
| KGD - 03B           |                 |

KGD - 02C  
No. 1808

Use the brushes recognized by us without fail, because the qualities of a brush affect commutating and the commutation surface.

- 2) The sliding surface of a new brush is similar to the one of the commutator in its curvature. But the fitness between both surfaces is not always good, when assembled. Therefore, carry out running for fitness. After confirming that the sliding surface are of each brush increases and reaches more than 80% of each perfection, begin to rotate the motor on full road.
- 3) At 100 rpm speed of the motor shaft, forward and reverse runnings for fitness should be done more than 3 times by turns. Each running should be continued for about 10 seconds.

#### (Defects of Command speed)

In case of N.C output (S-command) and D/A converter defects, it may be afraid of causing the discords between the command speed and actual one. Therefore, inspect them, also.

## 6. Motor application in cases where acceleration and deceleration modes are frequency

Recently, there is a tendency that working cycle is short time. Because robots are introduced for manufacturing. Then, owing to influence of business mark, working goods are changing from small size goods to big ones. Motor might be runned on severer temperature condition for amature, because of accelerating and decelerating motor current.

As result of heating motor amature, insulation will be bad, and will be dielectric breakdown or make to short on life time. Therefore, take care the following point for operating motor.

### 6-1. Limit

#### Example

- o Accelerating & decelerating time :  $t_1$  (sec) = 30 sec.
- o Cutting time :  $t_2$  (sec) = 60 sec.
- o Stopping time :  $t_3$  (sec) = 1 sec.
- o Accelerating, Decelerating Current :  $I_s = 63A$  (150%)
- o Cutting current :  $I_L = 21A$  (50%)
- o Motor rated current :  $I_a = 42A$
- o Load Current Effective Value :  $I_{rms}$

$$I_{rms} = \sqrt{\frac{I_s^2 \times t_1 + I_L^2 \times t_2}{t_1 + t_2 + t_3}} = 40 A$$


$$(I_{rms} / I_a) \times 100 = \frac{40}{42} \times 100 = 95\% > 80\%$$

In this case, The program must be changed because margin for heating is too little so as to be less than 80%.  
( $t_1$  should be shorter,  $t_3$  should be longer, ex.  $t_1$  : 18 sec,  $t_3$  : 7 sec.  
→ 80%)

It depend on parameter of  $t_1$ ,  $t_2$  and  $I_L$ . Then need to calculate it each time.

Pay attention to do it for protecting motor.

Following is general graphic

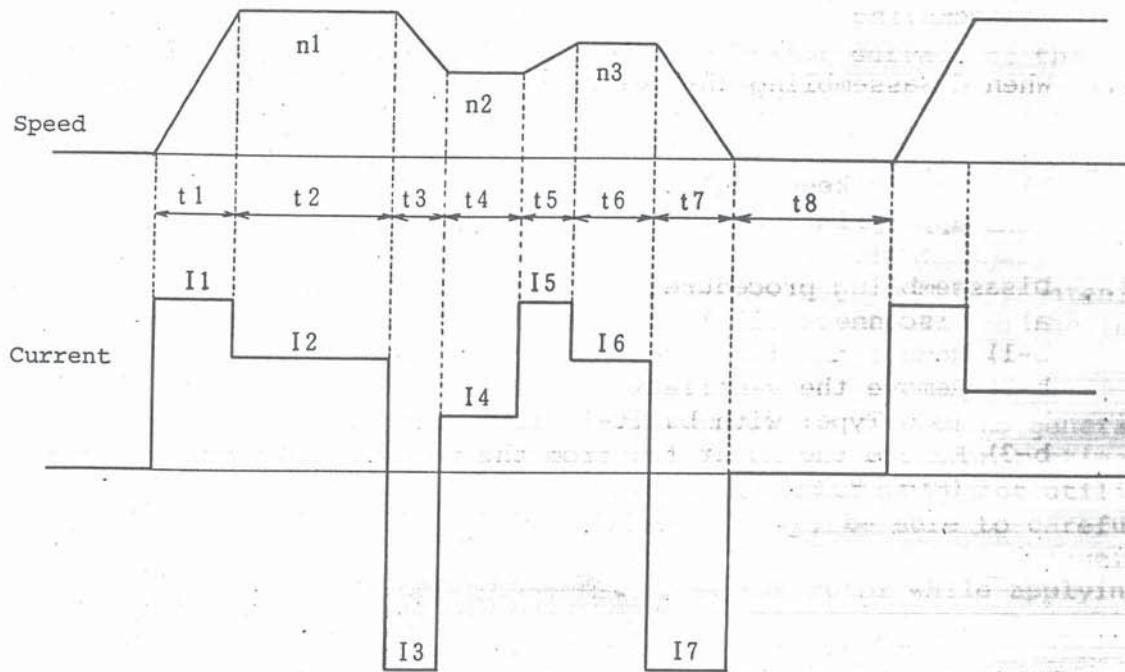

I<sub>1</sub>, I<sub>5</sub>: accelerative current  
 I<sub>2</sub>, I<sub>4</sub>, I<sub>6</sub>: Load current  
 I<sub>R</sub>: rated current

I<sub>3</sub>, I<sub>7</sub>: decelerative current  
 I<sub>rms</sub>: Load Current Effective Value

$$I_{rms} = \sqrt{\frac{I_1^2 \cdot t_1 + I_2^2 \cdot t_2 + I_3^2 \cdot t_3 + I_4^2 \cdot t_4 + I_5^2 \cdot t_5 + I_6^2 \cdot t_6 + I_7^2 \cdot t_7}{t_1 + t_2 + t_3 + t_4 + t_5 + t_6 + t_7 + t_8}} \leq 0.8 I_R$$

Therefore, load current effective value should be less than 80% of rated current.

## 6-2. Maintenance

Forced cooling fan is mounted on in order to cool motor. There are filter in air entrance. The filter protect from invading.

## 7. Disassembling and reassembling

### 7-1 Open Type Motor

#### A. Disassembling

1. When disassembling the motor, be sure to check the following.
  - a) Disassemble the motor in a location free from dirt, moisture, rain drops, oil, and chips.
  - b) Safely keep small parts such as bolts, nuts, and washers in an appropriate box.
2. Disassembling procedures
  - a) Disconnect all lead wires from the motor
  - b-1) Remove the fan cover from the motor. (GGN Type: with axial fan)
  - b-2) Remove the ventilation cover on the driven side. (GGG Type: with built-in fan) (Fig. 8-2)
  - b-3) Remove the mount fan from the motor. (GGF Type: with mount fan) (Fig. 8-3)

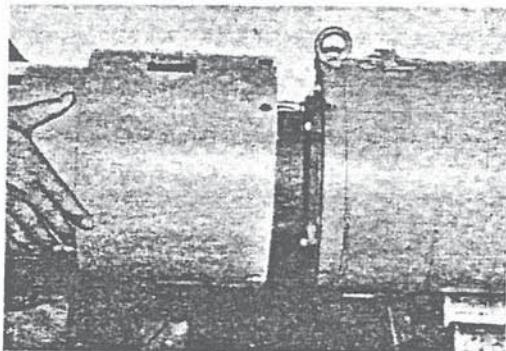


Fig. 8-1

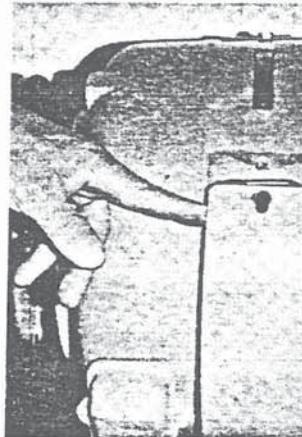


Fig. 8-2

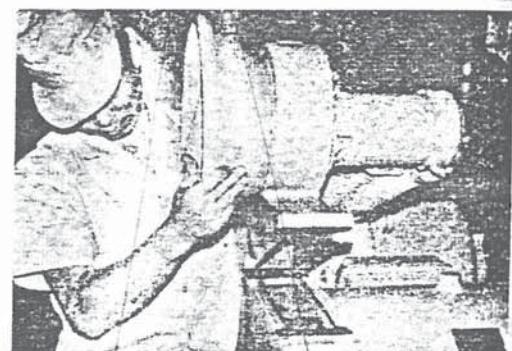


Fig. 8-3

- c) Remove the commutator inspection cover from the motor. (Fig. 8-4)
- d) Pull out brushes from the brush holders and remove the main circuit cables from the brush spindles. (Fig. 8-5)
- e) Wrap thick paper around the commutator surface to protect the commutator surface to protect the commutator against damage. (Fig. 8-6).

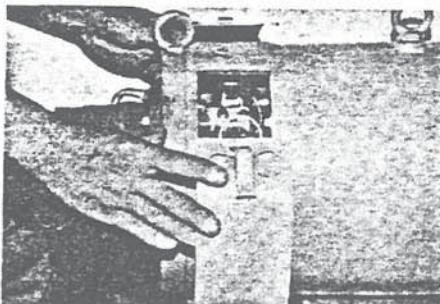


Fig. 8-4

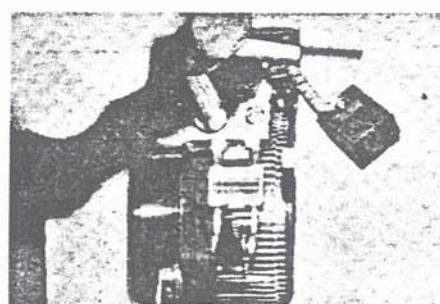


Fig. 8-5

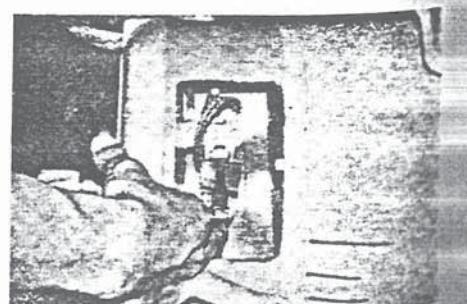


Fig. 8-6

f) Disassembling the tacho generator.

i) DC tacho generator

- o Remove the inspection cover from the tacho generator and withdraw the brushes from the brush holders.
- o Wrap thick paper around the commutator surface of the tacho generator.
- o Remove the bolts securing the stator of the tacho generator and the motor shield, and remove the stator of the tacho generator. (Since a permanent magnet utilized at the stator tends to attract the rotor, be sure to carefully handle the stator to protect the winding and commutator against damage.)
- o Loosen the setscrew and withdraw the rotor while tightening the jack bolt (M12 x 100) by using the tapped hold on the inner surface of the rotor boss (Fig. 8-7).

ii) AC tacho generator

- o Remove the bolts securing the stator of the tacho generator and the motor shield, and remove the stator while protecting the winding against damage. (Since a permanent magnet utilized at the rotor tends to attract the stator, be sure to carefully handle the stator to protect the winding against damage.)
- o Loosen the setscrew and withdraw the rotor while applying a puller to the boss. (Never apply the puller to the permanent magnet.) (Fig. 8-8)

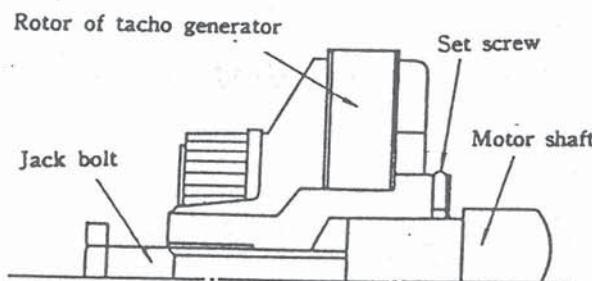


Fig. 8-7

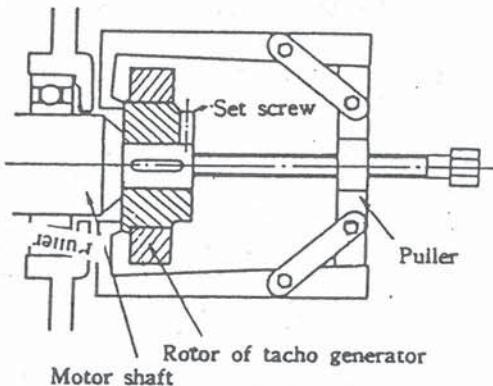


Fig. 8-8

- g) Remove the bolts securing the shield on the driven side.  
h) Insert a screwdriver into the gap between the shield on the driven side and the frame to remove the faucet, and then withdraw the shield from the frame. (Fig. 8-9)  
i) Apply a wooden plank to the shaft end on the commutator side and top the wooden plank with a wooden hammer to remove the rotor from the commutator shield. Subsequently withdraw the rotor from the frame. (Fig. 8-10)  
j) Remove the shield provided on the commutator side in the same manner as that provided on the driver side.  
k) The bearings will be taken away from the shaft by means of a special tool (Puller). (Fig. 8-11)  
l) Completely disassembled.

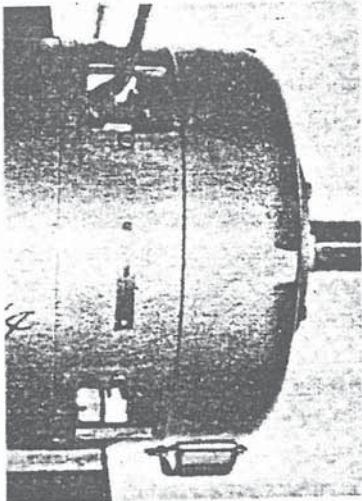


Fig. 8-9

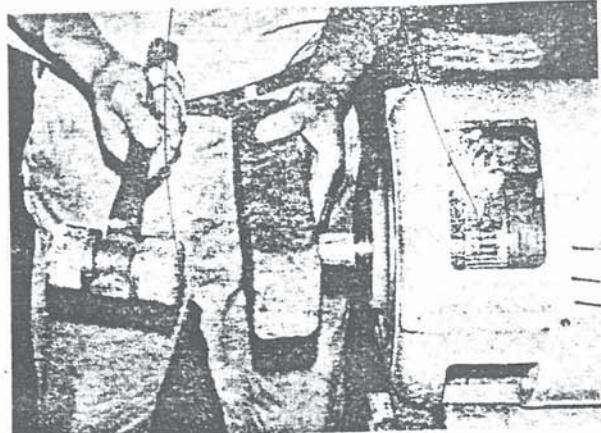


Fig. 8-10

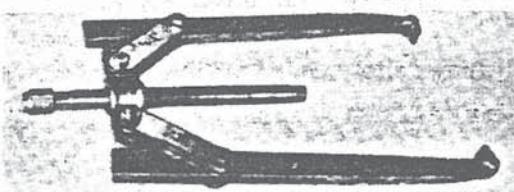


Fig. 8-11



8-12

#### B. Reassembling

1. When reassembling the motor, be sure to check the following.
  - a) Arrange all component parts in the order of reassembling procedures.
  - b) Correctly align the checking marks provided on the parts to be reassembled.
2. Reassembling proceduresEffect reassembling procedures in reverse order to that of disassembling procedures.
  - a) Insert the built-in-fan into the main rotor. (GGG type: with built-in-fan).
  - b) Insert the bearings into the shaft.
  - c) Reassemble the shield provided on the commutator side with the frame. (While aligning the checking mark.)
  - d) Reassemble the air guide with the frame of the built-in-fan side in the correct direction as shown in Fig. 8-12. (GGG type: with built-in-fan).
  - e) Insert the rotor into the frame.
  - f) Reassemble the shield on the driven side with the frame.
  - g) Reassembling the tacho generator.
    - o Insert the rotor of the tacho generator into the main motor shaft and secure the rotor with setscrew.
    - o Wrap thick paper around the commutator surface. (DC tacho generator).
    - o Insert the stator of the tacho generator and bolt it securely to the motor shield. (Since the permanent magnet is liable to attract the core, be sure to carefully handle the stator to protect the winding and commutator against damage.)
    - o Remove the thick paper from the commutator and reassemble the brushes

- h) Remove the thick paper from the commutator.
- i) Reassemble the main circuit cables with the brush spindles.
- j) Reassemble the brushes with the brush holders while keep the lower limit stopper of the brush in same direction as shown in Fig. 5.

## 7-2 Closed Type Motor

### A. Disassembling

1. When disassembling the motor, be sure to check the following.
  - a) Disassemble the motor in a location free from dirt, moisture, rain drops, oil, and chips.
  - b) Safely keep small parts such as bolts, nuts, and washers in an appropriate box.
2. Disassembling procedures
  - a) Disconnect all lead wires from the motor.
  - b) Remove the covers of the commutator inspection part from the motor (Fig. 8-1).
  - c) Remove the commutator inspection plates from the motor. (Fig. 8-2)
  - d) Pull out brushes from the brush holders and remove the main circuit-cables from the brush holders. (Fig. 8-3)
  - e) Wrap thick paper around the commutator surface to protect the commutator against damage. (Fig. 8-4)

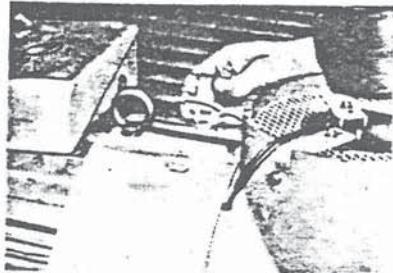


Fig. 8-1



Fig. 8-2



Fig. 8-3



Fig. 8-4

- f) Pull out the cables of the cooling fan from the main terminal box. (Fig. 8-4)
- g) Disassembling the tacho generator.
  - i) Remove the inspection cover from the tacho generator and withdraw the brushes from the brush holders.
  - ii) Wrap thick paper around the commutator surface of the tacho generator.
  - iii) Remove the bolts securing the stator of the tacho generator and the motor shield, and remove the stator of the tacho generator. (Since a permanent magnet utilized at the stator tends to attract the rotor, be sure to carefully handle the stator to protect the winding and commutator against damage.)
  - iv) Loosen the setscrew of the rotor of the tacho generator and withdraw the rotor.
- cf) In the case of type-DCM (GHP 6134 and 6164), after finishing item h) the TG of a DCM shall be taken off.
- h) Remove the fan cover from the motor. [Motor type I (GHP6138, 6166, 6168, 6184, 6188)]. (Fig. 8-6)
- i) Loosen the setscrew of the cooling fin and take away the cooling fin from the shaft by means of a poller. (Fig. 8-6), (Fig. 8-7)

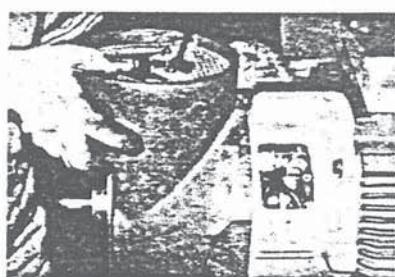


Fig. 8-5

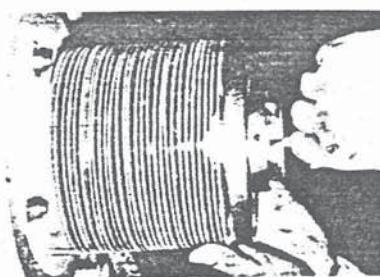


Fig. 8-6

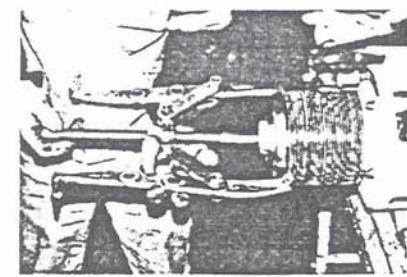


Fig. 8-7

- j) Remove the bolts securing the shield on the driven side.
- k) Insert a screwdriver into the gap between the shield on the driven side and the frame to remove the faucet, and then withdraw the shield from the frame. (Fig. 8-8)
- l) Apply a wooden plank to the shaft end on the commutator side and top the wooden plank with a wooden hammer to remove the armature from the commutator shield. Subsequently withdraw the rotor from the frame. (Fig. 8-9)
- m) Remove the shield provided on the commutator side in the same manner as that provided on the driving side.
- n) The bearings will be taken away from the shaft by means of a puller. (Fig. 8-10)
- o) Completely disassembled.

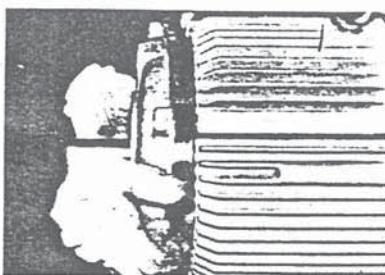


Fig. 8-8

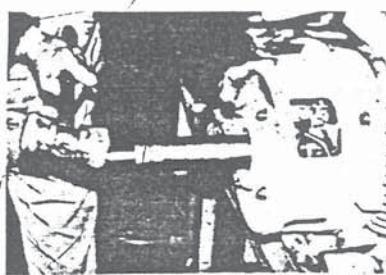


Fig. 8-9

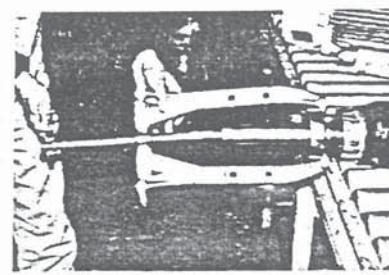


Fig. 8-10

## B. Reassembling

1. When reassembling the motor, be sure to check the following.
  - a) Arrange all component parts in the order of reassembling procedures.
  - b) Correctly align the checking marks provided on the parts to be reassembled.

### 2. Reassembling procedures

Effect reassembling procedures in reverse order to that of disassembling procedures.

- a) Insert the dust guarded plates and the bearing into the shaft.
- b) Reassemble the commutator side shield with frame. (Fig. 8-11)
- c) Wrap the thick paper around the commutator surface.
- d) Insert the armature into the frame from the driving side.
- e) Reassemble the driving side shield with the frame.
- f) Insert the cooling fin with the shaft of the commutator side.  
[Motor type I (GHP6138, 6166, 6168, 6184, 6188)]
- g) Reassemble the fan cover with the motor.

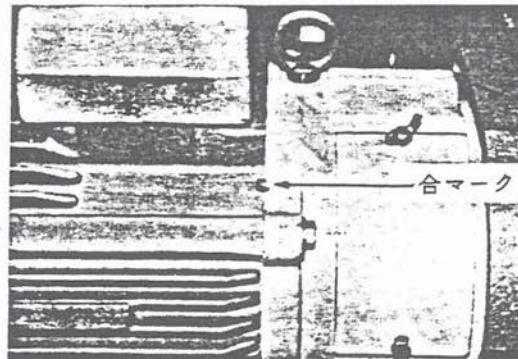


Fig. 8-11

- h) Reassembling the tacho generator.
  - i) Insert the rotor of the tacho generator into the main motor shaft and secure the rotor with setscrew.
  - ii) Wrap thick paper around the commutator surface.
  - iii) Insert the stator of the tacho generator and bolt it securely to the motor shield. (Since the permanent magnet is liable to attract the core, be sure to carefully, handle the stator to protect the winding and the commutator against damage.)
  - iv) Remove the thick paper from the commutator and reassemble the brushes with the brush holders.

- v) Reassemble the commutator inspection cover.
- vi) Connect the cables with the tacho generator terminales from the terminal box of the main motor and set the terminal cover of the tacho generator.  
[Motor type II (GHP6134, 6164)]
- i) Insert the cables of the cooling fan with the main terminal box and connect.
- j) Remove the thick paper from the commutator.
- k) Reassemble the main circuit cables with the brush holders.
- l) Reassemble the brushes with the brush holders while keep the lower limit stopper of the brush in same direction as shwon in Fig. 5.
- m) Reassemble the commutator inspection plates and covers.
- n) For installation, wiring, and operating procedures, refer to item III, IV, and V.
- o) Completely reassembled.

Notes

to check Armature of Motor, Disconnect all wires of Field Unit. Disconnect leads from H & A. Megger each Lead to Ground should be from 10 to 20 Meg. each lead can work as low as 2 to 2½ Meg. Scope on Armature leads look like see page 62.



Gate & Cathode about 15 to 20 ohms

To Free wheel Motor. Get up to speed & short out M F 37 in upper Right hand corner of Main Board

Field winding 14.7 ohm - Armature winding 1 to 2 ohm