

Aircraft Record General Information

Manufacturer: Air Tractor, Inc. Model Number: AT-602

Serial Number: 602-1156 Registration Number: N132JW

Date of Manufacture: January 25, 2008

Engine installed:

Manufacturer: Pratt & Whitney Model Number: PT6A-60AG Serial Number: PCE-RG0136

Propeller installed:


Manufacturer: Hartzell Propeller, Inc. Model Number: HC-B5MP-3C/M10876ANS

Hub Model: HC-B5MP-3C Serial Number: EVA2970

Blade Model: M10876ANS Serial Numbers: K57000, K57007, K57003, K56999, K57008

YEAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Re Entries must be endorsed with Name, Rating Facility. (See back pages for other specific en	and Certificate Number of technician or Reputities.)
	-	Air T	ractor, Inc	., 1584 Airport Road, P.O. Box 485, O AA Production Approval Holder PC 2	SW
		Date	F.	Aircraft Total Time	Aircraft Hobbs Meter
		The second second second	8	1.0 Hours Serial Number 602-1156, Registration Nu	1.0 Hours
The	aircraft was	found to	operate satis	duction Flight Test Procedures and Fligh factory and is in condition for safe operation. Pilot Certificate Number: 3127579	ation.
Pilo		Date Date	25	Aircraft Total Time	Aircraft Hobbs Meter
	Ismar	v 25 200	8	1.0 Hours able Air Tractor Service Letters through	1.0 Hours
Total	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Re Entries must be endorsed with Name, Rating Facility. (See back pages for other specific en	and Certificate Number of Technician or Repa
	TACH	FLIGHT	TIME IN	Entries must be endorsed with Name, Rating	and Certificate Number of Technician or Repairies.) Aircraft Hobbs Meter
YEAR: DATE	Januar	Date y 25, 200	SERVICE	Entries must be endorsed with Name, Rating Facility. (See back pages for other specific ent	and Certificate Number of Technician or Reporters.) Aircraft Hobbs Meter 1.0 Hours d have issued a Special Airworthines

PATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
				FLYING MAINTENANCE, INC. AR 72360 Phone: (870) 295-3776
Date	e:15 FEB	2008		N#: 132JW Hobbs:2.9
	del:AT-6			S/N#:602 \$ 130 \$ 1156 \$L
NOF	TE INST	ALLAT	TION GU	PS & FLOW CONTROL AND INTELIMAP USING DEL IDE ID #17-A-1165. WEIGHT & BALANCE REVISED BY ALLED IN AIRCRAFT FLIGHT MANUAL. OP'S CHECK
			University of the State of the	FAA FORM 337 THIS DATE FOR DETAILS. D FOR RETURN TO SERVICE.
SIG	NATUI	RE: (735	CLAY EDGIN 526395114 A&P

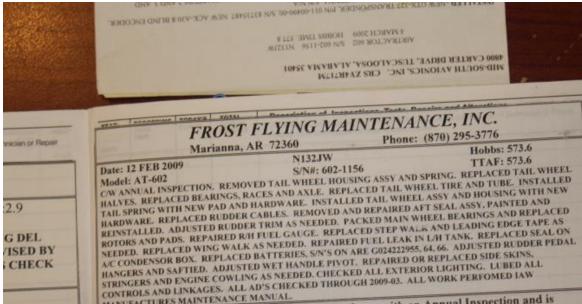

5114 A&P

MANUFACTURES MAINTENANCE MANUAL I certify this aircraft has been inspected in accordance with an Annual Inspection and is found to be in an airworthy condition.

Signature: Stew Russell

STEVE RUSSELL 495765302 IA

FROST FLYING MAINTENANCE, INC.

Marianna, AR 72360

Phone: (870) 295-3776

Date: 18 DEC 2009

N132JW

Hobbs: 932.1

S/N#: 602-1156

TTAF: 932.1

Date

Moc

CAW

ASS'

BUS

NEE STE

RUD

COL

WIN

PINS

BEA THE

I ce fou

Si

CWANNUAL INSPECTION. REMOVED TAIL GEAR ASSY. REPLACED TAIL WHEEL ASSY AND TUBE REPLACED UPPER BUSHING, BEARING AND RACE AND SEAL. PAINTED TAIL GEAR ASSY AND INSTALLED WITH NEW HARDWARE. REPLACED BEARING IN ELEVATOR PUSH PULL ROD. REPLACED REAR SPAR

BOLTS AND TORQUED. NEXT REPLACEMENT DUE AT 1932.1 HRS TTIS. CHECKED WING ATTACH ANGLES AND TORQUED, NO CRACKS NOTED. REPLACED BRAKE RESEVOIR. REPLACED HOPPER WINDOW AND SEALED. SEALED CENTER WINDSHIELD. REPLACED WING WALK AS NEEDED. REPLACED BEARINGS AS NEEDED IN FLAP/AILERON HINGE POINTS. INSTALLED NEW HARDWARE IN FLIGHT CONTROLS. REPLACED L/H NAV LIGHT LENS. RESEALED GATEBOX ASSY. PACKED MAIN WHEEL BEARINGS. CHECKED SHIMMING ON MAIN GEAR. REPAIRED AS NEEDED STRINGERS, TURTLE DECK SKINS, SIDE SKINS AND ENGINE COWLING. LUBED ALL CONTROLS AND LINKAGES. AD 2009-11-05 DOES NOT APPLY BY S/N. ALL WORK PERFORMED IAW MANUFACTURES MAINTENANCE MANUAL. ALL AD'S CHECKED THROUGH 2009-25.

I certify this aircraft has been inspected in accordance with an Annual Inspection and is found to be in an airworthy condition.

Signature:

CLAY EDGIN 526395114 IA

FROST FLYING MAINTENANCE, INC.

Marianna, AR 72360

Phone: (870) 295-3776

Date: 10 DEC 2010

N132JW

Hobbs: 1425.0

TTAF: 1425.0

ED

ES

ACED

IMING

14 IA

S/N#: 602-1156

MODEL AT THE COMMON ASSY. REPLACED TAIL WHEEL, TUBE, TIRE AND AXLE COVANNUAL INSTALLED ALL TAIL GEAR WITH NEW HARDWARE. REPLACED RUDDER HORN ASSI. FAIR LED ALCED ELEVATOR STOP BUMPERS. REPLACED BEARINGS, BUSHINGS AND HARDWARE AS BUSHINGS. REPLACED ELEVATOR STOP BUMPERS. NEEDED IN ELEVATOR AND RUDDER TRIM SYSTEMS. CHECKED ALL TORQUES IN EMPENAGE. PAINTED NEEDED IN ELEVATOR SHIMMED RUDDER TRIM TAB. REPLACED TRAY UNDER RINSE TANK, TIGHTENED RUDDER PEDAL HANGERS AND SAFTIED. INSTALLED NEW BOLT IN CONTROL STICK. REPLACED FLAP COUPLING. REPLACED BEARING IN LOWER SPRAY ROD. REPLACED HARDWARE IN FLAPS. REPLACED WING WALK AS NEEDED. INSTALLED NEW BRAKE ROTORS AND PADS, REPLACED I BACKING PLATE AND PINS. PACKED MAIN BEARINGS. INSTALLED LONG EYEBOLTS ON GATEBOX. REPLACED FAN CLUTCH AND BEARINGS AND SEALS FOR SPRAY PUMP. CHECKED ALL EXTERIOR LIGHTING. ALL AD'S CHECKED THROUGH 2010-24. ALL WORK PERFORMED IAW MANUFACTURES MAINTENANCE MANUAL

I certify this aircraft has been inspected in accordance with an Annual Inspection and is found to be in an airworthy condition.

Signature: Michael mefluder

MICHAEL McCLENDON 2769869 IA

YEAR: MIDCONTINENT YEAR DATE 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D Aircraft Corporation DATE MAKE MODEL AIR TRACTOR SERIAL NUMBER REGISTRATION AT-602 602-1156 N132JW TOTAL TIME TACH TIME TIME SINCE O/H 1540.0 1540.0 COMPLETED INSTALLATION OF HYDRAULIC LOADING SYSTEM AND ASSOCIATED CONTROL SYSTEM"LOAD HAWG SYSTEM" S/N LH1053AT IN ACCORDANCE WITH STC SA01540WI AND APPROVED DRAWING/INSTRUCTIONS CONTAINED IN MASTER DRAWING CONTROL LIST MC-D1 DATED APPROVAL 3-20-2009.STRUCTURAL SUBSTANTIATION OF INSTALLATION IN AIR TRACTOR S/N 602-1156 PROVIDED IN 8110-3 DATED 2-18-2011. FLIGHT MANUAL SUPPLEMENT AND INSTRUCTIONS FOR CONTINUED AIRWORTHINESS SUPPLIED WITH INSTALLATION. WEIGHT AND BALANCE REVISED BY COMPUTATION AND RECORDS REVISED. ALL MAINTENANCE PERFORMED IN ACCORDANCE WITH ABOVE LISTED DOCUMENTS, FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED. KEVIN JACKSON //Wal hul 5-23-2011 W.O. 32813

Hwy 84 East , MO. 63851 . DFQR172D

ON

"LOAD HAWG ISTRUCTIONS STRUCTURAL D 2-18-2011. PLIED WITH IAINTENANCE ON ALL WORK ITION UNDER

EAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)


SOUTHERN AIRCRAFT SERVICES LLC.

20929 HWY 31 SOUTH ENGLAND AR 72046 870 295-1038

DATE 11/30/2011 AT 602-1156 N#132JW HOBBS 1893.7

CW ANNUAL INSPECTION. REMOVED SIDE PANNELS INSPECTION PLATES AND ENGINE COWL. INSPECTED ENGINE MOUNT 1AW SL 253C IAW AD 2006-20-10 NO DEFECTS NOTED. REPLACED LIH RIH MAIN WING WALK. RESEALED RH LIH FUEL TANK LIDS AS REQUIRED. REPLACED CAMLOCK STUDS AS REQUIRED. SAND AND PREP AND PAINT TAIL SPRING, FORK, HOUSING, LIH RIH HORIZONTAL STRUTS. REPACKED TAIL WHEEL BEARINGS, TORQUED AND SAFTIED. REPLACED TAIL WHEEL FORK SEAL WITH NEW.RELAMPED RIH LIH NOSE LIGHT, RELAMPED RIN AV LIGHT. RELAMPED TAIL NAV LIGHT. REPLACED WIRING ON TAIL NAV LIGHT. REPLACED LIF FUEL GUAGE WITH NEW. CHECKED EMPANAGE HARDWARE FOR TORQUE INSPECTED RUDDER CABLES NO DEFECTS NOTED. REPLACED LIH RIH DOOR SEALS, BLEAD RH BRAKE. REPLACED RIH LIH STEP WALK. REPLACED EROSION TAPE ON FLAP ATTACH ARMS. REPLACED RIF FLAP CLOSE OUT REPLACED LIH RH CURTIS DRAIN ON FUEL TANKS. RESEARCHED BIWEEKLY FOR AD'S ALL PCW. I CERTIFY THIS AIRCRAFT HAS BEEN INSPECTED IAW AN ANNUAL INSPECTION IAW AMM CHECKLIST, AND FOUND TO BE IN AN AIRWORTHY CONDITION. LARRY BENNETT A&P 3025368 IA

LARRY BENNETT ARP 3025368 IA LONG BOWTH 3025368 IA

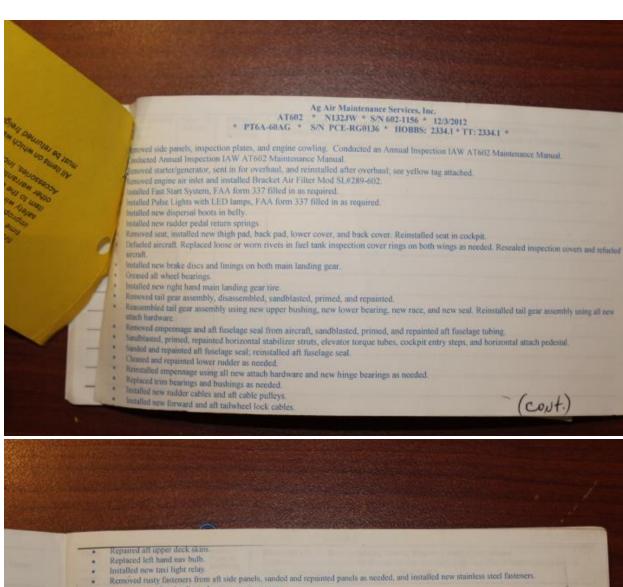

Installed new clear leading edge tape on empennage.

Replaced side panel anti chafe cork as needed.

Reinstalled side panels, inspection plates, and engine cowling.

Complied with AD 2005-13-12 by checking torque on stabilizer eyebolts in accordance with SL129. See complete AD list in logs.

I CERTIFY THIS AIRCRAFT HAS BEEN INSPECTED IAW AN ANNUAL INSPECTION AND IS IN AN AIRWORTHY CONDITION.

and refueled

ing all new


Ag Air Maintenance Services, Inc. AT602 * N132JW * S/N 602-1156 * 3/13/2013

* PT6A-60AG * S/N PCE-RG0136 * HOBBS: 2358* TT: 2358 *

Installed new Main Landing Gear Springs p/n 40086-4 using all new attach hardware. Landing gear installed, shimmed, and torqued in accordance with AT602 Maintenance Manual.

 Donald S Brewer AP432112099IA





- Removed side panels, inspection plates, and engine cowling and conducted an annual inspection in accordance with AT602 Maintenance Manual Serviced, charged, and installed new batteries.
- Installed new engine air inlet filter. Installed new rudder trim quadrastat
- Installed new rudder pedal return springs.
- Installed new brake disc right hand main landing gear
- Greased all wheel bearings.
- Removed tail gear assembly, disassembled, sandblasted, primed, and repainted.
- Reassembled and reinstalled tail gear assembly using all new attach hardware.
- Installed new aft tail wheel lock cable.
- Sandblasted, primed, and repainted aft lower fuselage tubing
- Cleaned and repainted lower rudder as needed.
- Replaced trim bearings and bushings as needed.
- Installed new rudder cables and aft cable pulleys.
- Installed new control system interconnect cables and pulleys.
- Installed new elevator stop washers.
- Replaced flap hinge bearings as needed.
- Installed new wing rear spar attach bolts.
- Installed new clear leading edge tape on stabilizers and struts.
- Replaced side panel anti chafe cork and wing walk as needed.

Reinstalled side panels, inspection plates, and engine by cowling.

Complied with AD 2005-13-12 by checking torque on stabilizer eyebolts in accordance with SL129. See complete AD list in logs.

CRITEY THIS AIRCRAFT HAS BEEN INSPECTED IAW AN ANNUAL INSPECTION AND IS IN AN AIRWORTHY CONDITION.

Id APPLIED TO SEE THE SEE OF THE SE

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)

Aircraft Corporation

1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D

MAKE AIR TRACTOR MODEL AT-602

SERIAL NUMBER

REGISTRATION N132JW

TOTAL TIME 2824.0 TACH TIME

TIME SINCE O/H

COMPLETED INSTALLATION OF NEW TIRES/TUBES ON MAIN GEAR WHEELS. INSTALLED NEW FUEL QUICK DRAIN L/H WING TANK, WPRK ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR 602 OWNER'S MANUAL, FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED.

W.O. 33912

TON

7-14-2014

KEVIN JACKSON

MIDCONTINENT*

Aircraft Corporation

1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D

AIR TRACTOR

MODEL

SERIAL NUMBER 602-1156

REGISTRATION N132JW

TOTAL TIME

TACH TIME

TIME SINCE O/H

COMPLETED AIR TRACTOR 602 INSPECTION CHECKLIST FOR 100 HOUR ITEMS. SECURED L/H BRAKE LINE TO MAIN GEAR. CHECKED ALL NAVIGATION LIGHTING AND REPAIRED AS REQUIRED. INSTALLED NEW ELEVATOR TRIM CONTROL ROD HARDWARE. INSTALLED NEW HARDWARE RUDDER TRIM AFT CONTROL ROD. INSTALLED NEW ELEVATOR AFT CONTROL ROD BEARING. SUMPED ALL FUEL TANKS. CHECKED ALL COCKPIT LIGHTING, SECURED WIRING AND REPAIRED AS REQUIRED. INSPECTED HYDRAULIC SYSTEM FOR OPERATION AND MISSING HARDWARE. INSTALLED NEW HYDRAULIC SYSTEM DOOR SWITCHING VALVE AND FITTINGS. INSTALLED NEW ROLL PIN AT LOAD VALVE HANDLE. REPLACED WIRE FROM STARTER GENERATOR TO GCU. INSPECTED ALL FUSELAGE SIDE PANELS FOR CONDITION AND REPLACED MISSING SEAL STRIPS. INSTALLED NEW WING WALK L/H I*18D WING. INSTALLED NEW BOOM PRESSURE SWITCHES. WORK ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR 602 OWNER'S MANUAL AND MANUFACTURER'S INSTALLATION DATA. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED, PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW, AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED.

W.O. 33920

7-29-2014

KEVIN JACKSON //Elme Glechon

Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair
Facility. (See back pages for other specific entries.) 4 East 63851 R172D DATE 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D Aircraft Corporation REGISTRATION SERIAL NUMBER MODEL MAKE 602-1156 N132JW AIR TRACTOR AT-602 MAIN TRIM TIME SINCE O/H TACH TIME TOTAL TIME NEW 2839.0 2839.0 URED REMOVED INTELLISTAR GPS SCREEN AND REINSTALLED AFTER INSPECTION IN ACCORDANCE WITH WARE. MANUFACTURERS INSTALLATION MANUAL. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT LOAD DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS SFOR INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED. DNEW ANUAL INENT KEVIN JACKSON 9-27-2014 ER AS CENTINUES NEXT DACK RECORDING TODAY'S TOTAL Description of Inspections Tests Renairs and Alto 1601 Hwy 84 East Hayti, MO. 63851 IN 0 Repair Station No. DFQR172D Aircraft Corporation PE SERIAL NUMBER REGISTRATION MODEL AC N132JW AT-602 602-1156 AIR TRACTOR Al TACH TIME TIME SINCE O/H TOTAL TIME

COMPLETED AIR TRACTOR 602 SCHEDULED INSPECTION CHECKLIST FOR ANNUAL INSPECTION THIS DATE. INSTALLED NEW BRAKE DISC AND LININGS ON L/H MAIN GEAR WHEEL AND BRAKE LININGS ON R/H WHEEL. INSTALLED NEW COTTER PINS LOWER ENGINE MOUNT HARDWARE. INSTALLED CHAFE STRIPE ON FUSELAGE PANELS WHERE NEEDED, INSTALLED NEW FWD. BEARING AT RUDDER TRIM AFT CONTROL ROD. SHIMMED CONTROL STICK TORQUE TUBE TO REMOVE EXCESS FWD AND AFT MOVEMENT. INSTALLED NEW R/H WINDSHIELD LOWER HARDWARE AND SEALED WINDSHIELD EDGES. INSTALLED NEW SHOULDER HARNESS AND LAP BELTS. INSTALLED NEW HOBBS SWITCH. COMPLIED WITH STC#SA01540WI INSTRUCTIONS FOR CONTINUED AIRWORTHINESS INSTRUCTIONS BY REPLACEMENT OF AUGER MOTOR, HOSES, BEARING AND SERVICED RESERVOIR. COMPLIED WITH INSTRUCTIONS FOR CONTINUED AIRWORTHINESS FOR PRECISE FLIGHT PULSELITE CONTROL SYSTEM 1/AW ENGINEERING DRAWING LIST INSTRUCTIONS. COMPLIED WITH INSTRUCTIONS FOR CONTINUED AIRWORTHINESS ON ETEC FAST START SYSTEM. COMPLETED FUEL TANK INDICATING CHECK AND CALIBRATION/ADJUSTMENT. REPAIRED BROKEN WIRE UTILIZED FOR FUEL FILTER PRESSURE SWITCH. REINSTALLED EMERGENCY SHUT-DFF CABLE AND VALVE AND VERIFIED OPERATION. INSTALLED NEW CLEVIS BOLT AT R/H OUTDD GATEBOX DOOR. COMPLETED A.D.

PERFORMED, PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH THE REQUIREMENTS OF AN ANNUAL INSPECTION AND WAS DETERMINED TO BE AIRWORTHY. AIRCRAFT APPROVED FOR RETURN TO SERVICE. W.O. 33983 11-6-2014 KEVIN JACKSON MUTULIAL KEVIN JACKSON	PERFORM	MANUAL AND M	ANNUAL INST ANUFACTURE	PECTION, WORK ER'S INSTALLAT	ACCOMPLISHE ION DATA, FIN	IN ACCORDA D IN ACCORDA AL INSPECTION	NCE WITH A COMPLETE	SL# 129A; IR TRACTOR D ON ALL W	DUE repair R 602 VORK
EAR: RECORDING TODAY'S TOTAL THE IN THE IN Entires must be endorsed with Name Religion and Alterations Entires must be endorsed with Name Religion and Alterations	ACCORDA AIRCRAFT	ED. PERTINENT DER PER NUMBER ANCE WITH THE REPROVED FOR	S INDICATE EQUIREMENT RETURN TO	ALL WORK ACCO ED BELOW. I CI TS OF AN ANNUA SERVICE.	ERTIFY THAT	ON FILE AT 19 THIS AIRCRAF	HAS BEEN	INSPECTE	D IN
EAR: RECORDING TODAY'S TOTAL TIME IN Entires must be endorsed with Name Rating and Alterations Entires must be endorsed with Name Rating and Alterations	W.O,	33983	11-6-	2014	KEVI	N JACKSON A	anye	~	
EAR: RECORDING TODAY'S TOTAL TIME IN Entires must be endorsed with Name Rating and Alterations Entires must be endorsed with Name Rating and Alterations									
EAR: RECORDING TODAY'S TOTAL TIME IN FINE THE IN FINE									11
EAR: RECORDING TODAY'S TOTAL TIME IN FINE THE IN FINE									
EAR: RECORDING TODAY'S TOTAL TIME IN FINISHER PRINTING MICH. PRINT	-		-			120			-15-1
EAR: RECORDING TODAY'S TOTAL TIME IN FINISHER PRINTING MICH. PRINT	14	11 (4)		the later	70	2 10	-	. 4	
	-		to contact	CANAL COLUMN TO	2000 2000				
	-		-			- 22-2-0		200	2 22
	-					311	No.		
			V 1 300	OS POR SOM	Salar Sa		-		
		AND DESCRIPTION							State of the state
					Test Carrier Carrier	THE CONTRACT OF THE CONTRACT O	BESCH BEST STATE	Name of the last	No.
Facility. (See back pages for others specific entries.)		CH FLIGHT	TIME IN	Description o	f Inspections,	Tests, Repaire	and Alterat	ions	1000
1 100		NE.	SERVICE				rtificate Number	M of Tochning	On Decision

REMOVED COCKPIT CENTER WINDSHIELD AND COMPLETED INSTALLATION OF FACTORY NEW WINDSHIELD. WORK ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR 602 OWNER'S MANUAL. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED.

W.O. 34073

4-30-2015

KEVIN JACKSON

D. WORK ETED ON

> CO CHE FIN ON

M. AI

TO

TOTAL TIME IN SERVICE Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.) 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D 20 Aircraft Corporation REGISTRATION SERIAL NUMBER MODEL MAKE AIR TRACTOR N132JW 602-1156 TIME SINCE O/H TACH TIME TOTAL TIME DK 3204.0 ON COMPLETED INSTALLATION OF NEW P/N HP-208 HYDRAULIC SYSTEM POWER PACK, SET SYSTEM PRESSURE AND ON CHECKED OPERATION IN ACCORDANCE WITH STC#SA01540WI INSTRUCTIONS FOR CONTINUED AIRWORTHINESS. RK FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED. KEVIN JACKSON //Www./www. 7-17-2015 W.O. 34163 Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D Aircraft Corporation SERIAL NUMBER REGISTRATION MODEL MAKE 602-1156 N132JW AIR TRACTOR AT-602 TACH TIME TIME SINCE O/H TOTAL TIME N/A 3224.2 INSTALLED NEW BRAKE LININGS ON MAIN GEAR WHEELS. INSTALLED NEW O-RINGS IN R/H BRAKE CALIPER AND

BRAKE DISC ON R/H MAIN WHEEL, SERVICED BRAKE SYSTEM AND CHECKED OPERATION. WORK ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR 602 OWNER'S MANUAL. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED, PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK

7-22-2015

KEVIN JACKSON HEVER CHOCK

ACCOMPLISHED.

W.O. 34170

3851

72D

AND

SHED

ORK

NDER

ORK

Description of Inspections, Tests, Repairs and Alterations

Entires must be endorsed with Name, Rating and Certificate Number of Technician or Repair

Aircraft Corporation

1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D

MAKE

MODEL AT-602

SERIAL NUMBER

REGISTRATION N1321W

TOTAL TIME

TACH TIME

TIME SINCE O/H

COMPLETED REMOVAL OF HEMISPHERE GPS INTELLISTAR SWATH GUIDANCE SYSTEM IN ACCORDANCE WITH INSTALLATION MANUAL P/N 875-0239-000. COMPLETED INSTALLATION OF HEMISPHERE GPS G-4 SWATH GUIDANCE SYSTEM P/N 900-1042-000 IN ACCORDANCE WITH MANUFACTURERS INSTALLATION MANUAL P/N 875-0307-000 REV

AL COMPLETED UPDATE OF AIRCRAFT WEIGHT AND BALANCE REPORT. COMPLETED FAA FORM 337 FOR INSTALLATION AND PLACED IN AIRCRAFT RECORDS. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED.

W.O. 34241

11-6-2015

KEVIN JACKSON / EUTH

RECORDING TODAY'S

Description of Inspections. Tests. Repairs and Alterations

SERIAL NUMBER

602-1156

Aircraft Corporation

1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D

REGISTRATION

N132JW

AIR TRACTOR TOTAL TIME 3382.7

TACH TIME


TIME SINCE O/H

COMPLETED AIR TRACTOR 602 SCHEDULED INSPECTION CHECKLIST FOR ANNUAL INSPECTION THIS DATE. INSTALLED NEW BRAKE DISC L/H MAIN GEAR WHEEL. COMPLIED WITH SL# 331 BY VISUAL INSPECTION OF UPPER RUDDER HINGE IN ACCORDANCE WITH S.L. INSTRUCTIONS. INSTALLED NEW FUEL QUICK DRAINS IN EACH WING. REPAIRED TAIL NAV POWER WIRE. INSTALLED NEW HYDRAULIC HOSES, AUGER BEARING, DOOR SEAL, AND SERVICED HOPPER DOOR AND AUGER SYSTEM IN ACCORDANCE WITH STC INSTRUCTIONS. REPAIRED CRACK IN AFT BELLY SKINS. REPAIRED OIL COOLER SCOOP, REMOVED AIR CONDITIONER DRIVE, SERVICED SPLINES AND REINSTALLED. INSTALLED NEW L/H ELEVATOR TRIM TAB BUSHING. REMOVED REAR WING SPAR ATTACH BOLTS AND INSTALLED NEW HARDWARE. COMPLETED A.D. APPLICABILITY AND COMPLIANCE CHECK: SEE COMPLETE LISTING IN LOGS. COMPLIED WITH AD 2005-13-12 EFF. 8-5-2005 BY TORQUE INSPECTION OF HORIZONTAL ATTACHMENTS IN ACCORDANCE WITH SL# 129A; DUE INSPECTION AGAIN NEXT ANNUAL INSPECTION INSPECTED AIRCRAFT FOR ADDITIONAL INSTALLATIONS AND COMPLIED WITH INSTRUCTIONS FOR CONTINUED AIRWORTHINESS: SEE SUPPLEMENTARY CHECKLIST, WORK ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR 602 OWNER'S MANUAL

CONTINGED NORT PROF,

AND MANUFACTURER'S INSTALLATION DATA, FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED, PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH THE REQUIREMENTS OF AN ANNUAL INSPECTION AND WAS DETERMINED TO BE AIRWORTHY. AIRCRAFT APPROVED FOR RETURN TO SERVICE. 84 East). 63851 QR172D Meran Gina W.O. 34248 12-14-2015 KEVIN JACKSON IS DATE. TION OF RAINS IN OR SEAL, D CRACK NES AND DLTS AND LISTING CHMENTS RAFT FOR ESS: SEE MANUAL PAGE/

VEAR:	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility (See back pages for other specific entries.)	100
02/01	33842		3384.2	Completed work as. follows: Replaced right	
				3 ea. Battery with now Gill 246 AT	
				bettays Replace Keplaced 3ea.	
				civets in hight leading edge center	
				Skin joint Stop deilled cracks	
				as required. Kepbred wing walk	
				with hew. Replaced placends as	
				required. Dock completed IAN	
100				AT- bod owners manual Aircraft	
				aproved for retyin to service for	
				work Completed James Machine	

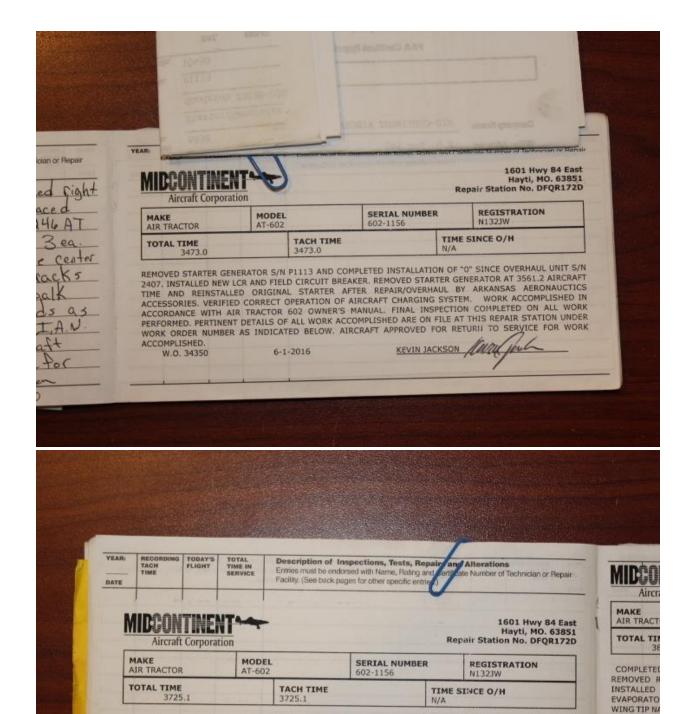

REMOVED AIR CONDITIONER CLUTCH SOLENOID AND INSTALLED NEW SOLENOID P/N 25-8597 IN ACCORDANCE

WITH AIR TRACTOR OWNERS MANUAL INSTRUCTIONS. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED.

PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER

KEVIN JACKSON // TON

NUMBER AS INDICATED BELOW, AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED.

8-3-2016

W.O. 34431

SWITCH. RE

PRIMED/PAI

COCKPIT AS


ACCESS ST

WING FUEL


CORROSIO RELOCATED GEAR BOLT


MIDCONTINENT ician or Repair 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D Aircraft Corporation MAKE AIR TRACTOR MODEL SERIAL NUMBER REGISTRATION Wy 84 East MO. 63851 DFQR172D AT-602 TOTAL TIME TACH TIME TIME SINCE O/H 3820.1 COMPLETED AIR TRACTOR 602 SCHEDULED INSPECTION CHECKLIST FOR ANNUAL INSPECTION THIS DATE. REMOVED REAR SPAR BOLTS AND INSTALLED NEW ATTACH HARDWARE, REMOVED, CLEANED, INSPECTED, INSTALLED NEW BEARINGS AND SERVICED AIR CONDITIONER DRIVE PAD SPLINES. CLEANED AIR COND. EVAPORATOR FILTER AND INSTALLED NEW TOP DUCT SCAT TUBE. REPAIRED REAR NAV WIRING, INSTALLED NEW WING TIP NAV BULBS, ADJUSTED POSITIONING OF R/H ANTI BIRD LIGHT, CLEANED AND CHECKED STALL WARNING SWITCH. REATTACHED WIRE TO SWATH ADVANCE SWITCH. REPAIRED HOLE IN R/H OUTBD BATTERY BOX AND CORDANCE PRIMED/PAINTED. INSPECTED FUSELAGE PANELS FOR CONDITION AND REPAIRED AS NEEDED. COVERED HOLES IN ERFORMED. COCKPIT AS NEEDED. INSTALLED NEW FRESH AIR DUCT R/H SIDE OF COCKPIT. WELD REPAIRED R/H COCKPIT ACCESS STEP, INSTALLED NEW L/H FUEL TANK QUICK DRAIN. RESEALED EPA FUEL CAN QUICK DRAIN. SEALED L/H ORK ORDER ISHED. WING FUEL TANK COVER. CLEANED L/H AILERON TRIM TAB FRONT ROD END BEARING AND LUBRICATED. REMOVED CORROSION FROM L/H OUTBD FLAP ATTACH. FABRICATED AND INSTALLED NEW TAIL WHEEL LOCK CABLE. RELOCATED LASER ALTIMETER CABLE TO PREVENT CHAFE ON RIBS. INSPECTED TORQUE AND SECURITY OF MAIN GEAR BOLTS AND ATTACHMENTS. COMPLETED A.D. APPLICABILITY AND COMPLIANCE CHECK: SEE COMPLETE CONTINES NEXT PAGE LISTING IN LOGS. COMPLIED WITH AD 2005-13-12 EFF. 8-5-2005 BY TORQUE INSPECTION OF HORIZONTAL ATTACHMENTS IN ACCORDANCE WITH SL# 129A; DUE INSPECTION AGAIN NEXT ANNUAL INSPECTION. INSPECTED AIRCRAFT FOR ADDITIONAL INSTALLATIONS AND COMPLIED WITH INSTRUCTIONS FOR CONTINUED AIRCRAFT SEE SUPPLEMENTARY CHECKLIST. WORK ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR AND MANUAL AND MANUAL TUDER'S INSTALLATION DATA. SINAL INSPECTION COMPLETED ON ALL WOOM AIRWORTHINESS: SEE SUPPLEMENTARY CHECKLIST. WURK ACCOMPLISHED IN ACCURDANCE WITH AIR TRACTURE 602 OWNER'S MANUAL AND MANUFACTURER'S INSTALLATION DATA. FINAL INSPECTION COMPLETED ON ALL WORK 602 OWNER'S MANUAL AND MANUFACTURER'S INSTALLATION DATA, FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED, PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN WORK ORDER NUMBER AS INDICATED BELOW. I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH THE REQUIREMENTS OF AN ANNUAL INSPECTION AND WAS DETERMINED TO BE AIRWORTHY. AIR TO KEVIN JACKSON // MINI / fluston INST INST OF A BELC

1	AIR TRACTOR	MODEL AT-602		1601 Hwy 84 East — Hayti, MO. 63851 Repair Station No. DFQR172D			
1	TOTAL TIME		011	SERIAL NUMB 602-1156	ER	REGISTRATION N132JW	1-
	TOTAL TIME 3837.9		ACH TIME 837.9		TIME S	TIME SINCE O/H	
	MIDCONT						vy 84 East
1	Aircraft (Corporation	EL.			Repair Station No. D	MO. 63851 DFQR172D
1	Aircraft (602-11	L NUMBER	Repair Station No. D	MO. 63851 DFQR172D

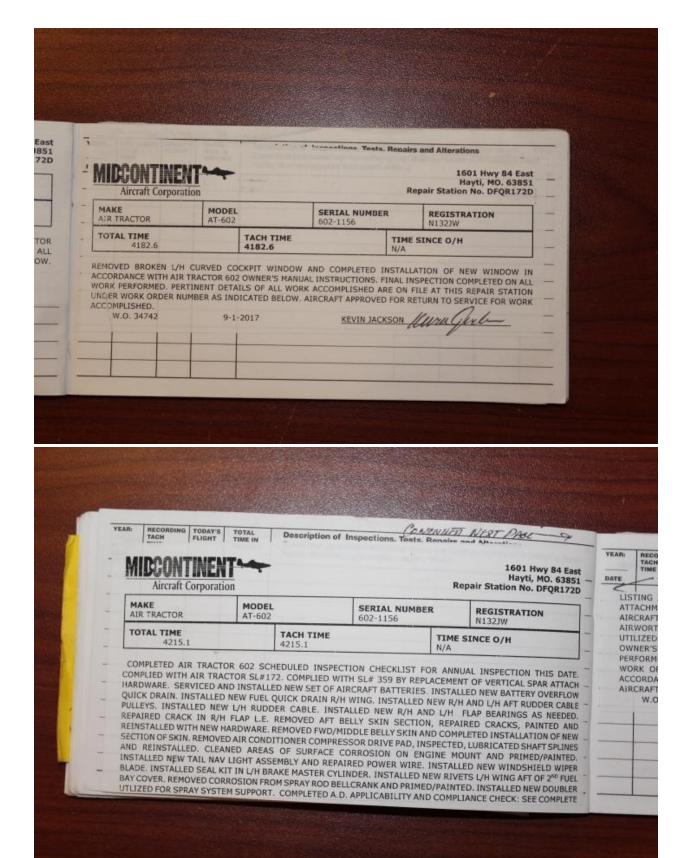

YEAR Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Railing and Certificate Number of Technician or Repair. TOTAL vy 84 East MO. 63851 DATE Merio acting (See back pages for other specific entries.) DATINUES DFQR172D LISTING IN LOGS, COMPLIED WITH AD 2005-13-12 EFF. 8-5-2005 BY TORQUE INSPECTION OF HORIZONTAL ATTACHMENTS IN ACCORDANCE WITH SL# 129A; DUE INSPECTION AGAIN NEXT ANNUAL INSPECTION. INSPECTED AIRCRAFT FOR ADDITIONAL INSTALLATIONS AND COMPLIED WITH INSTRUCTIONS FOR CONTINUED AIRWORTHINESS: SEE SUPPLEMENTARY CHECKLIST. INSTALLED NEW AUGER MOTOR, HOSES AND BEARING UTILIZED FOR HOPPER LOADING SYSTEM. WORK ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR 602 OWNER'S MANUAL AND MANUFACTURER'S INSTALLATION DATA. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN HIS DATE. ACCORDANCE WITH THE REQUIREMENTS OF AN ANNUAL INSPECTION AND WAS DETERMINED TO BE AIRWORTHY. AR ATTACH AIRCRAFT APPROVED FOR RETURN TO SERVICE. OVERFLOW W.O. 34808 2-3-2018 KEVIN JACKSON // Wyl Mulan DER CABLE NEEDED. NTED AND ON OF NEW TSPLINES /PAINTED LD WIPER F 2ND FUEL DOUBLER COMPLETE YEAR Description of Inspections, Tests, Repairs and Alterations FLIGHT TIME IN SERVICE Entries must be endorsed with Name, Flating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.) VEAR: DATE DATE 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D Aircraft Corporation MAKE MODEL SERIAL NUMBER REGISTRATION AIR TRACTOR AT-602 N132JW MA TOTAL TIME AIF TACH TIME TIME SINCE O/H 4326.4 4326.4 N/A TO COMPLETED WELD REPAIR OF CRACK IN L/H AFT CORNER OF GATE BOX. CORRECTED SMALL LEAK AT FLOW CONTROL VALVE SHAFT. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL CON WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. IN S AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED. NEW W.O. 34874 5-4-2018 KEVIN JACKSON Mul mela PER NUN

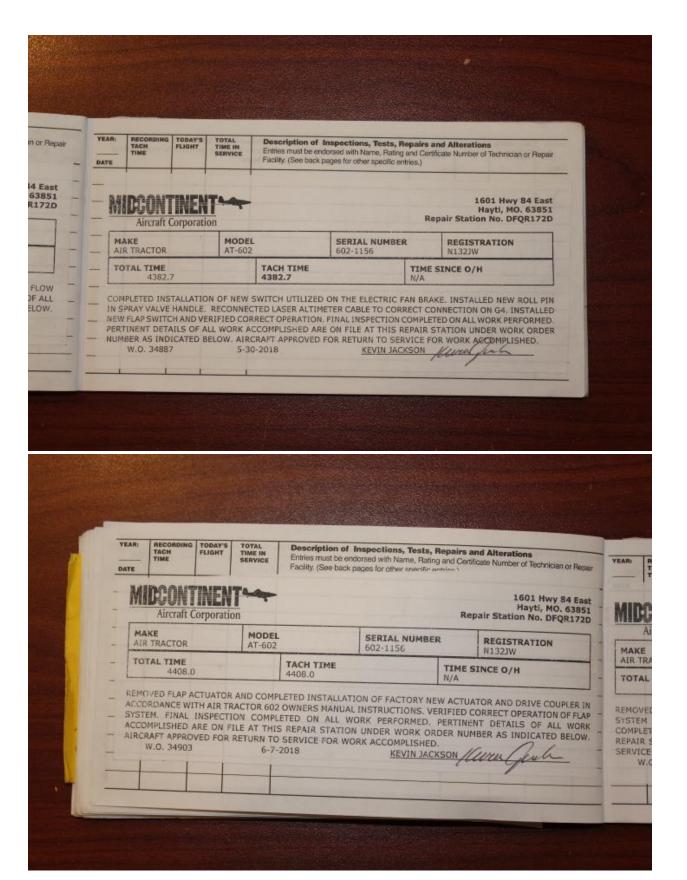

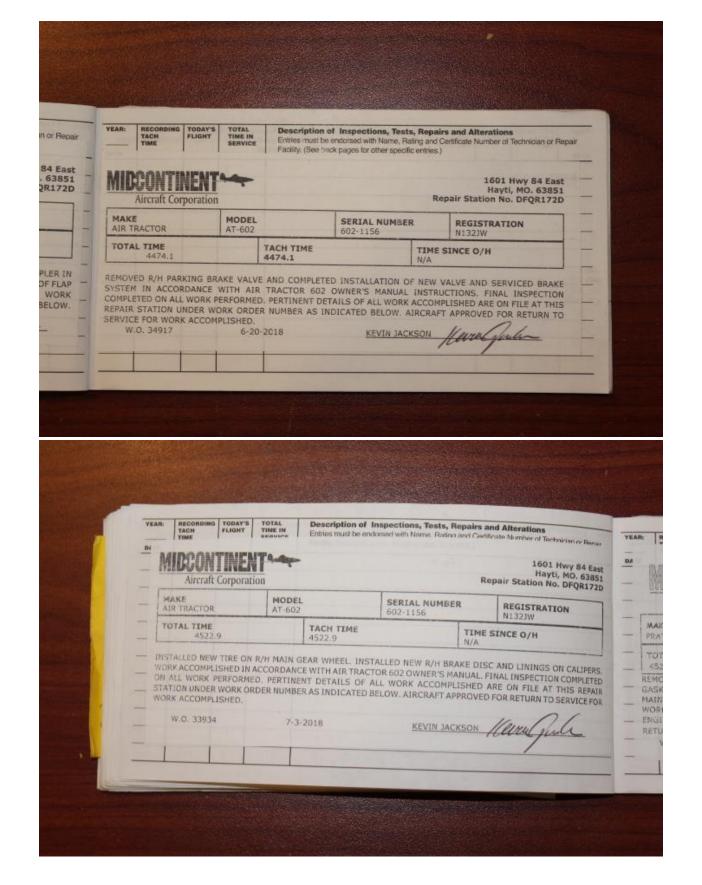

tions or of Technician or Re RECORDING TODAY'S TOTAL Description of Inspections, Tests, Repairs and Alterations 1601 Hwy 84 East Hayti, MO. 63851 tion No. DFQR172D 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D Aircraft Corporation TRATION Phone (800)325-0885 MODEL SERIAL NUMBER REGISTRATION PRATT & WHITNEY CANADA PT64-60AG PCE -RS0136 MISSIM TOTAL TIME TACH TIME TIME SINCE O/H INGS ON CALIPERS. TACH: 4522.9 ECTION COMPLETED REMOVED FUEL NOZZLE ASSEMBLIES, CLEANED AND FLOW CHECK NOZZLES, AND REINSTALLED WITH NEW GASKETS/O-RINGS, ALL MAINTENANCE PERFORMED I/A/W AIR TRACTOR 602 OWNER'S AND PRATT/WHITNEY LE AT THIS REPAIR RN TO SERVICE FOR MAINTENANCE MANUAL. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED, PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW ENGINE GROUND RUN AND OPERATIONALLY CHECKED THROUGH ALL OPERATING PARAMETERS AND APPROVED FOR RETURN TO SERVICE. KEVIN JACKSON //WILL june W O. 34934 7-3-2018 Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair
Facility. (See back pages for other specific entries.) 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D Aircraft Corporation MA MODEL SERIAL NUMBER MAKE REGISTRATION AIR TRACTOR AT-602 N132JW TO TOTAL TIME TACH TIME TIME SINCE O/H REP INS INSTALLED NEW RH COCKPIT DOOR WINDOW WITH NEW HARDWARD, WORK ACCOMPLISHED IN ACCORDANCE WITH ACC AIR TRACTOR 602 OWNER'S MANUAL, FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS ALL UN INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED. ACC W.O. 34955 MALCOMB ALLEN //

RECORDING TODAY'S TOTAL Description of Inspections, Tests, Repairs and Alterations chnician or Repair 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D MIDGONTINEN Hwy 84 East i, MO. 63851 i. DFQR172D Aircraft Corporation MODEL SERIAL NUMBER REGISTRATION MAKE AIR TRACTOR 602-1156 N132JW ON TOTAL TIME TACH TIME TIME SINCE O/H REPLACE RH AND LH BRAKE CALIPER SEALS. INSTALLED NEW RH AND LH BRAKE BLEEDER SCREWS AND SEATS. INSTALLED NEW LH BRAKE HOSE SUPPLIED BY OWNER. BLED AND SERVICED BRAKE SYSTEM, WORK DANCE WITH ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR 602 OWNER'S MANUAL. FINAL INSPECTION COMPLETED ON PERTINENT ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION. NUMBER AS UNDER WORK ORDER NUMBER AS INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED. W.O. 34963 8-2-2018 MALCOMB ALLEN Description of Inspections, Tests, Repairs and Alterations
Entires must be endorsed with Name, Rating and Certificate Number of Technician or Repair
Facility. (See back pages for other specific entries.) TOTAL TIME IN SERVICE Cont ON EN 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR1720 ACCOR Aircraft Corporation SEE CO MAKE MODEL AT-602 SERIAL NUMBER WORK REGISTRATION N132JW AIR TRACTOR INSTAL ACCOM TOTAL TIME TACH TIME CERTIF TIME SINCE O/H INSPEC COMPLETED AIR TRACTOR 602 SCHEDULED INSPECTION CHECKLIST FOR ANNUAL INSPECTION THIS DATE REMOVED, CLEANED, INSPECTED, INSTALLED NEW BEARINGS AND SERVICED AIR CONDITIONER DRIVE PADESPLINES. INSTALLED NEW SET OF MAIN GEAR BOLTS. INSTALLED NEW CLAMP ON RH PANEL STRINGER UNDER LIFE COCKPIT DOOR, FABRICATED PATCH AND REPAIRED VERTICAL PANEL STRINGER ON LH SIDE AFT OF AIR CONDITION CONDENSER BOX. FABRICATED PATCHES AND REPAIRED CRACKS ON RH PANEL BESIDE ENGINE SCOOP. WELD PEPAIRED BROKEN SPRAY PUMP MOUNT BRACKET. REPAIRED CRACK ON LH AND RH. HORIZONTAL STAB INBOARD TOP SIDE SKINS BY REPLACING CRACKED SKINS. REPAIRED BROKEN FUEL CONTROL DRAIN LINE, VERIFIED TORQUE next page

RECORDING TODAY'S TOTAL Description of Inspections, Tests, Repairs and Alterations thnician or Repair Continued from previous page DA' ON ENGINE MOUNT BOLTS AT FIREWALL CONNECTIONS. INSTALLED NEW RH STROBE POWER SUPPLY P/N 01-0770006-08. REPLACED HYDRAULIC GATE MOTOR ASSEMBLY, HYDRAULIC RAM, AND SERVICED SYSTEM IN ACCORDANCE WITH MANUFACTURES INSTRUCTIONS. COMPLETED A.D. APPLICABILITY AND COMPLIANCE CHECK: SEE COMPLETE LISTING IN LOGS. COMPLIED WITH AD 2005-13-12 EFF. 8-5-2005 BY TORQUE INSPECTION OF 01 Hwy 84 East lyti, MO. 63851 No. DFQR172D HORIZONTAL ATTACHMENTS IN ACCORDANCE WITH SL# 129A; DUE INSPECTION AGAIN NEXT ANNUAL INSPECTION. WORK ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR 602 OWNER'S MANUAL AND MANUFACTURER'S INSTALLATION DATA. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ATION ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. I CERTIFY THAT THIS AIRCRAFT HAS BEEN INSPECTED IN ACCORDANCE WITH THE REQUIREMENTS OF AN ANNUAL INSPECTION AND WAS DETERMINED TO BE AIRWORTHY. AIRCRAFT APPROVED FOR REJURY TO SERVICE. 3-9-2019 W.O. 35052 MALCOMB ALLEN ON THIS DATE. NER DRIVE PAD NGER UNDER LH AIR CONDITION E SCOOP, WELD STAB INBOARD RIFIED TORQUE Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technican or Repair Facility. (See back pages for other specific entries.) DATE 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR1720 Aircraft Corporation SERIAL NUMBER REGISTRATION MAKE 602-1156 N132JW TACH TIME TIME SINCE O/H TOTAL TIME 4742.1 REMOVED LH EXHAUST, WELD REPAIRED SMALL CRACK, INSTALLED LH EXHAUST IN SAME LOCATION WORK ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR 602 OWNER'S MANUAL AND AC43.13-1B. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. AIRCRAFT APPROVADIFOR RETURN TO SERVICE FOR WORK ACCOMPLISHED. 4-10-2019 MALCOMB ALLEN W.O. 35081

OZARK AIRCRAFT MAINTENANCE LLC CAPE GIRARDEAU REGIONAL AIRPORT, CAPE GIRARDEAU MO

February 1, 2020 N132JW Air Tractor AT-602 S/N 1156

Hr meter 5070.1 Total Time 5070.1 Cycles 1056

On this date disassembled cleaned primed and painted tail wheel spring, fork, housing and cap, lock assy and reassembled and installed using all new hardware. Installed new right main tire. Installed all new tail wheel bearings packed main bearings. Replaced left brake disc and installed all new brake pads and service with clean fluid. Installed new fresh air scat hose. Installed small doubler repairs on belly skins these are considered minor repairs. Cleaned and charged main batteries. Checked all lighting. C/W AD2005-13-12 Rev 8-5-2005 by replacement of horizontal stabilizer attach eyebolts per SB129A next torque due at 100 hours then ea 12 months until replacement at hobbs 6420.1. Cleaned primed and painted steps and elevator rudder trim tabs and replaced hardware. Replaced wing walk surface as needed I certify that this Aircraft has been inspected IAW

FAR 43 App (d) an Annual inspection and was determined


to be in an airworthy condition.
Brian J Ozart AP41640790IA


MID-CONTINENT AIRCRAFT CORPORATION Phone 573-359-0500 Fax 573-359-1323 FAA CRS NO. DFQR172D SERIAL NUMBER REGISTRATION N132JW TOTAL TIME TACH TIME TIME SINCE O/H N/A REPLACED 2 HYDRAULIC LINES FROM GATEBOX CYLINDER TO BULKHEAD FITTINGS IN BELLY WITH NEW. REPLACED 2 ELBOW FITTINGS AT BELLY WITH NEW. REPAIRED BROKEN TERMINAL ON ITT HARNESS AT ENGINE. DETAILS OF WORK ACCOMPLISHED CAN BE FOUND UNDER WORK ORDER NUMBER BELOW. FINAL INSPECTION COMPLETED ON ALL WORK ACCOMPLISHED. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK COMPLETED THIS WORK ORDER. THOMAS RUSSELL Thomas Rendo W.O. 35466 8-17-2020

YEAR: TOTAL TIME IN SERVICE Description of Inspections, Tests, Repairs and Alterations
Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D Aircraft Corporation MAKE MODEL SERIAL NUMBER REGISTRATION AIR TRACTOR AT-602 602-1156 N1321W TOTAL TIME TACH TIME TIME SINCE O/H INSTALLED NEW TRINARY SWITCH. INSTALLED NEW KNIFE SPLICE CONNECTORS IN TRINARY SWITCH WIRING AS REQUIRED. INSTALLED NEW RECEIVER/DRYER. INSTALLED NEW HIGH PRESSURE HOSE FROM FIREWALL TO COMPRESSOR. INSTALLED NEW FITTING ON LOW PRESSURE HOSE AT CONDENSER. PRESSURE CHECKED SYSTEM. NO LEAKS NOTED AT THIS TIME. EVACUATED SYSTEM AND SERVICED WITH R-134A REFRIGERANT. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED. W.O. 35485 9-11-2020 THOMAS RUSSELL YEAR: TOTAL Reference of Major Repairs and Major Alterations To TIME IN 1601 Hwy 84 East Hayti, MO. 63851 Repair Station No. DFQR172D Aircraft Corporation MAKE MODEL SERIAL NUMBER AIR TRACTOR REGISTRATION AT-602 602-1156 N132JW TOTAL TIME TACH TIME TIME SINCE O/H 5499.8 5499.8 INSTALLED FLUSH PATCHES ON L/H AND R/H LOWER ENGINE CORNER COWLS. FABRICATED AND FIT AFT LOWER ENGINE COWL PANEL. FABRICATED AND FIT PANEL BETWEEN MLG. PRIMED AND PAINTED BOTH NEW PANELS. FIT AND INSTALLED NEW T-BOOM. REPAIRED WIRING FOR CHIP DETECTOR CANNON PLUG. WELDED SMALL CRACKS IN GATEBOX ADAPTER AT L/H AND R/H AFT CORNERS. ALL WORK PERFORMED IN ACCORDANCE WITH AT-602 MAINTENANCE MANUAL AND AC43.13-1B. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED. PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NUMBER AS INDICATED BELOW. AIRCRAFT APPROVED FOR RETURN TO SERVICE FOR WORK ACCOMPLISHED. TOM RUSSELL QUEKE

ATE OZARK AIRCRAFT MAINTENANCE LLC CAPE GIRARDEAU REGIONAL AIRPORT, CAPE GIRARDEAU MO February 1, 2021 N132JW Air Tractor AT-602 S/N 1156 Hr meter 5505.4 Total Time 5505.4 On this date disassembles cleaned primed and painted tail wheel spring, fork, housing and cap, lock assy and reassembled and installed using all new hardware. Installed all new tail and main wheel bearings. Installed new aft belly skin. Serviced and charged main batteries. Replaced main tires and installed all new brake linings and serviced brakes. Checked all lighting. C/W AD2005-13-12 Rev 8-5-2005 by replacement of horizontal stabilizer attach eyebolts per SB129A next torque due at 100 hours then ea 12 months therafter. I certify that this Aircraft has been inspected IAW FAR 43 App (d) an Annual inspection and was determined to be in an airworthy condition. Brian J Stark AP41640790IA TOTAL TIME IN SERVICE Reference of Major Repairs and Major Alterations To FAA Form 337 by Date, or to the Work Order by Number and the Approving Agency DATE closed CRS DEAR 172D



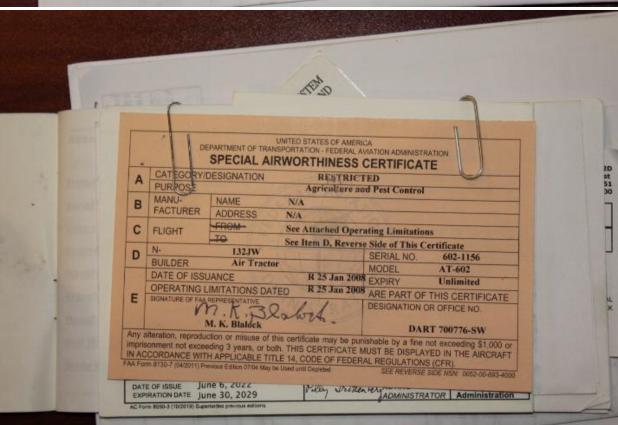

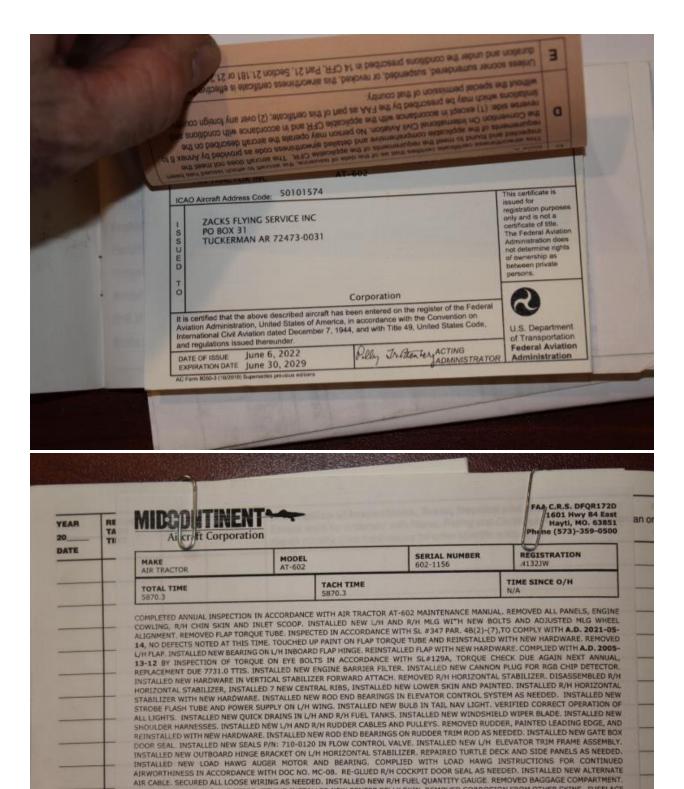

REMOVED BELLY SKINS AND STEPS. FIT AND INSTALLED NEW CENTER BELLY SKIN. REMOVED CORROSION FROM OTHER SKINS, PUSELAGE

-CONTINUED ON NEXT PAGE----

TUBING, AND BRACKETS, AND PAINT AS REQUIRED.

SYSTEM

CONTROLS IN BEARINGS IN BOLTS. ADJUS AND ENGINE (CHECKED ALL PERFORMED. F	SPRAY HANDLE BE T BETA SWITCH, IN	EPS AND BAGGAGE COM AND INSTALL 2 AFT PANE ILL CRANK. INSTALLED NO ISTALLED NEW STALL WAS	TINUED FROM PREVIOUS PAGE PARTMENT WITH NEW HARDW LS ON L/H AND R/H SIDES OF IEW DRY HANDLE CALIBRATION INTING SWITCH. INSTALLED ALL TENANCE. INSTALLED NEW FULL PAGE RECORD IN AIRCRAFT LOGS SHED ARE ON FILE AT THIS REPA	PANELS, R/H EL SHUT-OFF	CHIN SKIN, LOWE SPRING IN THROT	TLE QUADRANT.	∍chnic
BELOW.			WORKETED IN A	CORDANCE		1	
	1 CER	ANNUAL INSPECTI	*11	100000000000000000000000000000000000000		1	
	W.O. 35804	09/FEB/2022	TOM RUSSI	- Jan	Rud	-	
1	1						
							-
SIN THE		0.000	A STATE OF THE STA			YARAMI	
MIDCON'	TINEN Corporation	I——			P	C.R.S. DFQE 1601 Hwy 84 Hayti, MO. hone: (573)-359	East _
Aircraft	морг	EL.	SERIAL NUMBER 602-1156		REGISTRAT:	1601 Hwy 84 Hayti, MO. (hone: (573)-359	East _
KE TRACTOR TAL TIME	MODE AT-60	TACH TIME 5870.3		TIME S	REGISTRAT	1601 Hwy 84 Hayti, MO. (hone: (573)-359	East _
ATECTATE TRACTOR TAL TIME 10.3 MOVED BYH HORIZONT STALLED BUSHING P/N STALLED HORIZONTAL MORE ACCOMPLISHED:	MODE AT-60 FAL STABILIZER ST 112168-1 IN FUSE STRUT WITH NEW IN ACCORDANCE V	TACH TIME 5870.3 FRUT. LAGE EAR. HARDWARE.	602-1156 VING 12167 AND AT-602 MAIN JSHED ARE ON FILE AT THIS PROVED FOR RETURN TO SEE	N/A NTENANCE P	REGISTRATI N1323W INCE O/H IANUAL FINAL INS	1601 Hwy 85 Hayti, MO. o hone: (573)-359	4 East 638510500
AIFCEAR TRACTOR TAL TIME 0.3 MOVED B/H HORIZONT STALLED HORIZONTAL MORE ACCOMPLISHED:	MODE AT-60 AT-60 TAL STABILIZER ST 11 2168-1 IN FUSE STRUT WITH NEW IN ACCORDANCE V RITINENT DETAILS WORK PERFORME	TACH TIME 5870.3 TRUT. LAGE EAR. HARDWARE. WITH AIR TRACTOR DRAW OF ALL WORK ACCOMPI D THIS AIRCRAFT, IS AP	602-1156 VING 12167 AND AT-602 MAIN JSHED ARE ON FILE AT THIS PROVED FOR RETURN TO SEE	N/A WITENANCE M REPAIR STA EVICE.	REGISTRATI N1323W INCE O/H IANUAL FINAL INS	1601 Hwy 85 Hayti, MO. o hone: (573)-359	4 East 638510500
ATECTATE TRACTOR TAL TIME 10.3 MOVED BYH HORIZONT STALLED BUSHING P/N STALLED HORIZONTAL MORE ACCOMPLISHED:	MODE AT-60 AT-60 TAL STABILIZER ST 11 2168-1 IN FUSE STRUT WITH NEW IN ACCORDANCE V RITINENT DETAILS WORK PERFORME	TACH TIME 5870.3 TRUT. LAGE EAR. HARDWARE. WITH AIR TRACTOR DRAW OF ALL WORK ACCOMPI D THIS AIRCRAFT, IS AP	602-1156 VING 12167 AND AT-602 MAIN JSHED ARE ON FILE AT THIS PROVED FOR RETURN TO SEE	N/A WITENANCE M REPAIR STA EVICE.	REGISTRATI N1323W INCE O/H IANUAL FINAL INS	1601 Hwy 85 Hayti, MO. o hone: (573)-359	4 East 638510500

RECORDING TODAY'S TOTAL Description of Inspections Tosts Donales and Ath

MIDCONTINENT

Aircraft Corporation

C.R.S. DFQR172D 1601 Hwy 84 East Hayti, MO. 63851 Phone: (573)-359-0500

MAKE Paw C	MODEL PT6A-60A	G	SERIAL NUMBER PCE-RG0136		REGISTRATION N1323W	
TOTAL TIME		TACH TIME 5897.7		TIME SIN	CE O/H	

INSPECTED ENGINE CONTROLS, FOR A NO START SITUATION.
 ADJUSTED FUEL CONDITION CONTROL CABLE AT F.C.U. AS NEEDED.
 ENGINE GROUND RUN AND VERIFIED CORRECT OPERATION DURING START.

ALL WORK ACCOMPLISHED IN ACCORDANCE WITH AIR TRACTOR AT-602 MAINTENANCE MANUAL AND PT6A-60 ENGINE MAINTENANCE MANUAL. FINAL INSPECTION COMPLETED ON ALL WORK PERFORMED, PERTINENT DETAILS OF ALL WORK ACCOMPLISHED ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER AS INDICATED BELOW, WITH RESPECT TO WORK PERFORMED THIS AIRCRAFT, IS APPROVED FOR RETURN TO SERVICE.

W.O. 35853

14/MAR/2022

TOM RUSSELL JOIN TUND

INSPECTION CONFICE TO UN ALL WORK PERFURMED, PERTINENT DETAILS OF ALL WORK ACCOUNT EISTED ARE DISTILLED AT THIS SERVICE.

W.O. 35853

14/MAR/2022

TOM RUSSELL

W.O. 35853

RECORDING TODAY'S TOTAL

Description of Incocations Toste Donnies and Alt.

Patton Aircraft Repair

Date:2/1/2023

AT602-1156 N132JW

Hobbs & TT: 6236.0 Hrs

Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blasted corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new flap coupler. Installed new 10-23F master cylinder. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W lock cable. Installed new nav bulb. AD's researched through this date see attached sheets in logs. I certify that this airframe has been inspected in accordance with a 100 hour inspection and it was determined to be in an airworthy condition.

Chris S Patton A&P 3473462

Date: 2/1/2023 N132JW AT602-1156 Complied with annual inspection this date. I certify that this airframe has been inspected I/A/W ar annual inspection and was determined to be in an airworthy condition. Patrick Williams IA3645292 Patrick Williams IA3645292 FROST FLYING MAINITENANCE, INC. Marianna, AR Phone: (870) 295-3776 Registration: N132JW Model: AT-602 SNs. 602-1156 1. Installed L/H & R/H wing IAW S.L. 80FF & DWG 20777. L/H S/N: 5190A-98 & R/H: 5190A-98 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blast checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blast checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blast checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blast checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blast corrosion. Repainted and reinstalled using new hardware. Installed 11 new M514104-4 bearings in elevators and rudder. Installed 8 new 191-1 bushings in trim. Installed new center windshield frame and elevators and rudder. Installed 8 new 191-1 bushings in trim. Installed new center windshield frame and elevators and rudder. Installed 8 new 191-1 bushings in trim. Installed new are spar bolts. Repaired belty skin and panels as need. Installed new are spar bolts. Repaired belty skin and panels as need. Installed new are stached sheets in logs. I	Date: 2/1/2023 N132JW AT602-1156 Complied with annual inspection this date. I certify that this airframe has been inspected I/A/W an annual inspection and was determined to be in an airworthy condition. Patrick Williams IA3645292 FROST FLYING MAINTENANCE, INC. Marianna, AR Phone: (870) 295-3776 Registration: N332JW Model: AT-602 Syn: 602-1156 Installed L/H & R/H wing IAW S.L. 80FF & DWG 20777. L/H S/N: 5190A-49 & R/H: 5199A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Date: 2/19/2024 Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion.		RECORDING	TODAY'S FLIGHT	TOTAL TIME IN	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Retire and Control of the Contr
Complied with annual inspection this date. I certify that this airframe has been inspected I/A/W are annual inspection and was determined to be in an airworthy condition. Patrick Williams IA3645292 Patrick Williams IA3645292	Complied with annual inspection this date. I certify that this airframe has been inspected I/A/W an annual inspection and was determined to be in an airworthy condition. Patrick Williams IA3645292 Patrick Williams IA3645292 FROST FLYING MAINTENANCE, INC. Marianna, AR Phone: (870) 295-3776 Registration: N132/W Model: AT-602 5N: 602-1156 1. Installed I/JR R/H wing IAW S.L. 80F R DWG 20777. I/H 5/N-5190A-49 & R/H-5190A-49 2. Spar- cap safe life is 6500 TTS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 1 new MS14104-4 bearings in elevators and ruider. Installed S new P19-1 bushings in trim. Installed new center windshield frame an elevators and ruider. Installed S new P19-1 bushings in trim. Installed by Frost Flying after spat replacement. Main gear bolts: Repaired belly skin and panels as need. Installed new quadrastat. Starter/gen seators and ruider. Installed oney mature with this date see attached sheets in logs. I	DATE		FLIGHT		Entries must be endorsed with Name, Rating and Certificate Number of Technician or Renair Facility. (See back pages for other specific entries.)
Complied with annual inspection this date. I certify that this airframe has been inspected I/A/W are annual inspection and was determined to be in an airworthy condition. Patrick Williams IA3645292 Patrick Williams IA3645292 Patrick Williams IA3645292 Patrick Williams IA3645292 FROST FLYING MAINTENANCE, INC. Marianna, AR Phone: (870) 295-3776 Registration: N132JW Hobbs: 5467.0 Tition Date: 02/097/0004 1. Installed L/H & R/H wing IAW S.L. 80FF & DWG 20777. L/H 5/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Wan Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blast corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 5 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed 6 new rudder boost tab. Installed are we quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Install englacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rudder boost tab. Installed new air filter. Installed new TIM new rear spar bolts. Repaired belty skin and panels as need. Installed new air filter. Installed new TIM new rear spar bolts. Repaired belty skin and panels as need. Installed new air filter. Installed new TIM.	Complied with annual inspection this date. I certify that this airframe has been inspected I/A/W an annual inspection and was determined to be in an airworthy condition. Patrick Williams IA3645292 Patrick Williams IA3645292 Patrick Williams IA3645292 FROST FLYING MAINTENANCE, INC. Marianna, AR Phone: (870) 295-3776 Registration: N132/W Hobbs: 5467.0 Tit:— Model: AT-602 Syn: 602-1156 Spar-cap safe life is 6500 TTIS. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware, Installed 11 new MS14104-4 bearings in elevators and rudder. Installed S new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed a new rudder boost tab. Installed one wquadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spat new rear spar bolts. Repaired belly skin and panels as need. Installed one wair filter. Installed new III men were spar bolts. Repaired belly skin and panels as need. Installed one wair filter. Installed and Installed new rudder boots retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed one wair filter. Installed new III men repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed one wair filter. Installed new III men repacked. Installed new Yellon in the Part Repaired the Yellon in the Yellon i	-	Date: 2	/1/2023	3	N132JW AT602-1156
Patrick Williams IA3645292 PROST FLYING MAINTENANCE, INC. Marianna, AR Phone: (870) 295-3776 Registration: N132IW Model: A1-602 Syn. 602-1156 1. Installed Lyl-8 R/H wing IAW S.L. 80FF & DWG 20777. Lyh 5/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Date: 2/19/2024 Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection place for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed one yirrost Flying after spareplacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked, Install new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new Y/W repairs see 8130-3 W/O 18809. Wings were installed new affilter. Installed new Y/W repairs see attached sheets in logs. 1	Patrick Williams IA3645292 Registration: N132IW Model: AT-602 SN: 602-1156 I. Installed UH & R/H wing IAW S.L. 80FF & DWG 20777. UH 5/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Date: 2/19/2024 Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tallgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed a new P19-1 bushings in trim. Installed new center windshield frame an R/H curved window. Installed new rudder boost tab. Installed new quadrastst. Stater/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new Y/W new Year Spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new Y/W new Year Spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new Y/W new Y		Compli	ed with	annual in	Hobbs & TT: 6236.0 HRS
Patrick Williams IA3645292 PROST FLYING MAINTENANCE, INC. Marianna, AR Phone: (870) 295-3776 Registration: N132IW Model: A1-602 Syn. 602-1156 1. Installed Lyl-8 R/H wing IAW S.L. 80FF & DWG 20777. Lyh 5/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Date: 2/19/2024 Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection place for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed one yirrost Flying after spareplacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked, Install new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new Y/W repairs see 8130-3 W/O 18809. Wings were installed new affilter. Installed new Y/W repairs see attached sheets in logs. 1	Patrick Williams IA3645292 Registration: N132IW Model: AT-602 SN: 602-1156 I. Installed UH & R/H wing IAW S.L. 80FF & DWG 20777. UH 5/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Date: 2/19/2024 Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tallgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed a new P19-1 bushings in trim. Installed new center windshield frame an R/H curved window. Installed new rudder boost tab. Installed new quadrastst. Stater/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new Y/W new Year Spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new Y/W new Year Spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new Y/W new Y		annual	inspecti	on and wa	as determined to be certify that this airframe has been inspected I/A Nu
Registration: N132IW Model: AT-602 Sh: 602-1156 Sh: 602-1156 Installed I/H & R/H wing IAW S.L. 80F & DWG 20777. I/H s/N: 5190A-49 & R/H: 5190A-49 Spar cap safe life is 6500 TTS. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations A. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date: 2/19/2024 AT602-1156 N132IW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed new center windshield frame at R/H curved window. Installed a new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 813.03 - W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Install new Years spar bolts. Repaired belly skin and panels as need. Installed new winstalled sheets in logs. I	Patton Aircraft Repair Date: 2/19/2024 Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repairsee 813-33 - W/O 18809. Wings were installed by Frost Flying after spair replacement. Main gear botts retorqued per manual. All wheel bearings (leasted in restalled new large). Installed new under panels and replacement. Main gear botts retorqued per manual. All wheel bearings (leasted in restalled new larges) after spair replacement. Main gear botts retorqued per manual. All wheel bearings (leasted in restalled one with response to the replacement. Main gear botts retorqued per manual. All wheel bearings (leasted in restalled one with response to the replacement. Main gear botts retorqued per manual. All wheel bearings (leasted and reinstalled one with several panels as need. Installed new under spairs as 133-3 - W/O 18809. Wings were installed one wiffiler. Installed new filter. Installed new are spair botts. Repaired belly skin and panels as need. Installed new air filter. Installed new are spar botts. Repaired belly skin and panels as need. Installed new air filter. Installed new filter. In	-	100000			and contained.
Registration: N132IW Model: AT-602 S/N: 602-1156 I. Installed L/H & R/H wing IAW S.L. 80F & DWG 20777. L/H S/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date: 2/19/2024 AT602-1156 N132IW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed new center windshield frame at R/H curved window. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new center windshield frame are replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Install new Years spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W, respearched through this date see attached sheets in logs. I	FROST SEVING MAINTENANCE, INC. Marianna, AR Phone: (870) 295-3776 Registration: N132/W Model: AT-602 5/N: 602-1156 1. Installed J/H & R/H wing IAW S.L. 80FF & DWG 20777. L/H 5/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date: 2/19/2024 AT602-1156 N132/W Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new M514104-4 bearings in elevators and rudder. Installed 8 new 1919-1 bushings in trim. Installed new center windshield frame an A/H curved window. Installed 8 new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8133-3 W/O 18809. Wings were installed by Frost Flying after spair replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repaked. Installed new Yudder brough this date see attached sheets in logs. I	-		Patric	k Williams	s 1A3645292 Patul William
Registration: N132/W Model: A1-602 S/N: 602-1156 1. Installed L/H & R/H wing IAW S.L. 80FF & DWG 20777. L/H S/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date: 2/19/2024 AT602-1156 N132/W Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new M514104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed 8 new rudder boost tab. Installed new center windshield frame at replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts.	Registration: N132JW Model: AT-602 S/N: 602-1156 1. Installed L/H & R/H wing IAW S.L. 80FF & DWG 20777. L/H S/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date: 2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new M514104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed one we center windshield frame an R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W n					
Model: AT-602 S/N: 602-1156 1. Installed L/H & R/H wing IAW S.L. 80FF & DWG 20777. L/H S/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Date: 2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed a new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spareplacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as	Model: AT-602 \$/N: 602-1156 1. Installed L/H & R/H wing IAW S.L. 80FF & DWG 20777. L/H \$/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date:2/19/2024 AT602-1156 N132IW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed and reverted and replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new volls wheel bear ings cleaned and repacked. Installed new air filter. Installed new replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new very reasonable to the control of the provided reposts the control of the control of the provided reposts the control of the control of the provided reposts the control of the provided reposts the control of the provided reposts t	-				
S/N: 602-1156 1. Installed L/H & R/H wing IAW S.L. 80FF & DWG 20777. L/H S/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Date: 2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked, install new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new Y-MS researched through this date see attached sheets in logs. I	S/N: 602-1156 1. Installed L/H & R/H wing IAW S.L. 80FF & DWG 20777. L/H S/N: 5190A-49 & R/H: 5190A-49 2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date: 2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame and R/H curved window. Installed 8 new P19-1 bushings in trim. Installed by Frost Flying after spar Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin			UW		
2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date:2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame as R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spare replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Install new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new Creater was in the control of the	2. Spar cap safe life is 6500 TTIS. 3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date: 2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 1 new M541004-4 bearings in elevators and rudder. Installed a new P19-1 bushings in trim. Installed new center windshield frame an elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame an R/H curved window. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame an R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new are filter. Installed new Total Part of through this date see attached sheets in logs. I		5/N: 602-1156			Date: 02/09/2024
All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date:2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at a/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Install new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new T/W new	3. All work was done in accordance with the manufacture's maintenance manuals & current FAA regulations 4. This Aircraft has been approved for return to service for work performed at this time. Signature: Jonathan Brown A&P 3751198 IA Patton Aircraft Repair Date:2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame and R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new filter.					
Patton Aircraft Repair Date: 2/19/2024 AT602-1156 N132JW Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19+1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Install new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts.	Patton Aircraft Repair Date:2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame and R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar replacement. Main gear bolts retorqued per manual. All wheel bearings claemed and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts.	-	3. All wor	k was done	e in accordan	nce with the manufacture's maintenance manuals & current FAA regulations
Patton Aircraft Repair Date:2/19/2024 AT602-1156 N132IW Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed a new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installen new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W in the property of the part of	Patton Aircraft Repair Date:2/19/2024 AT602-1156 N132/W Hobbs & TT: 6467.0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blastes corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder, Installed 8 new P19-1 bushings in trim. Installed new center windshield frame and R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spat replacement. Main gear bolts retorqued per manual, All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter.					
Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear boits retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new T/W new rear spar boits. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar boits. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar boits.	Date:2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467:0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame an R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spair replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W					
Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear boits retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new T/W new rear spar boits. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar boits. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar boits.	Date:2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467:0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame an R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spair replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W					
Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear boits retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new T/W new rear spar boits. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar boits. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar boits.	Date:2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467:0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame an R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spair replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W					
Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear boits retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new T/W new rear spar boits. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar boits. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar boits.	Date:2/19/2024 AT602-1156 N132JW Hobbs & TT: 6467:0 Hrs Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame an R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spair replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W					
Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled 8 new P19-1 bushings in trim. Installed new center windshield frame at elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts.	Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in elevators and rudder. Installed using new hardware. Installed new center windshield frame an elevators and rudder. Installed new P19-1 bushings in trim. Installed new center windshield frame an R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spat replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W					A STATE AND A STAT
Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blasts corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and relevators and rudder. Installed sew P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts.	Performed a 100 Hour inspection in accordance with 14 CFR Part 43 app D and Air Tractor inspection checklist. Removed panels and inspection plates for inspection. Removed tailgear and struts and blaste corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled using new hardware. Installed 11 new MS14104-4 bearings in corrosion. Repainted and reinstalled same P19-1 bushings in trim. Installed new center windshield frame and R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spat replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W					
Van corrosion. Repainted and reinstalled using new hardware. Installed 11 new center windshield frame at elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame at R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spa replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts.	Van corrosion. Repainted and reinstalled using new hardware. Installed 11 New Center windshield frame an elevators and rudder. Installed 8 new P19-1 bushings in trim. Installed new center windshield frame an R/H curved window. Installed new rudder boost tab. Installed new quadrastat. Starter/gen sent to Arkansas Aeronautics for repair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spair replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned and repacked. Installed new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W	or .	pate:2/1	9/2024		AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs
R/H curved window. Installed new rudder boost tab. Installed new quadrates as the value of the proof of the p	R/H curved window. Installed new rudder boost tab. Installed new quadrastet. State 2. State 2	or .	Perform	ed a 100	all and a sale as	AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs ection in accordance with 14 CFR Part 43 app D and Air Tractor inspection and inspection plates for inspection. Removed tailgear and struts and blaste
replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned with the new T/W new rear spar bolts. Repaired belijy skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belijy skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belijy skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belijy skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belijy skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Repaired belijy skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts.	replacement. Main gear bolts retorqued per manual. All wheel bearings cleaned allow T/W new rear spar bolts. Repaired belly skin and panels as need. Installed new air filter. Installed new T/W new rear spar bolts. Apply spare bell through this date see attached sheets in logs. I		Perform checklist corrosio	ed a 100 :. Remove n. Repain	ed panels ar	AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs ection in accordance with 14 CFR Part 43 app D and Air Tractor inspection and inspection plates for inspection. Removed tailgear and struts and blaste installed using new hardware. Installed 11 new MS14104-4 bearings in led 8 new P19-1 husbings in trim. Installed new center windshield frame an
new rear spar bolts. Repaired belly skin and panels as need. Installed liew at the sheets in logs. I	new rear spar bolts. Repaired belly skin and panels as need, installed liew all files. I		Perform checklist corrosio elevator R/H curv	ed a 100 c. Remove n. Repain s and rud yed windo	ed panels a ted and rei lder. Install ow. Installe	AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs action in accordance with 14 CFR Part 43 app D and Air Tractor inspection and inspection plates for inspection. Removed tailgear and struts and blaster installed using new hardware. Installed 11 new MS14104-4 bearings in led 8 new P19-1 bushings in trim. Installed new center windshield frame and ad new rudder boost tab. Installed new quadrastat. Starter/gen sent to
A translad your pay built Aft's researched infough this date see attached sincers	And the Head wave book build Aft's researched infough this date see attached since and		Perform checklist corrosio elevator R/H curv Arkansa	ed a 100 Remove n. Repain s and rud yed windo s Aerona	ed panels and ited and rei ider. Install ow. Installe utics for rep	AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs action in accordance with 14 CFR Part 43 app D and Air Tractor inspection and inspection plates for inspection. Removed tailgear and struts and blaste installed using new hardware. Installed 11 new MS14104-4 bearings in led 8 new P19-1 bushings in trim. Installed new center windshield frame an ed new rudder boost tab. Installed new quadrastat. Starter/gen sent to pair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar
Last askin installed new may may a resembled in event and	lock cable. Installed new hor inspected in accordance with a 100 hour inspection and it was		Perform checklist corrosio elevator R/H curv Arkansa replacer	ed a 100 c. Remove n. Repain s and rud yed windo s Aerona ment. Ma	ed panels as ited and rei ider. Installe ow. Installe utics for rep in gear bolt	AT602-1156 N132JW Hobbs & TT: 6467.0 Hrs action in accordance with 14 CFR Part 43 app D and Air Tractor inspection and inspection plates for inspection. Removed tailgear and struts and blaste installed using new hardware. Installed 11 new MS14104-4 bearings in led 8 new P19-1 bushings in trim. Installed new center windshield frame an ed new rudder boost tab. Installed new quadrastat. Starter/gen sent to pair see 8130-3 W/O 18809. Wings were installed by Frost Flying after spar (Its retorqued per manual. All wheel bearings cleaned and repacked. Installed and helly skin and panels as need. Installed new air filter. Installed new T/W

determined to be in an airworthy condition. Chris S Patton A&P 3473462

09/2024

regulations

			TOTAL	Description of Inspections, Tests, Repairs and Alterations	
90 DA	TACH	TOBAY'S FLIGHT	TIME IN	Entries must be endorsed with Name. Hatting and Lagrangian number of Legislation of	
	Date: 2/15	9/2024		N132JW AT602-1156 Hobbs & TT: 6467.0 Hrs	
	Complied	with an	nual inspec	ction this date. I certify that this airframe has been inspected I/A/W an determined to be in an airworthy condition.	
1			Williams IA	11 5-11 111	
Г -	-1				4
					10. 19
_					
				Self-tribe.	
	- THE	T.T.		St. Right.	
ons		T. T.		Patton Aircraft Repair Hobbs & TT: 6782.0 Hrs	
her of Tachnician or	Date: 2/4/202			AT602-1156 N132JW Hobbs & TT: 6782.0 Hrs	
ons her of Tachnician or 6467.0 Hrs	performed a 1	100 Hou	anels and I	AT602-1156 N132JW Hobbs & TT: 6782.0 Hrs on in accordance with 14 CFR Part 43 app D and Air Tractor inspection inspection plates for inspection. Removed tailgear and struts and blasted inspection plates for inspection.	
6467.0 Hrs	performed a 1 checklist. Ren	100 Hou noved pa	anels and I and reinst	AT602-1156 N132JW Hobbs & TT: 6782.0 Hrs on in accordance with 14 CFR Part 43 app D and Air Tractor inspection inspection plates for inspection. Removed tailgear and struts and blasted inspection plates for inspection. Removed tailgear and struts and blasted iallied using new hardware. Installed new tailspring, new tailwhhel and	
6467.0 Hrs	performed a 2 checklist. Ren corrosion. Re- tire. New T/V	noved painted v axle in	anels and i and reinst stalled. Ins in trim. Sta	AT602-1156 N132JW Hobbs & TT: 6782.0 Hrs on in accordance with 14 CFR Part 43 app D and Air Tractor inspection inspection plates for inspection. Removed tailgear and struts and blasted ialled using new hardware. Installed new tailspring, new tailwhhel and stalled 10 new MS14104-4 bearings in elevators and rudder. Installed 8 arter/gen sent to Air Repair for repair W/O 042592. Installed ne A/C	
6467.0 Hrs	performed a 2 checklist. Ren corrosion. Retire. New T/V new P19-1 bu compressor. new rear spa	noved pa painted V axle in ushings i Main ge	anels and I and reinst stalled. Ins in trim. Sta ar bolts re Repaired b	AT602-1156 N132JW Hobbs & TT: 6782.0 Hrs on in accordance with 14 CFR Part 43 app D and Air Tractor inspection inspection plates for inspection. Removed tailgear and struts and blasted ialled using new hardware. Installed new tailspring, new tailwhhel and stalled 10 new MS14104-4 bearings in elevators and rudder. Installed 8 arter/gen sent to Air Repair for repair W/O 042592. Installed ne A/C arter/gen sent to Air Repair for repair w/O 042592. Installed new A/C arter/gen sent and panels as need. Installed new air filter. Installed new T/W belly skin and panels as need. Installed new air filter. Installed new T/W	
her of Tachnician or	Performed a 2 checklist. Ren corrosion. Re; tire. New T/M new P19-1 bu compressor. new rear spa lock cable. In certify that ti	noved painted of axle incushings in Main geor bolts. It is stalled in this airfra	and reinst stalled. Ins in trim. Sta ar bolts re Repaired b new nay bu ame has be	AT602-1156 N132JW Hobbs & TT: 6782.0 Hrs on in accordance with 14 CFR Part 43 app D and Air Tractor inspection inspection plates for inspection. Removed tailgear and struts and blasted ialled using new hardware. Installed new tailspring, new tailwhhel and stalled 10 new MS14104-4 bearings in elevators and rudder. Installed 8	

		-
Companiu	2/4/2025 N132JW AT602-1156 Hobbs & TT: 6782.01 plied with annual inspection this date. I certify that this airframe has been inspected I/I al inspection and was determined to be in an airworthy condition. Patrick Williams IA3645292	
A COLUMN TO THE PARTY OF THE PA	Serviceable Manufacturer name: 1840. Seizles	
	Manufacturer name:	
0	The component identified above was over the inspected in accordance with current regulations of the Federal Aviation Agency and was found airworthy for return to service. Work order number: 042592 Signed: 4152036	

