

# COUNTAX™

## SERVICE BULLETIN

09-T4-58

DATE: 28/09/09

MODELS CONCERNED: A2050 & A2550 42" HGM Deck


CONCERN: Deck cover is being worn away

---

Heat generated from the belt is melting the deck cover due to the speed the pulley configuration is running at. If a bigger pulley is used this should slow down the speed of the pulley configuration and cause less heat to build up.

Currently the deck is using a 120mm DIA driving pulley (20869600) and a B52 belt (229503200). This needs to be changed to use a 150mm DIA pulley (209044300) and a B54 ½" Belt (22807500).

The Internal belt (BB100 229503500) and the deck cover (148002402) remains the same.

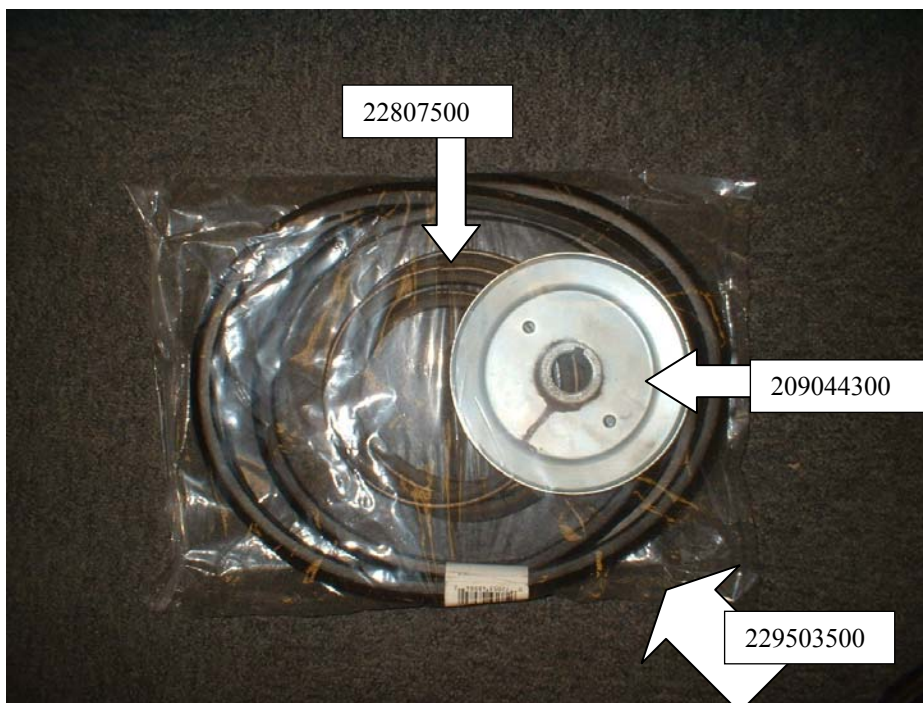

Please contact COUNTAX service department for any further information