

VOLVO CARS SERVICE AND PARTS BUSINESS	
--	---

# Technical Journal

TITLE:  
**Yaw rate sensor, BCM-C006364 or BCM-0121**

<b>REF NO:</b> TJ 28031	<b>ISSUING DEPARTMENT:</b> Technical Service	<b>CAR MARKET:</b> United States and Canada						
<b>PARTNER:</b> 3 US 7510 Volvo Cars North America		<b>ISSUE DATE:</b>						
<b>FUNC GROUP:</b> 5939	<b>FUNC DESC:</b> Miscellaneous	<table border="1"> <tr> <td>YEAR</td> <td>MONTH</td> <td>DAY</td> </tr> <tr> <td>2013</td> <td>07</td> <td>22</td> </tr> </table>	YEAR	MONTH	DAY	2013	07	22
YEAR	MONTH	DAY						
2013	07	22						
Page 1 of 2								

“Right first time in Time”

**Attachment**

**Vehicle Type**

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
275							2006-2014		0224000-0681274	200520-201322

**CSC Customer Symptom Codes**

Code	Description
DY	Warning lights and chimes/Antispin/antiskid (DSA, TRACS, STC, DSTC) indication/no indication
YP	Anti-lock brake system (ABS)/Does not work or engages unexpectedly
PA	Anti-spin function/Does not work
PJ	Stability function/Does not work

**DTC Diagnostic Trouble Codes**

Control Module	Code	Fault Type
BCM	C006364	Intermittent
BCM	0121	Intermittent

**Text**

DSTC = Dynamic Stability and Traction Control

BCM = Brake Control Module

**DESCRIPTION:**

Anti-skid warning lamp with DSTC warning message may be set after a few minutes driving after system start up, with DTC BCM-C006364 or BCM-0121.

The symptoms indicate that there could be a plausibility problem with the alignment of the Steering angle sensor (SAS) or a faulty Wheel alignment, however the DTC could occur if both SAS alignment and wheel alignment are within specifications due to algorithm specifications in BCM software.

**PRODUCT MODIFICATION:**

A new BCM software was released 2013 week 22 in production and is also available to upgrade existing vehicles from model year 2006.

**MATERIAL RETURN:**

No.

**VEHICLE REPORT:**

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report", sub concern area "Support Not Needed", and function group 5939.

**SERVICE:**

Order and download BCM Upgrade software, PN 30677015.

**Volvo Standard Times Guide (VSTG) OPERATION NUMBER:**

36004-2 Software control module downloading      *See VSTG*