

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name Chandler W. Hines / Greenwood Date 3/28/16 Page 1 of 1
 (Please Print)

Inspected From RA To JH ML # 2 WO# **2340378**

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O. #
	From	To				Comp.	Defect			
1.	230 + 90		2	S		J02	D05	R	N	
2.	229 + 00		2	N	1-A	S02	D05	R	N	
3.	228 + 80		2	N	5-B	S02	D05	R	N	
4.										
5.										
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
17.										
18.										
19.										
20.										

Item	COMMENTS
1	standard joint chipped and pitted needs welding
2	stock rail chipped and pitted needs welding
3	stock rail chipped and pitted needs welding

Wesley Chandler
 Trackwalkers Signature

[Signature]
 Supervisory Certification

Work Order	Description	Status	Reported Date
2198166	2 RAJH warp (-2.00 - 8ft) at cm#181+48 (Holland Rep...	INPRG	12/02/15 12:18:55
2014950	2 RAJH Wheel Burns (7) (S) PO 228+50-228+30	APPR	07/22/15 08:17
2017776	2 RAJH Wheel Burns (6) (S) PO 229+90	APPR	07/24/15 11:25:38 AM
2013860	2 RAJH Vegetation Obstructing CM Sign 248	APPR	07/21/15 01:03:40 PM
2087965	2 RAJH Timbers Rotted (28) PO 7A 232+00	APPR	09/16/15 07:44:44 AM
2087968	2 RAJH Timbers Rotted (18) PO 5A 227+50	APPR	09/16/15 07:46:37 AM
2014043	2 RAJH Ties Pumping BH 068+50 - 067+70W	INPRG	07/21/15 03:16:35 PM
2013845	2 RAJH Switch Point/Stock Rail Pumping (S) PO 7B 231+10	APPR	07/21/15 12:52:06 PM
2017781	2 RAJH Switch Point Wheel Burns(4) PO 1A 229+10 - 229+20	APPR	07/24/15 11:33:25 AM
2192028	2 RAJH Switch Point Strap Bolts Missing PO 5B 229+10	APPR	11/27/15 08:02:59 AM
891534	2 RAJH Switch Point Chipped PO 7B 231+00	REVIEW	12/06/12 09:16:59 AM
2013908	2 RAJH Straight Closure Rail Chipped CC 3A	APPR	07/21/15 01:57:44 PM
2014145	2 RAJH Stock Rail Wheel Burns PO 5B 229+00	APPR	07/21/15 05:42:02 PM
2014982	2 RAJH Stock Rail Out of Surface PO 7B 231+00	APPR	07/22/15 06:58:35 AM
2017785	2 RAJH Standard Joint/Stock Rail Battered PO 3A 230+90	APPR	07/24/15 11:37:09 AM
2087904	2 RAJH Rail Wheel Burns 237+85	MONITOR	09/16/15 06:18:24 AM
891815	2 RAJH Rail Side Worn 186 -180+00	REVIEW	12/06/12 02:22:13 PM
2043011	2 RAJH Rail Side Worn (S) (25 Deg) 278+25	MONITOR	08/12/15 07:52:45 AM
2014946	2 RAJH Rail Side Worn (N) (25 Deg) 241+00	APPR	07/22/15 06:13:41 AM
1035100	2 RAJH Rail Side Worn (N) (23 Deg) 280-276+00	REVIEW	04/09/13 03:14:01 PM
2017966	2 RAJH Rail Side Worn (29 Deg) 101 - 086	FAIL	07/24/15 04:49:20 PM
2253600	2 RAJH Rail Chipped (N) / Wet Condition 014+25E	MONITOR	01/15/16 03:15:49 PM
2060146	2 RAJH Rail Base Deteriorated/Corroded 158+65-156+40	MONITOR	08/26/15 11:03:41 AM
2060162	2 RAJH Rail Base Deteriorated/Corroded (S) 150+80-150+50	MONITOR	08/26/15 11:12:56 AM
2043020	2 RAJH RH Stock Rail Side Worn (25 Deg) JH 1A	MONITOR	08/12/15 08:00:41 AM
1147528	2 RAJH RH Stock Rail Wheel Burns PO 1A 229+20	REVIEW	07/11/13 02:12:18 PM
2013792	2 RAJH Mud Condition/Low Joint PO 232+45	HOLD	07/21/15 11:55:32 AM
2017777	2 RAJH LH Switch Point Wheel Burns PO 5B 228+70 - 228+90	APPR	07/24/15 11:29:06 AM
2014923	2 RAJH LH Switch Point Fastener Blocks Loose (4) JH 1A	APPR	07/22/15 05:45:44 AM
2017780	2 RAJH LH Stock Rail Wheel Burns (5) PO 1A 229+10 - 229+30	APPR	07/24/15 11:31:54 AM
2202878	2 RAJH LB Foster Pads Concrete Base Broken 101+90	APPR	12/05/15 06:24:49 AM
2017775	2 RAJH Interlocking Out of Surface PO 231+30-227+40	APPR	07/24/15 11:22:13 AM
2014978	2 RAJH Insulator Cup & Bracket Loose PO 3A 230+85	APPR	07/22/15 06:54:19 AM
2014972	2 RAJH Heel Block Tie Plate Missing PO 3A 230+55	APPR	07/22/15 06:51:34 AM
2013843	2 RAJH Frog Welding PO 3A	INPRG	07/21/15 12:50:31 PM
2013904	2 RAJH Frog Screw Spikes Missing/Frog Wing Battered PO 7B 231+65	APPR	07/21/15 01:54:06 PM
2017793	2 RAJH Frog Point/Riser Battered PO 1A 229	APPR	07/24/15 11:53:56 AM
2014968	2 RAJH Frog Plate Missing PO 3A 230+20	APPR	07/22/15 06:46:43 AM
2034599	2 RAJH Frog Joint Bolt Missing PO 1A 229+75	APPR	08/06/15 05:48:26 AM
2043032	2 RAJH Direct Fixation Pad Deteriorating 224+20-224+10	APPR	08/12/15 08:22:02 AM

2060167	2 RAJH Coverboard Sagging 081+50	APPR	08/26/15 11:30:09 AM
2015097	2 RAJH Coverboard Missing 161+70 -161+40	WMATL	07/22/15 08:10:27 AM
2015095	2 RAJH Coverboard Missing/Bracket Damaged 068+05-067+10	APPR	07/22/15 08:05:17 AM
2015096	2 RAJH Coverboard Missing 068+10 - 068+30E	WMATL	07/22/15 08:07:24 AM
2017792	2 RAJH Concrete Tie Cracked PO 227+40	APPR	07/24/15 11:47:48 AM
2014053	2 RAJH Concrete Pad Pumping 226+70 - 226+60	HOLD	07/21/15 03:26:10 PM
2017784	2 RAJH Closure Rail/Switch Points Wheel Burns PO 3A	APPR	07/24/15 11:35:13 AM
2083378	2 RAJH Clips Broken/Plates & Rail Deteriorated 046E - 050E	INPRG	09/12/15 06:06:00 AM
2014955	2 RAJH 14' Frog Timber Rotted PO 5B 228+40	APPR	07/22/15 06:27:26 AM
2268179	2 RAJH Wheel Burn (S) 142+10	MONITOR	01/30/16 05:25:33 AM
2013793	2 RAJH Water/Trash Condition 030-050+00E	HOLD	07/21/15 11:56:35 AM
2218384	2 RAJH Water Leak (S) 034+00W	APPR	12/17/15 08:13:50 AM
2141689	2 RAJH Vegetation Overgrowth Fouling ML1/2 233+90W	APPR	10/23/15 02:34:18 PM
2017725	2 RAJH Vegetation / Sight Restriction 328 - 328+05	APPR	07/24/15 09:56:38 AM
2202882	2 RAJH Two Block Tie Broken (N) 096+10	APPR	12/05/15 06:38:46 AM
2088344	2 RAJH Tunnel Wall Section Broken 194+20	APPR	09/16/15 02:47:26 PM
2014958	2 RAJH Switch Point Stop Braces Loose PO 5B 228+75	APPR	07/22/15 06:29:11 AM
2110269	2 RAJH Standard Joint Huck Bolts Loose (2) 230+90 PO 3A	APPR	10/01/15 03:49:47 PM
2025642	2 RAJH Running Rail Head Chipped/Pitted/Gouged 100-090	MONITOR	07/31/15 02:24:44 PM
2013890	2 RAJH Running Rail Deteriorated 156+40	APPR	07/21/15 01:44:34 PM
915676	2 RAJH Rail Wheel Burns 233+40	REVIEW	12/28/12 10:48:49 AM
2060151	2 RAJH Rail Wheel Burn/Shelling (S) 153+15	MONITOR	08/26/15 11:07:55 AM
2043307	2 RAJH Rail Sideworn (27-32 Deg) 056E-064E	MONITOR	08/12/15 03:09:32 PM
2041956	2 RAJH Rail Side Worn 260 - 250	MONITOR	08/11/15 03:08:23 PM
2060123	2 RAJH Rail Side Worn (30 Deg) /Top Worn (1/4") 170-165	MONITOR	08/26/15 10:37:16 AM
2060139	2 RAJH Rail Deteriorated / Corroded 165+80165+65	MONITOR	08/26/15 10:47:14 AM
2202885	2 RAJH Rail Corrugation/Pitting (S) 082-071W	MONITOR	12/05/15 07:00:07 AM
2014143	2 RAJH Rail Corroded/Pandrol Clips Broken 193+20-192+70	APPR	07/21/15 05:39:20 PM
2060141	2 RAJH Rail Base Deteriorated/Corroded 164+00-163+15	MONITOR	08/26/15 10:51:52 AM
2060144	2 RAJH Rail Base Deteriorated/Corroded 161+75-161+00	MONITOR	08/26/15 10:56:39 AM
2014146	2 RAJH Pandrol Clips Missing 268 - 236+00	APPR	07/21/15 05:44:02 PM
2268178	2 RAJH Pandrol Clips Broken (3 Consec) 165+80	APPR	01/30/16 05:19:36 AM
2118885	2 RAJH Out of Surface/Pumping 233+90	APPR	10/08/15 08:53:49 AM
2100250	2 RAJH Lord Pads Flexing (Gauge Rod Installed) 055+30E	MONITOR	09/25/15 05:53:11 AM
2100249	2 RAJH Lord Pads Flexing (Gauge Rod Installed) 055+60E	MONITOR	09/25/15 05:37:57 AM
2083372	2 RAJH L/H Stock Rail Wheel Burns PO 7B 231+10	MONITOR	09/12/15 05:46:16 AM
2013895	2 RAJH Insulator Cup Smoking (Wet) 163+20	APPR	07/21/15 01:47:42 PM
1254477	2 RAJH IJ Battered (2) 068+00W	REVIEW	10/15/13 03:03:39 PM
2097064	2 RAJH Heel Block Bolts (2) / Washer Broken (1) PO 5B 228+70	APPR	09/23/15 07:54:48 AM
2110263	2 RAJH Frog Wing Bolt Broken PO 7B 231+50	APPR	10/01/15 03:44:38 PM
2254502	2 RAJH Frog Point Cracked/Chipped JH 3A 067+80E	APPR	01/16/16 01:21:32 PM

2254505	2 RAJH Frog Point Chipped JH 1A 069+25E	APPR	01/16/16 01:29:48 PM
2254506	2 RAJH Frog Bolts Loose (2) JH 1A 069+25E	APPR	01/16/16 01:35:44 PM
2083379	2 RAJH Frog Bolt Loose West Diamond 068+40E	APPR	09/12/15 06:14:20 AM
2268180	2 RAJH East Diamond Frog Point Chipped 068+30E	APPR	01/30/16 05:33:54 AM
2013849	2 RAJH Drain Blocked 072+10W	APPR	07/21/15 12:55:28 PM
2013856	2 RAJH Drain Blocked 110-108	APPR	07/21/15 01:00:51 PM
2013791	2 RAJH Crosswalk Missing BH 3A 069+00W	HOLD	07/21/15 11:54:12 AM
2013781	2 RAJH Crosswalk Board Missing 272+10	HOLD	07/21/15 11:48:15 AM
1673460	2 RAJH Coverbrd Missng 20' JH 1A 068+10E	APPR	10/15/14 01:01:48 PM
2060168	2 RAJH Coverboard Sagging/Burnt/Arcing 079+10	APPR	08/26/15 11:35:16 AM
2013861	2 RAJH Coverboard Sagging 208+50	APPR	07/21/15 01:03:49 PM
2013854	2 RAJH Coverboard Sagging 080+20W	APPR	07/21/15 12:59:01 PM
2013863	2 RAJH Coverboard Sagging 307+50	APPR	07/21/15 01:05:29 PM
2013887	2 RAJH Coverboard Sagging 093+00	APPR	07/21/15 01:38:10 PM
2015109	2 RAJH Coverboard Missing 158+10 - 157+60	WMATL	07/22/15 08:34:22 AM
2015103	2 RAJH Coverboard Missing 056+50 - 056+75E	WMATL	07/22/15 08:21:51 AM
2015099	2 RAJH Coverboard Bracket Broken/Hardware Missing 102+7	APPR	07/22/15 08:12:50 AM
	0		
2202890	2 RAJH Concrete Deteriorating 068+60-067W	APPR	12/05/15 07:11:15 AM
2083374	2 RAJH Adjustable Brace Missing PO 3A 230+85	APPR	09/12/15 05:54:43 AM
2063554	2 RAJH 3rd Rail Metal Bracket Broken/Bent 221+35	APPR	08/29/15 09:53:10 AM
2062903	2 RAJH 3rd Rail End Approach Joint Burnt/Arcing 221+45	APPR	08/28/15 06:20:49 PM
2013775	2 RAJH IJ Out of Crosslevel / Pumping / Mud PO 227+40	HOLD	07/21/15 11:43:50 AM
1025983	2 RAJH	CAN	04/01/13 03:10:15 PM

Work Order Tracking (Tr)

Bull

Find Work Order



Select Action



List

Work Order

Plans

Actuals

Activities

Measurements

Axle Configuration

Related Records

Safety Plan

Log

Work Order: 2340402 (1JH-RA) METRO MOW WEEKLY TRACK INSPECTION W/

Classification: MTA \ METRO >>

Classification Description: MTA - METRO

Asset: >> [icon]

Alias:

Location: CHAIN_MARK >> Metro Chain Markers [icon]

Work Location: >> [icon]

Work Type: PM [icon]

Status: WSCH

Status Date: 03/25/16 04:15:57 AM

Reported By: MTACRON >>

Phone:

Reported Date: 03/25/16 04:15:58 AM [icon]

On Behalf Of: >>

Consist: >> [icon]

Asset Details

Year:

Manufacturer: >> [icon]

Model: [icon]

Serial #:

Type: [icon]

Status:

Asset Condition:

Address Information

Service Address: >> [icon]

City:

Formatted Address: State/Province:

WEEKLY TRACK WALKING INSPECTION REPORTING FORM

Name Greenwood Thomas

Date 03/29/15

Page 1 of 1

(Please Print)

Inspected From JH To RA ML # 1 WO# 2340402

Item	Exception Chain Marker No.		Track No.	Rail N/S	Switch No.	Codes		Status S/Y/R	Repair Y/N	W. O. #
	From	To				Comp.	Defect			
1.			2	N	3B	S04	D05	Y		
2.	007+10W		2			C03	D21	Y		
3.	158+00	158+60	2			C03	D21	Y		
4.	238+00	268+00				S01	D11	Y		
5.	069+30			N	1B	S04	D05	Y		
6.										
7.										
8.										
9.										
10.										
11.										
12.										
13.										
14.										
15.										
17.										
18.										
19.										
20.										

Item COMMENTS

1	Switch point Chipped CLBB
2	Cover board missing 10 feet
3	cover board missing
4	LB faster Pads deteriorating
5	Switch point chipped BH-1B

Thomas Greenwood
Trackwalkers Signature


Supervisory Certification

2080337	1 JHRA 3rd Rail Severely Corroded 068+70 - 068+90	APPR	09/10/15 07:56:55 AM
2061165	1 JHRA Coverboard Missing 184-186	WMATL	08/27/15 07:52:38 AM
2077038	1 JHRA #3 Switch Rod Striking Timber PO 1B 230+70	APPR	09/08/15 03:56:49 PM
2080383	1 JHRA Insulated Tie Plate Missing 230+15	APPR	09/10/15 08:08:32 AM
2030720	1 JHRA IJ Battered BH 1B 069+35W	APPR	08/03/15 06:40:43 AM
2014045	1 JHRA Interlocking Out of Surface PO 228-232+00	HOLD	07/21/15 03:19:37 PM
2030726	1 JHRA RH Stock Rail Wheel Burns PO 1B 230+90	MONITOR	08/03/15 06:47:19 AM
2030747	1 JHRA Rail Side Worn (22 Deg) 274+00	MONITOR	08/03/15 06:59:44 AM
1042501	1 JHRA Rail Side Worn (N) (26-28 deg) 248 - 256+00	REVIEW	04/16/13 03:18:04 PM
2015378	1 JHRA Rail Web/Base Deteriorated (S) 141+00	APPR	07/22/15 02:44:48 PM
2089704	1 JHRA Stock Rail Wheel Burns/Top Worn/Chipped PO 3B 229+10	MONITOR	09/17/15 07:50:57 AM
2013893	1 JHRA Running Rail Wheel Burns (N/S) 234+90	APPR	07/21/15 01:46:12 PM
2106039	1 JHRA 4 Gauge Rods / 2 Block Ties 071W - 071+15	MONITOR	09/30/15 06:34:11 AM
2106077	1 JHRA Rail Corrugation/Pitted/Gouged (S) 053W-059W	MONITOR	09/30/15 07:21:19 AM
2194899	1 JHRA Expansion Joint Burnt / Arching 305+80	INPRG	12/01/15 04:03:10 AM
2204233	1 JHRA Warp (-1.83"-13') cm#330+41 (Holland Report) URGENT	MONITOR	12/07/15 05:32:08 AM
2204238	1 JHRA Warp (-1.96"-37') cm#330+13 (Holland Report) URGENT	MONITOR	12/07/15 05:42:50 AM
2204242	1 JHRA Warp (-1.94"-26') cm#231+07 (Holland Report) URGENT	MONITOR	12/07/15 05:49:24 AM
2204247	1 JHRA Warp (-2.13"-24') cm#230+74 (Holland Report) URGENT	MONITOR	12/07/15 06:03:04 AM
2204253	1 JHRA Unbl. (25.38 - 938') cm#018+87 (Holland Report) URGENT	MONITOR	12/07/15 06:42:41 AM
2204266	1 JHRA Vmax. (40.71-938') cm#019+09 (Holland Report) URGENT	MONITOR	12/07/15 06:53:10 AM
2205671	1 JHRA Two Block Tie Broken 018+25W	COMP	12/08/15 06:54:55 AM
2208897	1 JHRA Chain Marker Sign 160NW Loose/Hanging	APPR	12/10/15 04:02:28 PM
2208896	1 JHRA Two Block Tie Broken 158+40W	APPR	12/10/15 03:58:16 PM
2106032	1 JHRA Defective Lord Pads / Gauge Rods Installed 062E - 057E	MONITOR	09/30/15 06:13:49 AM
2212343	1 JHRA Pandrol Clips Broken/Deteriorating 160W-170W	APPR	12/12/15 07:36:37 AM
2058584	1 JHRA Track Bolt Loose/ Worn (Replace) 229+80	APPR	08/25/15 06:40:59 AM
2220227	1 JHRA Rail Wheel Burn 229+90	MONITOR	12/18/15 11:19:01 AM
2212359	1 JHRA Rail Side Worn 3/8" (30 Deg) 211 - 227	MONITOR	12/12/15 08:11:20 AM
2220221	1 JHRA Closure Rail Wheel Burns (4) PO 3B 229+40	MONITOR	12/18/15 11:06:09 AM
2220224	1 JHRA Standard Joint / Frog Heel Wing Rail Chipped 229+85 PO 3	MONITOR	12/18/15 11:11:21 AM
	B		
2212324	1 JHRA Rail Base Corroded (N) 045+70-046+30	MONITOR	12/12/15 07:15:13 AM
2212327	1 JHRA Rail Head Pitted (S) 070W - 081W	MONITOR	12/12/15 07:19:51 AM
2212336	1 JHRA Rail Side Worn (Tangent) 084+10 - 084+30	MONITOR	12/12/15 07:25:20 AM
2212341	1 JHRA Rail Corrugation 089+00 - 089+20	MONITOR	12/12/15 07:29:55 AM
2212351	1 JHRA Rail Side Worn 3/8" (23 Deg) 163 - 171	MONITOR	12/12/15 07:44:51 AM
2212357	1 JHRA Rail Head Pitted (N) 163 - 171	MONITOR	12/12/15 07:58:26 AM
2212358	1 JHRA Rail Head Pitted (N) 181 - 186	MONITOR	12/12/15 08:06:50 AM
2208898	1 JHRA Rail Pitted / Water Condition 160+60W	MONITOR	12/10/15 04:07:28 PM
2212310	1 JHRA Rail Corroded (N) 037+20	MONITOR	12/12/15 07:08:21 AM
2043305	1 JHRA Two Block Tie Deteriorating (N) 013+85W	INPRG	08/12/15 03:07:39 PM

Work Order	Description	Status	Reported Date
2053299	1 JHRA RH Switch Point Chipped / Pitted CC 3B	MONITOR	08/20/15 07:55:47 AM
2053301	1 JHRA LH Switch Point Chipped / Pitted CC 3B	MONITOR	08/20/15 07:59:08 AM
2015114	1 JHRA Coverboard Missing (70') 162-162+50 &162+70-162+90	WMATL	07/22/15 08:42:01 AM
2013812	1 JHRA Fastener Pad Cracked/Broken (6) 018+60W	HOLD	07/21/15 12:10:23 PM
2087957	1 JHRA Two Block Tie Broken/Unsupported 013+60W	COMP	09/16/15 07:38:35 AM
2087964	1 JHRA Running Rail Deteriorated (S) 154 -165	MONITOR	09/16/15 07:42:56 AM
2106086	1 JHRA Drain Clogged/Fouled (600') 053W-059W	APPR	09/30/15 07:26:22 AM
2106102	1 JHRA Coverboard Bracket Broken 107+15	APPR	09/30/15 07:30:42 AM
2106107	1 JHRA Station Concrete Wall/Ceiling Cracked 107+80	MONITOR	09/30/15 07:33:39 AM
2106112	1 JHRA 3rd Rail Unseated/Out of Insulator Cups 148+00	APPR	09/30/15 07:38:06 AM
2106121	1 JHRA Rail Web/Base Corroded (N) 151+50	MONITOR	09/30/15 07:47:48 AM
2106126	1 JHRA Rail Web/Base Corroded (N) 154-165	APPR	09/30/15 07:51:23 AM
2106133	1 JHRA Two Block Tie Broken 157+30	APPR	09/30/15 07:57:51 AM
2106138	1 JHRA Two Block Tie Broken 161+25	APPR	09/30/15 08:01:21 AM
1036885	1 JHRA Tunnel Leak CC 3B 005 NW	MONITOR	04/11/13 07:58:55 AM
2015112	1 JHRA Coverboard Missing 10' CC 007+10W	WMATL	07/22/15 08:38:35 AM
2013741	1 JHRA Shim Plate Loose 237+50	APPR	07/21/15 11:01:27 AM
2013746	1 JHRA Saddles Loose (5) Pandrols Missing PO1B	APPR	07/21/15 11:07:57 AM
2013748	1 JHRA Running Rail Wheel Burns (N) 230+00	APPR	07/21/15 11:15:10 AM
2013865	1 JHRA Restraining Rail IJ Bolts Loose 067+70E	APPR	07/21/15 01:07:32 PM
2014064	1 JHRA Coverboard Brackets Bent 267+50 - 272	APPR	07/21/15 03:40:25 PM
2014921	1 JHRA Insulator Cup Burnt (4) 140+70 -140+90	APPR	07/22/15 05:41:56 AM
2015100	1 JHRA Coverboard Broken / Bracket Missing 036+65E	APPR	07/22/15 08:15:11 AM
2015101	1 JHRA Coverboard Brackets Missing 194+90 & 195+25	APPR	07/22/15 08:17:16 AM
2015102	1 JHRA Coverboard Missing (60') 158 -158+60	WMATL	07/22/15 08:19:25 AM
2015104	1 JHRA Coverboard Missing 069+10E - 068+40E	WMATL	07/22/15 08:28:23 AM
2015107	1 JHRA Coverboard Missing (60') 078W	WMATL	07/22/15 08:31:45 AM
2015388	1 JHRA 3rd Rail Corroded 141+00	APPR	07/22/15 02:54:07 PM
2017678	1 JHRA Adjustable Brace Plate Missing 229+70 PO-3B	APPR	07/24/15 08:18:26 AM
2017699	1 JHRA 3rd Rail Side Approach Hardware Missing CC 1B 007+50	APPR	07/24/15 09:01:09 AM
2017722	1 JHRA LB Foster Plates Deteriorating 238 - 268	APPR	07/24/15 09:46:52 AM
2017696	1 JHRA Guard Rail Screw Spikes Missing PO 3B	APPR	07/24/15 08:54:29 AM
2017716	1 JHRA Guard Rail Screw Spikes Missing PO 1B	APPR	07/24/15 09:34:45 AM
2017718	1 JHRA Insulated Joint Chipped (S) 230+90	MONITOR	07/24/15 09:41:36 AM
2013896	1 JHRA Gage Tight (56 3/8") 236 - 242+00	APPR	07/21/15 01:49:09 PM
2021953	1 JHRA LB Foster Anchor Bolts Loose 235-332	APPR	07/28/15 10:15:42 AM
2030698	1 JHRA IJ Battered BH-3B 066+80W	MONITOR	08/03/15 06:16:38 AM
2030709	1 JHRA Switch Point Chipped BH-1B 069+30W	MONITOR	08/03/15 06:34:06 AM
2030745	1 JHRA Shim Plate Missing 248+10W	APPR	08/03/15 06:55:13 AM
2041954	1 JHRA RH Switch Point Wheel Burns PO 3B 229	MONITOR	08/11/15 03:06:34 PM
2043013	1 JHRA Rail Corrugation (N) 202 - 214+00	MONITOR	08/12/15 07:55:00 AM
2051473	1 JHRA 3rd Rail Deteriorated 158 -166+00	MONITOR	08/19/15 07:34:44 AM
2033296	1 JHRA Curve Closure Rail Chipped 067+60E JH 1B	MONITOR	08/05/15 03:16:44 PM
2058572	1 JHRA Front Rod Nut Loose PO 3B 229+00	APPR	08/25/15 06:33:08 AM
2059899	1 JHRA Frog Riser Cracked JH 3B	APPR	08/26/15 05:42:36 AM
2050074	1 JHRA Frog Point/Riser Worn PO 1B	APPR	08/18/15 04:32:57 AM

2043299	1 JHRA Two Block Tie Deteriorating (N) 015+75W	INPRG	08/12/15 03:03:16 PM
2220233	1 JHRA Closure Rail Battered/Wheel Burns (2) PO 1B 230+55	MONITOR	12/18/15 11:35:22 AM
2245860	1 JHRA LH Switch Point Worn PO 1B 230+80	MONITOR	01/08/16 09:43:10 AM
2246787	1 JHRA Front Rod Nut Loose PO 1B 230+80	APPR	01/09/16 07:22:51 AM
2274510	1 JHRA Two Heel Block Bolts Loose BH 1B 069+00W	COMP	02/03/16 03:07:18 PM