



[4910-13-P]

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA-2013-0463; Directorate Identifier 2012-NM-165-AD; Amendment 39-17584; AD 2013-19-02]**

**RIN 2120-AA64**

**Airworthiness Directives; Airbus Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Airbus Model A330-200, -200 Freighter, and -300 series airplanes. This AD was prompted by a report that a certain wire harness located in the tail cone has wiring of a narrower gauge than design requires. This AD requires replacing the affected wire harness. We are issuing this AD to prevent damage to the affected wiring, which could create an ignition source in an area that might contain fuel vapors, possibly resulting in an uncontrolled fire and subsequent loss of the airplane.

**DATES:** This AD becomes effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC.

For service information identified in this AD, contact Airbus SAS – Airworthiness Office – EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**FOR FURTHER INFORMATION CONTACT:** Vladimir Ulyanov, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: (425) 227-1138; fax: (425) 227-1149.

**SUPPLEMENTARY INFORMATION:**

**Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. The NPRM published in the Federal Register on June 21, 2013 (78 FR 37498). The NPRM proposed to correct an unsafe condition for the specified products.

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2012-0182, dated September 11, 2012 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

On a production aeroplane, it has been discovered that wires in harness 5877VB, installed in the Tail Cone (Section 19.1) and connected to the Auxiliary Power Unit starter, have a section smaller [narrower] than required by design. Section 19 is a flammable fluid leakage zone, adjacent to a fuel tank (trim tank) and is open with Section 19.1. The results of the investigation show that this issue is a manufacturing quality issue. Airbus identified a list of other aeroplanes that are affected.

This condition, if not corrected, could damage the wiring which may create an ignition source in an area that may contain fuel vapours, possibly resulting in an uncontrolled fire and subsequent loss of the aeroplane.

\* \* \* \* \*

For the reasons described above, this [EASA] AD requires the replacement of the affected wiring harness.

You may obtain further information by examining the MCAI in the AD docket.

### **Comments**

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM (78 FR 37498, June 21, 2013) or on the determination of the cost to the public.

## **Conclusion**

We reviewed the available data and determined that air safety and the public interest require adopting this AD as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (78 FR 37498, June 21, 2013) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (78 FR 37498, June 21, 2013).

## **Costs of Compliance**

Based on the service information, we estimate that this AD affects about 1 product of U.S. registry. We also estimate that it will take about 4 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Required parts will cost about \$2,920 per product. Where the service information lists required parts costs that are covered under warranty, we have assumed that there will be no charge for these parts. As we do not control warranty coverage for affected parties, some parties may incur costs higher than estimated here. Based on these figures, we estimate the cost of this AD on U.S. operators to be \$3,260, or \$3,260 per product.

## **Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator.

“Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### **Regulatory Findings**

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

### **Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the MCAI, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the ADDRESSES section.

### **List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### **Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### **PART 39 - AIRWORTHINESS DIRECTIVES**

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

### **§ 39.13 [Amended]**

2. The FAA amends § 39.13 by adding the following new AD:

**2013-19-02 Airbus:** Amendment 39-17584. Docket No. FAA-2013-0463; Directorate Identifier 2012-NM-165-AD.

**(a) Effective Date**

This airworthiness directive (AD) becomes effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Airbus Model A330-201, -202, -203, -223, -223F, -243 -243F, -301, -302, -303, -321, -322, -323, -341, -342, and -343 airplanes; certificated in any category; manufacturer serial numbers 1070, 1127, 1133, 1135, 1137, 1138, 1141, 1143, 1145, 1146, 1147, 1149, 1150, 1151, 1153, 1155, 1156, 1157, 1159, 1160, 1161, 1165, 1167, 1168, 1169, 1171, 1172, 1173, 1174, 1177, 1178, 1181, 1183, 1184, 1186, 1187, 1188, 1189, 1191, 1195, 1196, and 1202.

**(d) Subject**

Air Transport Association (ATA) of America Code 92.

**(e) Reason**

This AD was prompted by a report that a certain wire harness located in the tail cone has wiring of a narrower gauge than design requires. We are issuing this AD to prevent damage to the affected wiring, which could create an ignition source in an area that might contain fuel vapors, possibly resulting in an uncontrolled fire and subsequent loss of the airplane.

**(f) Compliance**

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**(g) Actions**

Within 24 months after the effective date of this AD: Replace wiring harness 5877VB located in section 19.1, Frame 91 to Frame 96, in accordance with the Accomplishment Instructions of Airbus Mandatory Service Bulletin A330-92-3116, dated April 25, 2012.

**(h) Other FAA AD Provisions**

The following provisions also apply to this AD:

**(1) Alternative Methods of Compliance (AMOCs):** The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Vladimir Ulyanov, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: (425) 227-1138; fax: (425) 227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

**(2) Airworthy Product:** For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

**(i) Related Information**

Refer to Mandatory Continuing Airworthiness Information European Aviation Safety Agency Airworthiness Directive 2012-0182, dated September 11, 2012, for related information, which can be found in the AD docket on the Internet at <http://www.regulations.gov>.

**(j) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Airbus Mandatory Service Bulletin A330-92-3116, dated April 25, 2012

(ii) Reserved.

(3) For service information identified in this AD, contact Airbus SAS – Airworthiness Office – EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>.

(4) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to:

<http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on September 9, 2013.

Jeffrey E. Duven,  
Acting Manager,  
Transport Airplane Directorate,  
Aircraft Certification Service.

[FR Doc. 2013-22542 Filed 09/19/2013 at 8:45 am; Publication Date: 09/20/2013]