



This document is scheduled to be published in the
Federal Register on 07/24/2020 and available online at
[federalregister.gov/d/2020-16042](https://www.federalregister.gov/d/2020-16042), and on [govinfo.gov](https://www.govinfo.gov)

[4910-13-P]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2020-0729; Project Identifier AD-2020-00620-E]

RIN 2120-AA64

Airworthiness Directives; CFM International, S.A. Turbofan Engines

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain CFM International, S.A. (CFM) LEAP-1A23, LEAP-1A24, LEAP-1A24E1, LEAP-1A26, LEAP-1A26CJ, LEAP-1A26E1, LEAP-1A29, LEAP-1A29CJ, LEAP-1A30, LEAP-1A32, LEAP-1A33, LEAP-1A33B2, LEAP-1A35A model turbofan engines. This proposed AD was prompted by an investigation by CFM that showed a subsurface anomaly in a part manufactured using the same material as the LEAP-1A high-pressure turbine (HPT) stage 2 disk. This proposed AD would require an ultrasonic inspection (UI) of the HPT stage 2 disk and replacement of any HPT stage 2 disk that fails the UI with a part eligible for installation. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- Fax: 202-493-2251.

- Mail: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- Hand Delivery: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact CFM International, S.A., Aviation Operations Center, 1 Neumann Way, M/D Room 285, Cincinnati, OH, 45125, United States; phone: (877) 432-3272; email: fleetsupport@ge.com. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA, 01803. For information on the availability of this material at the FAA, call 781-238-7759.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0729; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Christopher McGuire, Aerospace Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA, 01803; phone: (781) 238-7120; fax: (781) 238-7199; email: Chris.McGuire@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the ADDRESSES section. Include "Docket No. FAA-2020-0729; Project Identifier AD-2020-00620-E" at the

beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this NPRM because of those comments.

Except for Confidential Business Information as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this proposal.

Confidential Business Information

Confidential Business Information (CBI) is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Christopher McGuire, Aerospace Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA, 01803. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA learned that during a broad investigation by CFM into melt-related material anomalies, a subsurface anomaly was found in a part manufactured from the

same material used to manufacture the LEAP-1A HPT stage 2 disk. This condition, if not addressed, could result in failure of the HPT stage 2 disk, uncontained release of the HPT stage 2 disk, damage to the engine, and damage to the airplane.

FAA's Determination

The FAA is issuing this NPRM because the agency has determined that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Service Information Incorporated by Reference under 1 CFR part 51

The FAA reviewed CFM Service Bulletin (SB) LEAP-1A-72-00-0405-01A-930A-D, Issue 001, dated March 5, 2020. The SB describes procedures for performing an ultrasonic inspection of the HPT stage 2 disk. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

Proposed AD Requirements

This proposed AD would require a UI of the HPT stage 2 disk and replacement of any HPT stage 2 disk that fails the inspection with a part eligible for installation.

Costs of Compliance

The FAA estimates that this AD, as proposed, would affect 148 engines installed on airplanes of U.S. registry.

The FAA estimates the following costs to comply with this proposed AD:

Estimated costs

Action	Labor Cost	Parts Cost	Cost per product	Cost on U.S. operators
UI of HPT stage 2 disk	8 work-hours x \$85 per hour = \$680	\$0	\$680	\$100,640

The FAA estimates the following costs to do any necessary replacements that would be required based on the results of the proposed inspection. The FAA has no way of determining the number of aircraft that might need these replacements:

On-condition costs

Action	Labor Cost	Parts Cost	Cost per product
Replace HPT stage 2 disk	0.25 work-hours x \$85.00 per hour = \$21.25	\$286,000	\$286,021.25

Authority for this Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

CFM International, S.A.: Docket No. FAA-2020-0729; Project Identifier AD-2020-00620-E.

(a) Comments Due Date

The FAA must receive comments by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE Federal Register].

(b) Affected ADs

None.

(c) Applicability

This AD applies to CFM International, S.A. (CFM) LEAP-1A23, LEAP-1A24, LEAP-1A24E1, LEAP-1A26, LEAP-1A26CJ, LEAP-1A26E1, LEAP-1A29, LEAP-1A29CJ, LEAP-1A30, LEAP-1A32, LEAP-1A33, LEAP-1A33B2, LEAP-1A35A model

turbofan engines with a high-pressure turbine (HPT) stage 2 disk, part number (P/N) 2466M52G03 or P/N 2788M26G01 installed, and with a serial number listed in Table 1 of CFM Service Bulletin (SB) LEAP-1A-72-00-0405-01A-930A-D, Issue 001, dated March 5, 2020.

(d) Subject

Joint Aircraft System Component (JASC) Code 7250, Turbine Section.

(e) Unsafe Condition

This AD was prompted by an investigation by CFM that discovered a subsurface anomaly in a part manufactured from the same material as used to manufacture the LEAP-1A HPT stage 2 disk. The FAA is issuing this AD to prevent failure of the LEAP-1A HPT stage 2 disk. The unsafe condition, if not addressed, could result in uncontained release of the HPT stage 2 disk, damage to the engine, and damage to the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

(1) At next piece part exposure after the effective date of this AD, perform an ultrasonic inspection of the HPT stage 2 disk in accordance with the Accomplishment Instructions, paragraph 5.A.(1), of CFM SB LEAP-1A-72-00-0405-01A-930A-D, Issue 001, dated March 5, 2020.

(2) Replace any disk that fails the inspection required by paragraph (g)(1) of this AD with a part eligible for installation.

(h) Definition

For the purpose of this AD, a part eligible for installation is a HPT stage 2 disk not affected by this AD, or an HPT stage 2 disk that has been inspected in accordance with the Accomplishment Instructions, paragraph 5.A.(1), of CFM SB LEAP-1A-72-00-

0405-01A-930A-D, Issue 001, dated March 5, 2020, and is not rejected by the inspection limits as specified in the service information.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, ECO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. You may email your request to: ANE-AD-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(j) Related Information

(1) For more information about this AD, contact Christopher McGuire, Aerospace Engineer, ECO Branch, FAA, 1200 District Avenue, Burlington, MA, 01803; phone: (781) 238-7120; fax: (781) 238-7199; email: Chris.McGuire@faa.gov.

(2) For service information identified in this AD, contact CFM International, S.A., Aviation Operations Center, 1 Neumann Way, M/D Room 285, Cincinnati, OH, 45125, United States; phone: (877) 432-3272; email: fleetsupport@ge.com. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 1200 District Avenue, Burlington, MA, 01803. For information on the availability of this material at the FAA, call 781-238-7759.

Issued on July 21, 2020.

Gaetano A. Sciortino, Deputy Director for Strategic Initiatives,
Compliance & Airworthiness Division,
Aircraft Certification Service.

[FR Doc. 2020-16042 Filed: 7/23/2020 8:45 am; Publication Date: 7/24/2020]