

<p style="text-align: center;">SHEET 15 LTPP TRAFFIC DATA</p> <p style="text-align: center;">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	<p>*STATE ASSIGNED ID [P15]</p> <p>*STATE CODE [53]</p> <p>*SHRP SECTION ID [3013/1008]</p>
---	---

LOCATION SR 195 TYPE EQUIP. Piezo (Class 1)

MP # 87.7 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
12/27/11		<p>12/27/11 P15 Spangle Problem: Intermittent "unequal axle detected" SB drive lane; starting on the 17th. Called site to monitor traffic, but didn't find any problem (see attached.) (HN)</p>	Hoang		

10/21/11		<p>Woman leads police on high-speed chase, crashes in Spokane County Posted on October 21, 2011 at 8:59 AM SPOKANE COUNTY-- A woman was arrested on felony charges for leading police on a high-speed chase on Highway 195. It began in Whitman County Friday morning just after 7:00 a.m. The Washington State Patrol says officials tried to pull over the woman because she was speeding and her license plate was falling off the front of the car. The woman reportedly refused to stop, and led police on the chase. Officials say she reached speeds of up to 100 mph. The chase lasted about 30 minutes before authorities decided to force the woman from the road. Police put down spike strips at Spangle Road, but that didn't stop the driver. Eventually, troopers said they used a pit maneuver to end the chase. Officials rear-ended the woman, causing her car to spin off the highway and into a ditch. The chase came to an end just south of Hatch Rd (mp 91) in Spokane County. The woman was not injured. She told WSP she did not want to be pulled over, mostly because the car belongs to a relative. She was arrested on a felony charge for eluding officers, and faces assault charges for hitting an officer's car. Lanes in both directions were closed, but have since reopened. (Tom)</p>			

800.12-4-8.12

<p align="center">SHEET 15 LTPP TRAFFIC DATA</p> <p align="center">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	*STATE ASSIGNED ID	[P15]
	*STATE CODE	[53]
	*SHRP SECTION ID	[3013/1008]

LOCATION SR 195 TYPE EQUIP. Piezo (Class 1)

MP # 87.7 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
9/22/11		9/22/11 Spangle – P15 Problem: DMA not synchronized with A/D card....again. Did "system shutdown". Okay for now. Will need to make a site visit to fix the problem. (HN) Note***: looks like it started 9/20/11 (Tom)	Hoang		
9/27/11		9/27/11 Spokane-P15 "DMA not synchronized with A/D card". Replaced A/D chip set. (HN)	Hoang		

800.12.11.8.12

SHEET 15 LTPP TRAFFIC DATA LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM	*STATE ASSIGNED ID	[P15]
	*STATE CODE	[53]
	*SHRP SECTION ID	[3013/1008]

LOCATION SR 195 TYPE EQUIP. Piezo (Class 1)

MP # 87.7 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
8/29/11		SITE VISIT -- Hoang -- Problem: DMA not synchronized with A/D card (bad data starting on the 19 th). Did system shutdown. Site is collecting normal for now!	Hoang		
8/15/11		Brush fire in vicinity of site location			

<p style="text-align: center;">SHEET 15 LTPP TRAFFIC DATA</p> <p style="text-align: center;">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	<p>*STATE ASSIGNED ID [P15]</p> <p>*STATE CODE [53]</p> <p>*SHRP SECTION ID [3013/1008]</p>
---	---

LOCATION SR 195 TYPE EQUIP. Piezo (Class 1)

MP # 87.7 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
6/30/11		No Changes			
6/5/11		<p>250 Spangle neighbors without power Posted on June 5, 2011 at 8:09 PM SPANGLE, Wash. -- About 250 Avista customers are without power in Spangle, Washington. Neighbors reported their lights went out just before 6:00 p.m. Sunday. According to a company spokesperson, the cause of the outage is still under investigation. Workers are patrolling the line to figure out where the problem happened. Avista said until they find it, they are not sure when the power will be restored. (Tom)</p>			

<p style="text-align: center;">SHEET 15 LTPP TRAFFIC DATA LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	<p>*STATE ASSIGNED ID [P15]</p> <p>*STATE CODE [53]</p> <p>*SHRP SECTION ID [3013/1008]</p>
--	---

LOCATION SR 195 TYPE EQUIP. Piezo (Class 1)

MP # 87.7 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
		<p>5/10/11 Spanagle-P15 Site inspected. Copied log and parameter files. Sensor #2 needs patching. Homerun conduit SB needs to be replaced. Might have to run new single pairs and coax cable for NB loops #3 and #4, and piezos. (HN)</p>			

[illegible]

<p style="text-align: center;">SHEET 15</p> <p style="text-align: center;">LTPP TRAFFIC DATA</p> <p style="text-align: center;">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	*STATE ASSIGNED ID	[P15]
	*STATE CODE	[53]
	*SHRP SECTION ID	[3013/1008]

LOCATION SR 195 TYPE EQUIP. Piezo (Class 1)

MP # 87.7 MODEL # IRD 1060

[illegible]

<p align="center">SHEET 15 LTPP TRAFFIC DATA</p> <p align="center">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	*STATE ASSIGNED ID	[P15]
	*STATE CODE	[53]
	*SHRP SECTION ID	[3013/1008]

File: 802.12.118.12

LOCATION SR 195 TYPE EQUIP. Piezo (Class 1)

MP # 87.7 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
2/28/11		No Changes			
2/7/11		PROCESSED MANUAL COUNT -- Weighted vol = 1.86%, 1.40% , 0.45% -- NB overcounting class 5, 7, 8, 9, 13 -- undercounting 2-3, 6, 10 -- SB overcounting class 5, 8, -- undercounting 2-3, 6,			
2/11/11		Semi-truck rollover spews paper across highway Posted on February 11, 2011 at 6:38 AM SPANGLE, Wash.—The Washington State Patrol responded to a semi-rollover on Highway 195 early Friday near Spangle. Troopers said it happened after a vehicle passed the semi on Spangle Creek Road. Authorities believe the driver veered onto the right shoulder as the vehicle passed on the inside lane. They said the semi driver overcorrected which forced his load to tip onto its right side. Fortunately, no one was hurt and the crash did not block the roadway. But the truck was carrying a shipment of recycled paper which was spewed across the area.			

