

<p align="center">SHEET 15 LTPP TRAFFIC DATA</p> <p align="center">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	*STATE ASSIGNED ID	[ P02 ]
	*STATE CODE	[ 53 ]
	*SHRP SECTION ID	[ 1501 ]

LOCATION SR 2 TYPE EQUIP. Diamond

MP # 179.1 MODEL # D-2169

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
12/06/01		Brady WIM and Test Sites Installed UPS here, and performed basic system check/maintenance on 1060s. Data running same as before.			D2169

<p align="center">SHEET 15 LTPP TRAFFIC DATA</p> <p align="center">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	*STATE ASSIGNED ID	[ P02 ]
	*STATE CODE	[ 53 ]
	*SHRP SECTION ID	[ 1501 ]

LOCATION SR 2 TYPE EQUIP IRD

MP # 179.1 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
6/20/01		<p><b>20 Jun 01 -- Coulee City(P02)</b></p> <p><u>Was</u> No answer.</p> <p><u>Action</u> Found 1060 not responding to loop hits. PTEST.EXE saw the loop crossings, but WIM.EXE did not. Removed 9106-1182 and installed 9305-2493. Re-setup site from scratch, and calibrated.</p> <p>Found dial tone on phone, but not getting incoming RING signal. CenturyTel's repair number continued to ring BUSY after several tries. Tom Newman (graciously) agreed to keep trying to reach them.</p> <p><u>Now</u> All good data, beginning 21 Jun 01. Won't be able to poll here until phone company fixes phone problem.</p>	RICH REMPER		9305-2493