

<p align="center">SHEET 15 LTPP TRAFFIC DATA</p> <p align="center">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	*STATE ASSIGNED ID	[B03]
	*STATE CODE	[53]
	*SHRP SECTION ID	[3014]

LOCATION SR 395 TYPE EQUIP. IRD Bending Plate

MP # 27.2 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
10/5/95		Turned off autocalibration since only NB Pass has Weights	Pat McFayden	(360) 753-6156	
11/2/95		System running but not writing to harddrive. Reformatted & installed from backup. Reset autocalibration factor to 1.0 when I reinstalled system because new plates will have to be calibrated when repairs are finished.	Pat McFayden	(360) 753-6156	
12/5/95		Replaced card for NB Drive , Pads 5 & 6, loose chip. Disabled pad 8, NB pass, voltage drifts on bridge #3. Signals from all new NB pads are not normal, they cannot be relied on for proper axle counts. Disabled autocalibration since we are not using weights.	Pat McFayden	(360) 753-6156	

LOG OF CHANGES AT GPS TEST
LOCATIONS WITH PERM. AVC OR WIM

*SHRP SECTION ID [3014]

MP # 27.2 MODEL # IRD 1060

[illegible]