

<p align="center">SHEET 15 LTPP TRAFFIC DATA</p> <p align="center">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	<p>*STATE ASSIGNED ID [B03]</p> <p>*STATE CODE [53]</p> <p>*SHRP SECTION ID [3014]</p>
---	--

LOCATION SR 395 TYPE EQUIP. IRD Bending Plate

MP # 27.2 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
10-21-02	(14:30-17:40)	Pasco B03 Worked on installation of loops and piezos in NB drive lane.	(RCR)		
10-22-02	(11:30-17:15)	Pasco B03 Worked on reinstallation of site and reconfigured computer for piezos.	(RCR)		
10/23/02		B03 Pasco Completed site reinstallation at Pasco B03. Site is now a piezo WIM. Site in not yet enabled. Having problems with 1060. Rich will let you know when Pasco is back collecting data.	(KL)		
10-23-02	(15:45-18:10)	Pasco B03 Was: Site needs calibrating after reinstallation. Action: Computer failed to recognize traffic. Checked configuration, looked OK. Tried several different units with same results. Checked power supply, OK. Not sure what problem is, getting dark and very scary. Must find some place to hide. There's no place like home, there's no place like home. HELP MR. WIZARD!!!!	(RCR)		

10/29/02	(13:40-17:10)	Pasco B03 Was: No display of traffic on screen. Needs calibration. Action: Changed IRQ7 for bending plate to IRQ5 for class 1 piezo. Calibrated site.	(RCR)		
11-12-02		Pasco B03 (15:40- 16:05) Was: Dials no answer Action: found unit locked up with "stack overflow" message. Shut unit down and rebooted. Now operating OK (RCR)			

<p align="center">SHEET 15 LTPP TRAFFIC DATA</p> <p align="center">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	<p>*STATE ASSIGNED ID [B03]</p> <p>*STATE CODE [53]</p> <p>*SHRP SECTION ID [3014]</p>
---	--

LOCATION SR 395 TYPE EQUIP. IRD Bending Plate

MP # 27.2 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
07/09/02	??	07-09-02 Pasco B03, Replaced bending plate #5 North bound dr. lane (all the ears were broken and the frame was also broken). Had the welder from the Pasco office came out to fix the frame. (HN)	Rich Rempfer		
8/14/02	(12:10- 14:30)	Pasco B03 Was: dials, modem, no log on screen. Action: Found unit hung up in boot process, rebooted, logged on and viewed traffic, found 0 axles detected on all lanes. Swapped A/D card, no help; swapped power supply, no help; tried to call Rich again and still no answer. (RCR)	Rich Radcliff		

<p align="center">SHEET 15 LTPP TRAFFIC DATA</p> <p align="center">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	<p>*STATE ASSIGNED ID [B03]</p> <p>*STATE CODE [53]</p> <p>*SHRP SECTION ID [3014]</p>
---	--

LOCATION SR 395 TYPE EQUIP. IRD Bending Plate

MP # 27.2 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
05-08-02	@ 8:30 to 11:30 AM	<u>Pasco B03</u> Was: Offscale hits reported. Action: Found no problem with offscale hits. Tuned bending plate cards: - Plate 2, pair 3 non-functional so disabled on card - Plate 5, pair 2 not working so disabled on card - Plate 6, most pairs not working so disabled on card Now: Good WIM except one and zero axles detected errors are mc/cars/pickups when seen NBD. All trucks are reporting properly.	Rich Rempfer		
07/09/02	??	07-09-02 Pasco B03, Replaced bending plate #5 North bound dr. lane (all the ears were broken and the frame was also broken). Had the welder from the Pasco office come out to fix the frame. (HN)	Hoang Nguyen		

<p align="center">SHEET 15 LTPP TRAFFIC DATA</p> <p align="center">LOG OF CHANGES AT GPS TEST LOCATIONS WITH PERM. AVC OR WIM</p>	<p>*STATE ASSIGNED ID [B03]</p> <p>*STATE CODE [53]</p> <p>*SHRP SECTION ID [3014]</p>
---	--

LOCATION SR 395 TYPE EQUIP. IRD Bending Plate

MP # 27.2 MODEL # IRD 1060

DATE OF CHANGE	TIME OF CHANGE	DESCRIPTION OF CHANGE	PERSON MAKING CHANGE	PHONE #	NEW EQUIP. SERIAL #
1/2/02		<p>Pasco WIM (B03) <u>Was</u> Connects but no screen. <u>Action</u> Found unit halted with internal stack overflow error. Reinstalled DOS and WIM. Found voltage unadjustable on plate 6 (NB Drive -- SHRP direction), load cell pairs 2-5 and 3-6. This problem follows the plate when trying different B/P cards in different 1060 slots. Also, 1060 sees no axles on NB Drive lane. The two problems compound each other. Not much point in swapping out 1060 unless/until bad plate is replaced. I would suggest making this a piezo site, once and for all, and abandoning the bending plate "technology." <u>Now</u> Volume only until we decide what to do, NB Drive lane, beginning 1/3/02. Dick</p>	RICH REMPFER		
2/6/02	@ 4 PM	<p><u>Pasco (B03)</u> Was: No answer Action: System halted with internal stack overflow error. Cold boot fixed. Bad plates NBD, or problems in 1060 relating to that lane. Now: Volume only, beginning 02-07-02. (RR)</p>	RICH REMPFER		

2/27/02	@ 2:00 PM	Pasco (B03) <u>Was</u> No answer. <u>Action</u> Found unit halted with internal stack overflow error. Reinstalled DOS and WIM after running Spinrite and Norton Disk Doctor (hard disk was corrupted). <u>Now</u> Volume only NB, beginning 02-28-02. (RR)	RICH REMPFER		
03/27/02	@ 0800	-B03 Pasco <u>Was</u> Connects, but no screen. <u>Action</u> Found unit crashed with "internal stack overflow" error. Replaced 9305-2462 with 9106-1187. Bending plate 6 impossible to tune. Disabled on card and in software. Other than this, the site is working okay. Doubled weight calibration on plate 5 to compensate for missing plate 6. <u>Now</u> Good WIM, beginning 03/28/02 (RR)			9106-1187