


Stereo Sound System

Cable Reel Harness Test

CAUTION: Disconnect the battery negative cable and then positive cable. Connect the short connector to the airbag assembly (see page 23-407).


1. Disconnect the cable reel 7-P connector from the SRS main harness, and connect the Test Harness C only to the cable reel side of the 7-P connector.

CABLE REEL
HARNESS SIDE OF
7-P CONNECTOR

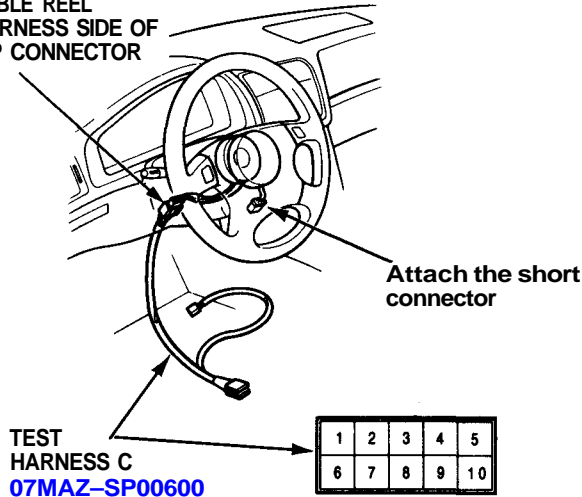

TEST
HARNESS C
07MAZ-SP00600

2. Separate the radio remote switch (see page 23-235).
3. Disconnect the 2-P connector from the radio remote switch.

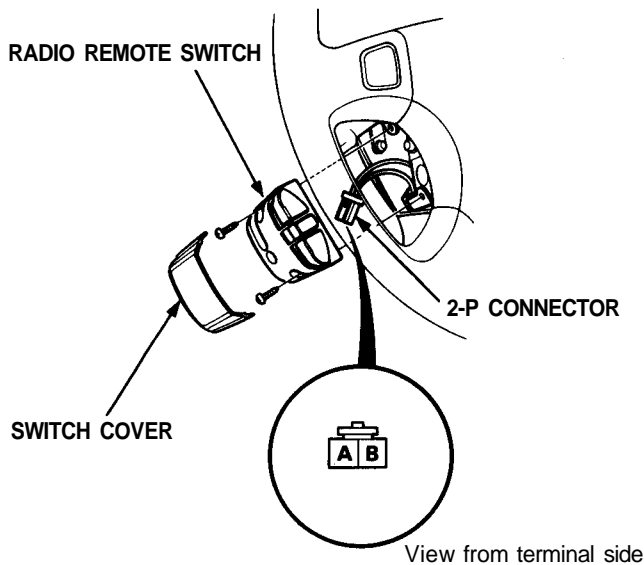

4. Check for continuity between the No. 7 and B terminals. There should be continuity.

- If there is no continuity, replace the cable reel.
- If there is continuity, go to step 5.

5. Check for continuity between the A terminal and body ground. There should be continuity.

If there is no continuity, go to step 6.

6. Remove the airbag (see page 23-360 ('91 Model) or 23-430 ('92-'95 Models)).

7. Disconnect the ground connector, then check for continuity between the A terminal and ground connector. There should be continuity.

If there is no continuity, replace the cable reel.

