



XTREME[®] RAPID CLEANER

**High Foaming, Mega Concentrated,
Super Action Cleaner**



Xtreme Rapid Cleaner is a concentrated detergent formulated to remove grease, oils, mineral deposits, and other hard to remove soils. Safe on all metals, including aluminum. Ideal for cleaning food processing evaporator coils, engine parts, air ventilation systems, and other industrial equipment in brushless or automatic applications.

XTREME® RAPID CLEANER

FEATURES

- Formulated with corrosion inhibitors to prevent pitting, discoloration, or surface damage on aluminum
- Non-flammable, phosphate-free, solvent-free, and low-odor
- Versatile application: ideal for automatic wash systems, pressure washers, and manual cleaning
- Formulated for use in and around food processing and handling facilities

BENEFITS

- Delivers high performance at extremely lean dilutions ranging from 1/4 – 1 oz/gal
- Performs effectively in cold water, eliminating the need for hot water and reducing energy consumption
- Quickly dissolves road film, grease, oils, salts, and other hard to remove soils
- Safe for use on all water-tolerant surfaces, including interiors and engines

SPECIFICATION DATA

Dilution	0.25 – 6 oz/gal
pH	11.5 – 12.5
Color	Blue
Fragrance	Clean
Specific Gravity @ 24°C/75°F	1.042
Flash Point	< 100°C/212°F
Stability: Shelf @ 24°C/75°F	1 year
Stability: Freeze/Thaw	1 cycle

ORDERING INFORMATION



#301405 #301455 #301460

DIRECTIONS FOR USE

AUTOMATIC WASH SYSTEMS (TRANSIT CLEANING)

Use at 0.5 oz per gallon dilution under normal cleaning circumstances. For light duty soils, use at 0.25 oz per gallon. For heavy duty soils, 1 oz per gallon may be used. Rinse thoroughly. For best results when heavy soil conditions exist, pre-scrub rocker panels, front and back of bus with hand brush.

PRESSURE WASHING

Dilute 1:50 (2.5 oz/gal of water). Rinse thoroughly.

ENGINE CLEANING

In some cases, strong dilutions of Xtreme Rapid Cleaner (1:10 – 1:25) can be used to clean engines. Apply through a sprayer or pressure washer and rinse thoroughly.

MANUAL CLEANING

When using Xtreme Rapid Cleaner in a bucket for manual hand washes, dilute at 1:128 (1 oz/gal of water). Rinse thoroughly.

EVAPORATOR CLEANING (FOOD PRODUCTION FACILITIES)


Cover all electrical components and disconnect piping in accordance with facility standard operating procedures. Using low pressure, pre-wash evaporator with hot water. Foam evaporator using Xtreme Rapid Cleaner at 6 ounces per gallon in foam tank. Let foam set for a minimum of 5 minutes. Scrub evaporator framework using green pads. DO NOT allow Xtreme Rapid Cleaner solution to dry on surface. Rinse thoroughly.

ALUMINUM CLEANING

Xtreme Rapid Cleaner contains an aluminum corrosion inhibitor which protects aluminum. For best results, dilute Xtreme Rapid Cleaner at 1:128 (1 oz/gal of water). Rinse thoroughly.

ADDITIONAL RESOURCES

Scan the QR code to access this product's safety information and documentation.

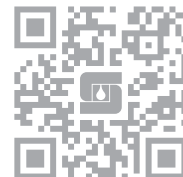

SAFETY: For institutional and industrial use only. Be sure to read all directions, precautionary and first aid statements on product labels before using this or any other Spartan product. If questions remain, consult your employer or a physician. Safety Data Sheets for all Spartan products are available from your authorized Spartan distributor and at www.spartanchemical.com. Workplace labels are available in English, Spanish, and French.

GUARANTEE: Spartan's modern manufacturing and laboratory control ensures uniform quality. If dissatisfied with performance of product, any unused portion may be returned for credit within 12 months of the date of manufacture.