


Gap Solution for Excessive Fire Door and Frame Clearances — 90 Minute

UL Certified Solution for Fire doors with Excessive clearance between door and frame over 1/8", up to 5/16"

Requires installation of **ALL** components below:

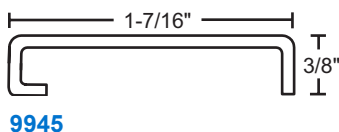


Steel Stop Extender

16 Gauge , Gray Primer Finish

Furnished with #10 X 1" TEK SMS

Patent No.: US9,273,510B2

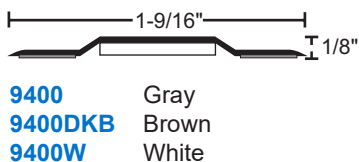

NGP-Edge® Intumescent Seal with PVC cover

Self-Adhesive - specifications on page G9



Anti-Microbial



Self-Adhesive TPE Seal



*Anti-Microbial not available in clear

Ordering Information:

GAP90™ Includes 9945, 9400, 5075CL

GAP90DKB™ Includes 9945, 9400DKB, 5075B

GAP90W™ Includes 9945, 9400W, 5075W

Available in 36", 48", 84" and 96" lengths



90 minute rated UL Certified Miscellaneous Fire Door Accessory UL10B and UL10C wood or hollow metal fire doors

An NGP strike shim 9275 or 9225 is also required for proper latchbolt engagement

Certified for use on doors with Rim Exit Devices, refer to Installation Instructions.

Doors with Parallel arm closers – use 9990 shown on next page.

INSTALLED VIEW

