


CB29M—CONTROL PANEL PARTS

NOVEMBER 27, 1995



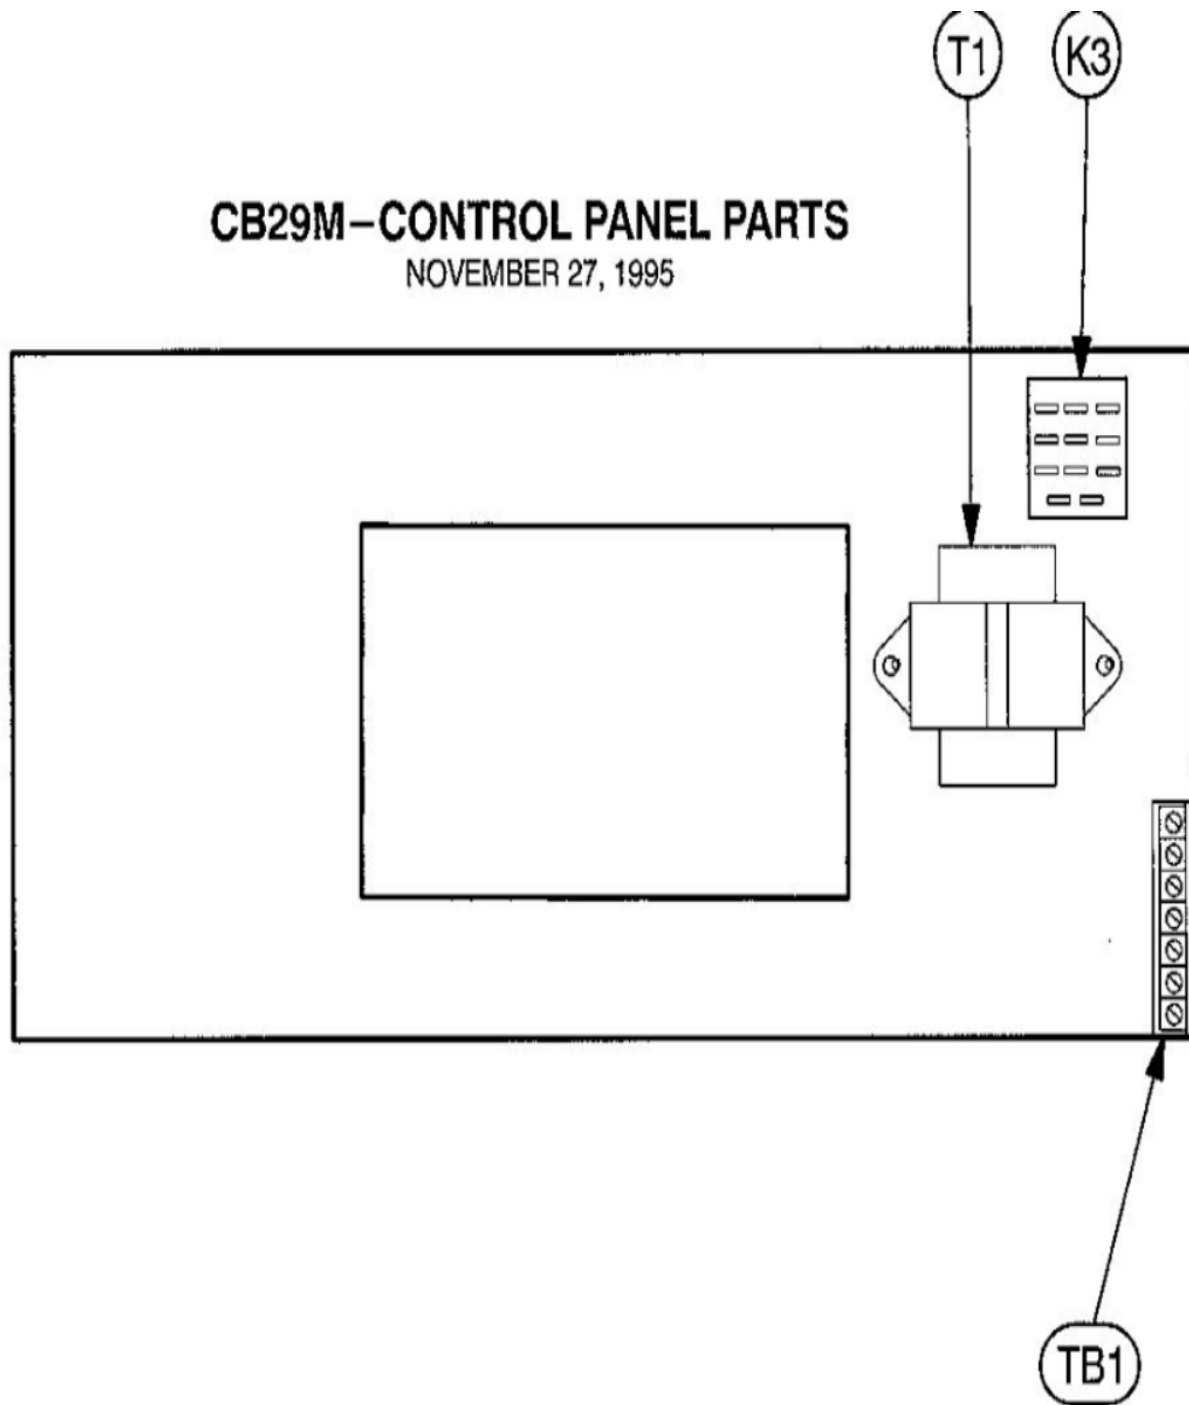

Revision Number - 2

BLOWER PARTS

| Callout | Name | Quantity | Description |
|---------|---|----------|-------------------------------------|
| | HARNESS-WIRING Cat #: 64K20 Model/Part #: LB-74239 | 1 | BLOWER MOTOR (208/230V) |
| | HARNESS-WIRING Cat #: 27L51 Model/Part #: LB-89757 | 1 | BLOWER MOTOR (460V) |
| | PLATE-CUTOFF Cat #: 93K60 Model/Part #: LB-89876 | 1 | CUTOFF PLATE |
| 35 | HOUSING-BLOWER Cat #: 53K60 Model/Part #: 53K6001 | 1 | BLOWER HOUSING S.A. |
| 36 | MOTOR-BLOWER Cat #: 18K74 Model/Part #: 18K7401 | 1 | 1/3HP, 1075 RPM, 208-230/60/1 |
| 36 | MOTOR-BLOWER Cat #: 34K79 Model/Part #: 34K7901 | 1 | 1/3HP, 1075 RPM, 460/60/1 (460V) |
| 38 | WHEEL-BLOWER Cat #: 21708 Model/Part #: LB-29333BJ | 1 | 1/2" BORE, 10" X 8" |
| C4 | CAPACITOR Cat #: 22W78 Model/Part #: 59C9201 | 1 | 5MFD, 370VAC |

CABINET PARTS

| Callout | Name | Quantity | Description |
|---------|---|----------|------------------------------|
| | FILTER-AIR 20" X 20" X 1" Cat #: Model/Part #: | 1 | |
| | KIT-HARDWARE Cat #: 97M37 Model/Part #: LB-110418A | 1 | PKG OF 10 FOR FILTER DOOR |
| 1 | CAP-CABINET Cat #: 72M02 Model/Part #: LB-107656C | 1 | TOP CAP |
| 2 | PLATE Cat #: 72M05 Model/Part #: LB-107656F | 1 | PATCH |
| 3 | PANEL Cat #: 72M03 Model/Part #: LB-107656D | 1 | BLOWER |

| Callout | Name | Quantity | Description |
|----------------|--|-----------------|--------------------|
| 4 | PLATE Cat #: 72M04 Model/Part #: LB-107656E | 1 | PLUMBING |
| 5 | WRAPPER Cat #: 72M01 Model/Part #: LB-107656B | 1 | RIGHT |
| 6 | WRAPPER Cat #: 72M00 Model/Part #: LB-107656A | 1 | LEFT |
| 7 | WRAPPER Cat #: 72M12 Model/Part #: LB-107656N | 1 | REAR |
| 8 | PANEL Cat #: 72M06 Model/Part #: LB-107656G | 1 | FILTER ACCESS |

COOLING PARTS

| Callout | Name | Quantity | Description |
|----------------|--|-----------------|------------------------|
| | FUSE 3 AMP 32 VOLT Cat #: 25J49 Model/Part #: 25J4901 | 1 | TRANSFORMER-3 AMP |
| | LIQUID LINE Cat #: 44L35 Model/Part #: 44L3501 | 1 | SWEAT ASSY INCL SCREEN |
| | WASHER KIT Cat #: 49J23 Model/Part #: 49J2301PR | 1 | PKG (12) |
| | HARNESS-WIRING Cat #: 78K52 Model/Part #: LB-74237 | 1 | POWER (208/230-460V) |
| | HARNESS-WIRING Cat #: 32L79 Model/Part #: LB-74238 | 1 | CONTROL (208/230V) |
| | CHANNEL Cat #: 64K05 Model/Part #: LB-88628 | 1 | DRAIN |
| | CHANNEL Cat #: 64K06 Model/Part #: LB-88651 | 2 | CONDENSATE |
| | HARNESS-WIRING | 1 | P50 (460V) |

| Callout | Name | Quantity | Description |
|---------|---|----------|--|
| | Cat #: 53L91 Model/Part #: LB-89758 | | |
| | HARNES-WIRING Cat #: 53L92 Model/Part #: LB-89759 | 1 | CONTROL (460V) |
| | LIQUID LINE KIT Cat #: 69J46 Model/Part #: LB-95325A | 1 | INCL 10 LIQUID LINES(44L35)+WASHERS&NUTS |
| 10 | COIL-INDOOR Cat #: 57K55 Model/Part #: LB-90287C | 1 | W/MANIFOLD & TXV |
| 12 | PAN-DRAIN Cat #: 93J58 Model/Part #: 93J5801 | 1 | (HORIZONTAL) |
| 12 | PAN-DRAIN Cat #: 68K31 Model/Part #: LB-90788B | 1 | PAN-DRAIN |
| 15 | DISTRIBUTOR ASSY (FOOTNOTE 1) Cat #: Model/Part #: | 1 | |
| 16 | VALVE-EXPANSION Cat #: 37J69 Model/Part #: 37J6901 | 1 | VALVE-EXPANSION/CHECK-R22 |
| 20 | SEAL-COIL Cat #: LB-88008 Model/Part #: LB-88008 | 1 | REAR |
| 21 | SEAL-COIL Cat #: 40W99 Model/Part #: 600588-01 | 1 | FRONT-TOP |
| 22 | SEAL-COIL Cat #: 40W94 Model/Part #: 600583-01 | 1 | FRONT-BOTT |
| 23 | SEAL-COIL Cat #: 24W90 Model/Part #: LB-88007 | 1 | TOP |
| K3 | RELAY Cat #: 67K66 Model/Part #: 67K6601 | 1 | ID DLR, 3PDT, 24V (460V) |
| K3 | RELAY | 1 | ID BLR, DPDT, 24V |

| Callout | Name | Quantity | Description |
|----------------|--|-----------------|--|
| | Cat #: 69J57 Model/Part #: 69J5701 | | |
| S51 | SWITCH Cat #: 25J13 Model/Part #: 25J1301 | 1 | DOOR INTERLOCK (460V) |
| T1 | TRANSFORMER Cat #: 51H79 Model/Part #: 51H7901 | 1 | 480V PRI, 24 SEC, 70VA L/ FUSE |
| T1 | TRANSFORMER Cat #: 51M10 Model/Part #: 51M1001 | 1 | 208/240V PRI, 24V SEC, 40VA L/ FUSE |
| TB1 | STRIP-TERMINAL Cat #: 18K71 Model/Part #: 18K7101 | 1 | TERMINAL BLOCK |

Note:

Note1: DISTRIBUTOR ASSEMBLIES ARE NOT SET UP AS A REPAIR PART. IF COIL HAS MULTIPLE LEAKS IN THE DISTRIBUTOR ASSEMBLY, THE COIL SHOULD BE REPLACED.