


From 2025—Present 5 doors / 5 seats / SUV







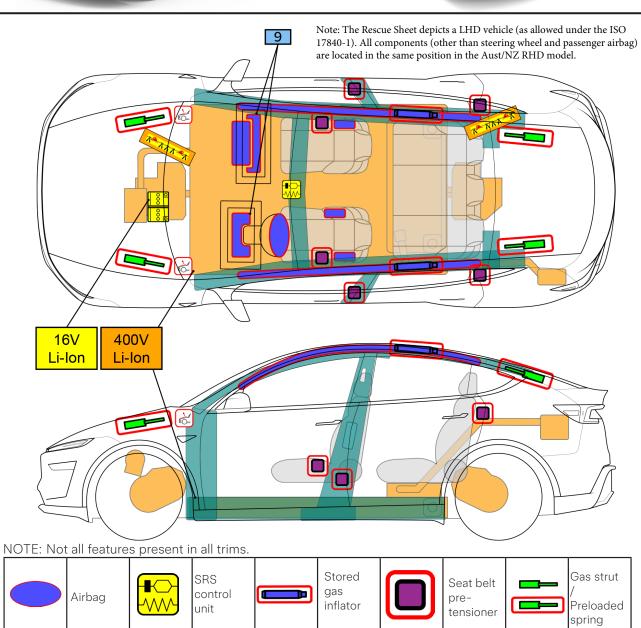

	Airbag		SRS control unit		Stored gas inflator		Seat belt pre- tensioner	Gas strut / Preloaded spring
000000	Battery low voltage	0 0	Battery pack, high- voltage	N	High voltage power cable	<del>******</del>	Cable cut	High strength zone
	Pedestrian protec- tion active system							

TESLA Model Y
From 2025 - Present

ID No.	Version No.	Page No.
TESLA-2026MY-002	04	01/05



From 2025—Present 5 doors / 5 seats / SUV



# 1. Identification / Recognition



LACK OF ENGINE NOISE DOES NOT MEAN VEHICLE IS OFF.
SILENT MOVEMENT OR INSTANT RESTART CAPABILITY EXISTS UNTIL VEHICLE IS FULLY SHUT DOWN. WEAR APROPRIATE PPE.









NOTE: The Tesla wordmark indicates a fully electric vehicle.

NOTE: The model name does not appear on the exterior of the vehicle.

### 2. Immobilization / Stabilization / Lifting


#### **IMMOBILIZATION**

1. CHOCK WHEELS

#### 2. PUT VEHICLE INTO PARK POSITION





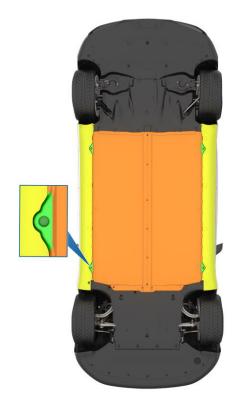

### STABILIZATION / LIFTING POINTS

Appropriate lift areas		
Safe stabilization points for Model Y resting on its side		
High Voltage (HV) Battery		



Do not push on HV Battery.



7	TESLA Model Y	ID No.	Version No.	Page No.
	From 2025 - Present	TESLA-2026MY-002	04	02/05



From 2025—Present 5 doors / 5 seats / SUV



# 3. Disable Direct Hazards / Safety Regulations



# MAIN DISABLING METHOD

ACCESS





- · Open the hood.
- · Double cut the first responder loop.





# ALTERNATIVE DISABLING METHOD

#### **ACCESS**



- First responder loop is located on the right side of Model Y.
- · Break fixed window and remove trim to access.
- Double cut the first responder loop.



Not every high voltage component is labeled. Always wear appropriate PPE. Always double cut the first responder loop. Do not attempt to open the high voltage (HV) battery.



T	TESLA Model Y	ID No.	Version No.	Page No.
1	From 2025 - Present	TESLA-2026MY-002	04	03/05



From 2025—Present 5 doors / 5 seats / SUV



### 4. Access to the Occupants



Electrical and mechanical releases like doors and seat belts may be compromised after a collision.



NOTE: The seats, steering wheel, and interior door buttons are electrically powered and may not function after a collision. The steering wheel becomes difficult to move without low voltage power.

NOTE: After a collision, the doors may not unlock from the outside. Extrication may be required. The body is constructed of steel with aluminum doors.

NOTE: The windshield, top glass, and rear window is made of laminated glass. The side windows can be either tempered or laminated glass.

# **OPENING DOORS** FROM OUTSIDE WITH POWER



# **OPENING DOORS** FROM INSIDE WITH POWER



**OPENING TRUNK FROM OUTSIDE WITH POWER** 



### OPENING HOOD FROM INSIDE WITH POWER

Touch the open hood button on the touchscreen



OPENING FRONT DOORS FROM INSIDE WITHOUT POWER



**OPENING REAR** DOORS FROM INSIDE WITHOUT POWER




NON-OPERATIONAL WITHOUT POWER




OPENING HOOD WITHOUT POWER

Use external power supply to OPEN

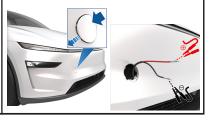

#### **GLASS**

- LAMINATED
- **TEMPERED**

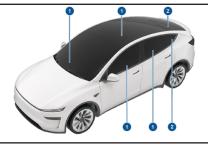

#### HIGH STRENGTH ZONES

- · STEEL VEHICLE STRUCTURE
- · ULTRA-HIGH STRENGTH STEEL A/B **PILLARS**
- · ALUMINUM DOORS



### 5. Stored Energy / Liquids / Gases / Solids



Li-Ion

















400V Li-lon

16V Low Voltage



All high voltage cables have ORANGE INSULATION.



Never cut or open high voltage components or cables.



Coolant is blue or orange.



TESLA Model Y	ID No.	Version No.	Page No.
From 2025 - Present	TESLA-2026MY-002	04	04/05



From 2025—Present 5 doors / 5 seats / SUV



#### 6. In Case of Fire



















DO NOT SUBMERGE VEHICLE TO EXTINGUISH/COOL BATTERY FIRE



USE LARGE AMOUNTS OF WATER TO COOL THE BATTERY ENCLOSURE FROM THE BOTTOM OF THE VEHICLE



POSSIBLE BATTERY RE-IGNITION!

MONITOR HV BATTERY TEMPERATURE FOR AT LEAST 24 HOURS


#### 7. In Case of Submersion

Treat a submerged Model Y like any other submerged vehicle. Wear appropriate PPE for water rescue. Remove the vehicle from the water and continue with normal high voltage disabling. Vehicles submerged in water should be handled with a greater potential risk of an HV battery fire. Raise the front of the vehicle approximately 30 cm (1 foot) to allow water to drain out of the vehicle and battery pack and then store the vehicle flat.

### 8. Towing / Transportation / Storage

Use a towing truck with flatbed.

NO towing with running traction wheels.

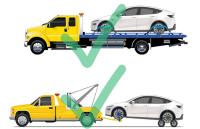







HV BATTERY
TEMPERATURE
SHOULD BE CHECKED
BEFORE TRANSPORT



POSSIBLE BATTERY RE-IGNITION!

AFTER A FIRE INCIDENT, STORE OUTSIDE AT A SAFE DISTANCE (AT LEAST 50 FT/ 15 M) FROM OTHER VEHICLES AND STRUCTURES!

### 9. Important Additional Information

First Responders and Second Responders with emergencies, call Tesla Roadside Assistance. Refer to <a href="https://www.tesla.com/roadside-assistance">https://www.tesla.com/roadside-assistance</a> for the applicable hotline number.

First responder information can be found at <a href="https://www.tesla.com/firstresponders">https://www.tesla.com/firstresponders</a>. First responders and training officers who have questions, contact firstrespondersafety@tesla.com.

Airbags:



Knee airbags are only installed in North America, excluding Mexico.

#### 10. Explanation of Pictograms



In some working environments, the Infrared (IR) device is referred to as a Thermal Image Camera (TIC).

7	TESLA Model Y	ID No.	Version No.	Page No.
	From 2025 - Present	TESLA-2026MY-002	04	05/05