


INSTALLATION INSTRUCTIONS FOR OPTIONAL MODEL EGS FIRESTOP/SUPPORT

- At the desired location, cut a square or circular hole in the floor at a minimum of $3\frac{1}{4}$ inches larger than the nominal pipe size, but not greater than 4 inches larger. See the chart below. This will provide the REQUIRED 1-INCH CLEARANCE FROM COMBUSTIBLES.

Support Hole Dimensions (inches)				
Nominal Pipe Size	7	8	9	10
Minimum Hole Size	10 $\frac{1}{4}$	11 $\frac{1}{4}$	12 $\frac{1}{4}$	13 $\frac{1}{4}$
Maximum Hole Size	11	12	13	14

- Place the support over the hole with the ring down.
- Use an 8 penny nail or self-drilling sheet metal screw in each corner at least $\frac{3}{8}$ of an inch in from the edge.
- Pipe should be inserted from below. A maximum of 30 feet of pipe may be installed above the support before resupport is required.

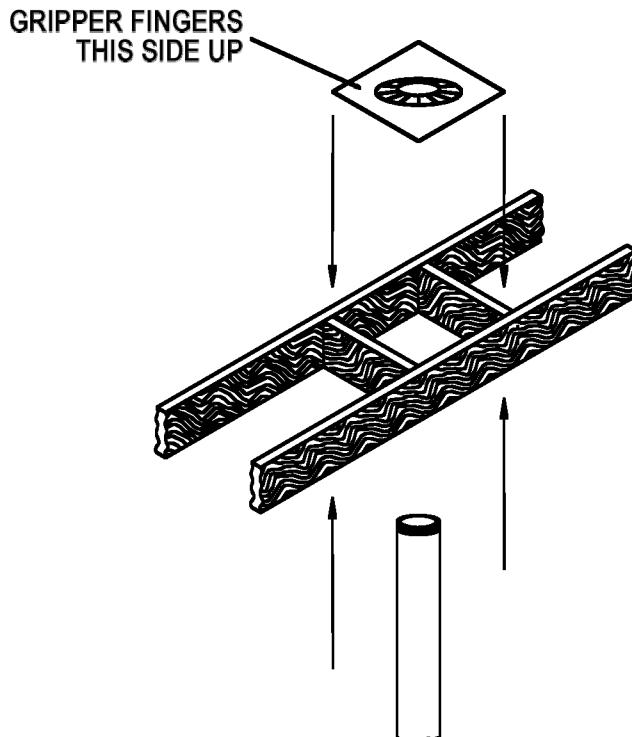

American Metal Products Group 800-423-4270 toll-free
5030 Corporate Exchange Blvd. SE 616-656-8400 phone
Grand Rapids, MI 49512 800-626-3825 toll-free fax
www.americanmetalproducts.com 616-656-6388 fax