



REFERENCE "FALCON MA" MORTISE LOCKSET INSTALLATION TEMPLATE FOR ACTUAL DIMENSIONS PERTAINING TO THE LOCKCASE INSTALLATION AND CENTER—TO—CENTER DIMENSIONS.

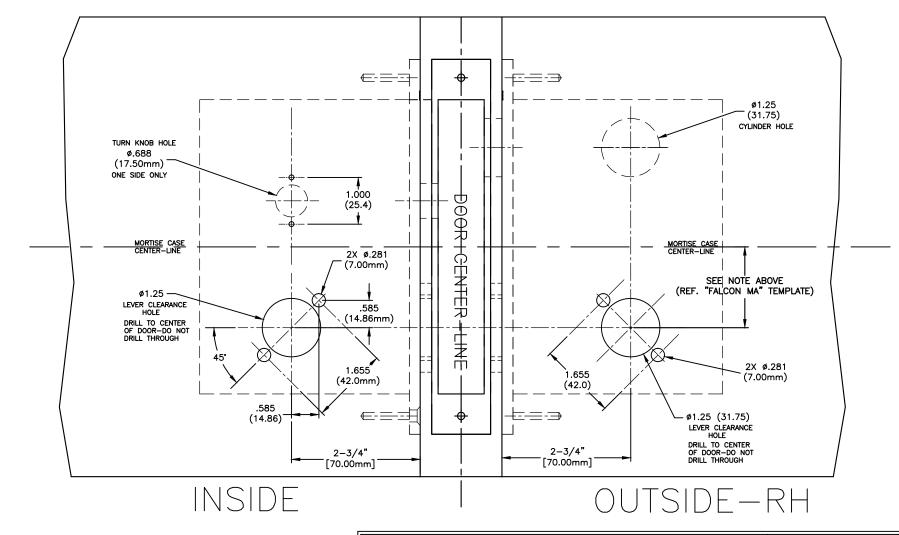



TITLE FALCON "MA" MORTISE DOOR PREP
FOR SECTIONAL "SM" ROSE

TOLERANCES—METRIC
"DO NOT SCALE PRINT"
TOLERANCES UNLESS OTHERWISE SPECIFIED:
X.X = ±0.4
X.XX = ±0.15


TITLE FALCON "MA" MORTISE DOOR PREP
REV. DATE: 12-15-14 REV. A
APPVD: DRAWN BY: ORIG. DATE:
--- JWB 03-29-11
SCALE: Drawing NO:
NTS DP-126

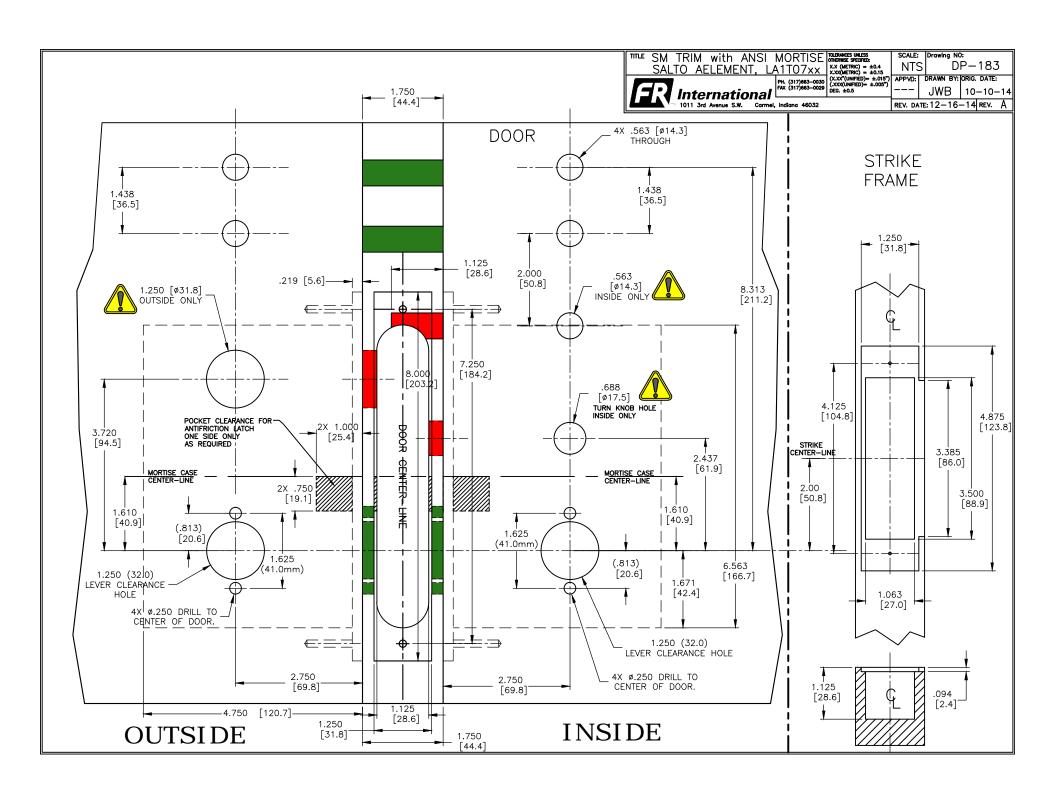

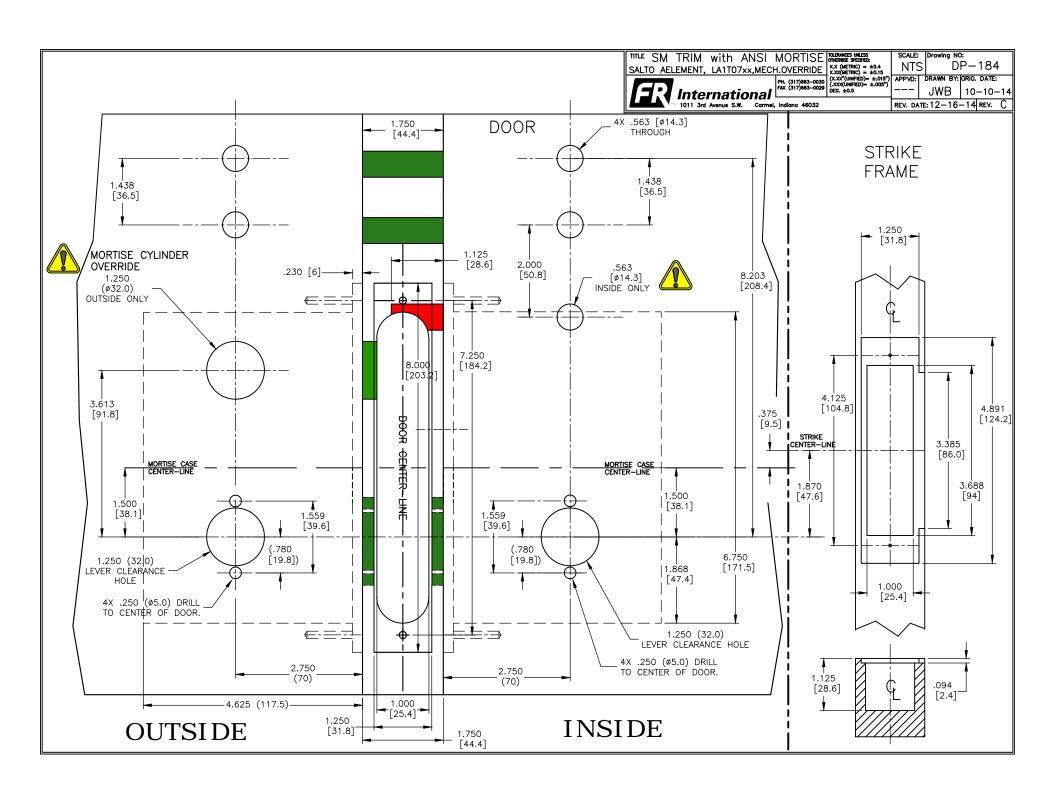

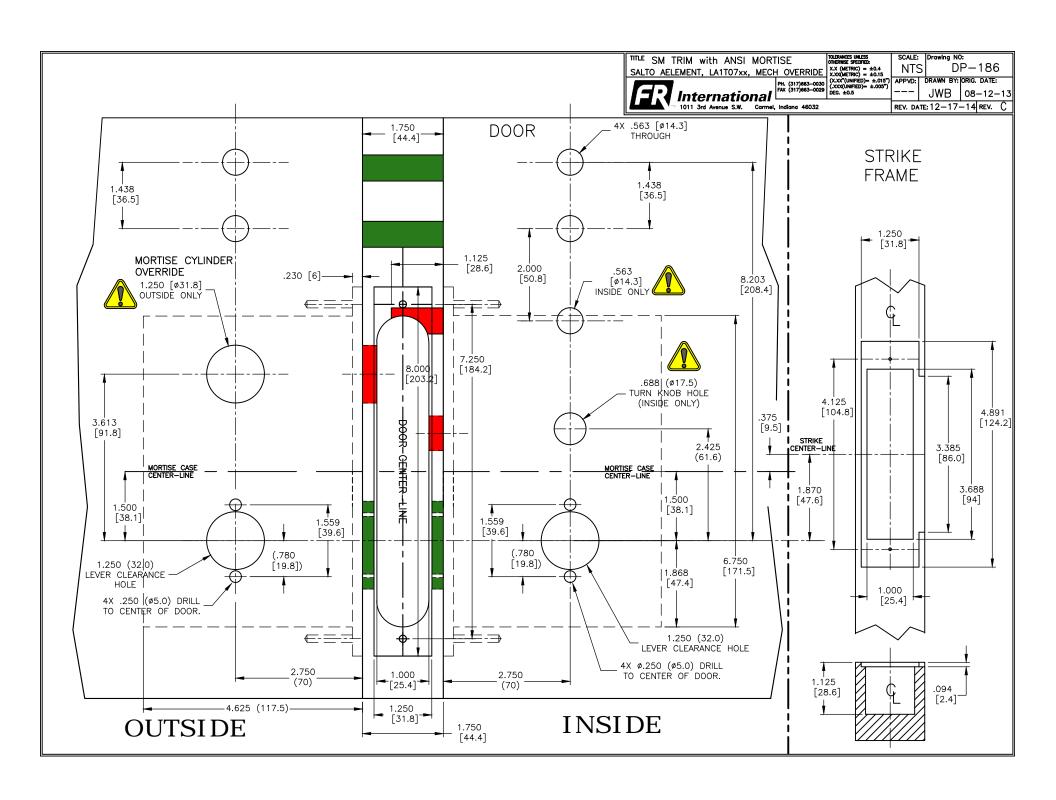


## AEIement LEVER TRIM INSTALLATION INSTRUCTIONS A) Mortise Strike kit components B) "SALTO" Mortise lock/Faceplate C) Outside Lever/Rose Trim D) Inside Backplate Mounting Base

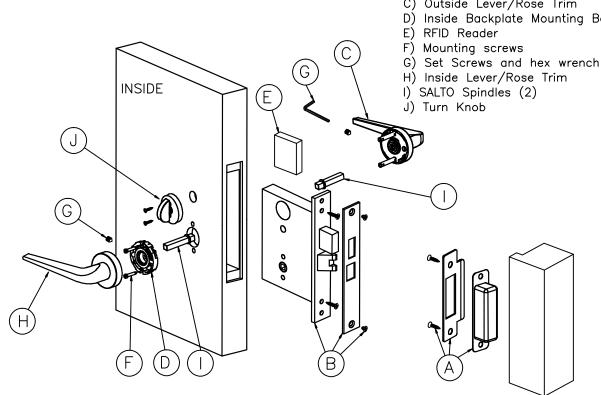


BEFORE ASSEMBLING, CAREFULLY READ THE INSTALLATION INSTRUCTIONS.

**INSIDE** 

- a. ONCE THE MOUNTING BASE IS INSTALLED, INSERT THE INSIDE LEVER/ROSE ASSEMBLY "H" OVER THE SPINDLE AND ROTATE THE ROSE ALONE TO ALIGN THE (4) CLEATS WITH (4) MATING GROOVES IN THE MOUNTING BASE. SEE IMAGE a-b BELOW.
- b. ONCE ALIGNED, PUSH FIRMLY UNTIL THE ROSE IS UP AGAINST THE SURFACE

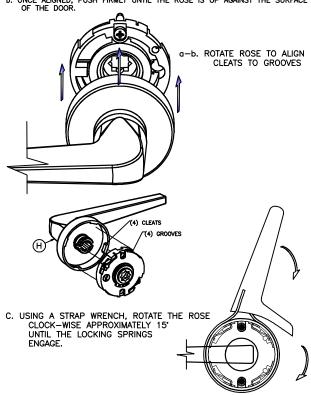

(NOTE: SHOWING INSIDE MOUNTING BASE FOR VISUAL REFERENCE ONLY)

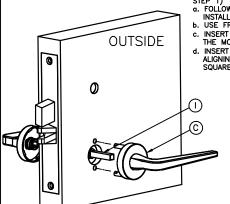

IT-125 SM LEVER TRIM Mortise Sectional-INSTALLATION INSTRUCTIONS ORIG: 12-10-10 REVISED: 11-07-12

STEP 1)

0. FOLLOW THE LOCK MANUFACTURERS INSTRUCTIONS INSTALLING THE MORTISE LOCK CASE.

1. USE FRASCIO DOOR PREP GUIDE, DP-125.

1. INSERT THE OUTSIDE LEVER SPINDLE "I" INTO THE MORTISE LOCKCASE.

d. INSERT THE OUTSIDE TRIMSET "C" CAREFULLY ALIGNING THE SPINDLE THROUGH APPROPRIATE SQUARE HOLE AND INTO THE LEVER.


a. INSERT THE SPINDLE "I" INTO THE MORTISE CASE HUB.

ALIGN THE BACKPLATE MOUNTING BASE "D" TO THE APPROPRIATE SPINDLE HOLE AND SLIDE DOWN TO THE FACE OF THE DOOR.

INSERT (2) MOUNTING SCREWS "F" AND TIGHTEN FIRM—DO NOT OVER-TORQUE SCREWS. THIS WILL PREVENT DOOR COMPRESSION.

INSERT THE TURN KNOB ASSEMBLY "J" INTO THE TURN KNOB HUB AND FASTEN SECURELY WITH THE (2) PROVIDED SCREWS. MAKE SURE TURN KNOB ROSE MOUNTING HOLES ARE ALIGNED STEP 4)

a. INSERT THE LEVER SET SCREWS IN THE OUTSIDE AND INSIDE LEVER AND TIGHTEN FIRMLY WITH HEX WRENCH SUPPLIED.

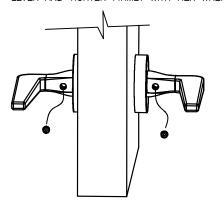

IT-125

