


COOLING-COIL/BLOWER COILS
MARCH, 2007
SUPERCEDES NOVEMBER, 1995

CB30M CONTROL PANEL

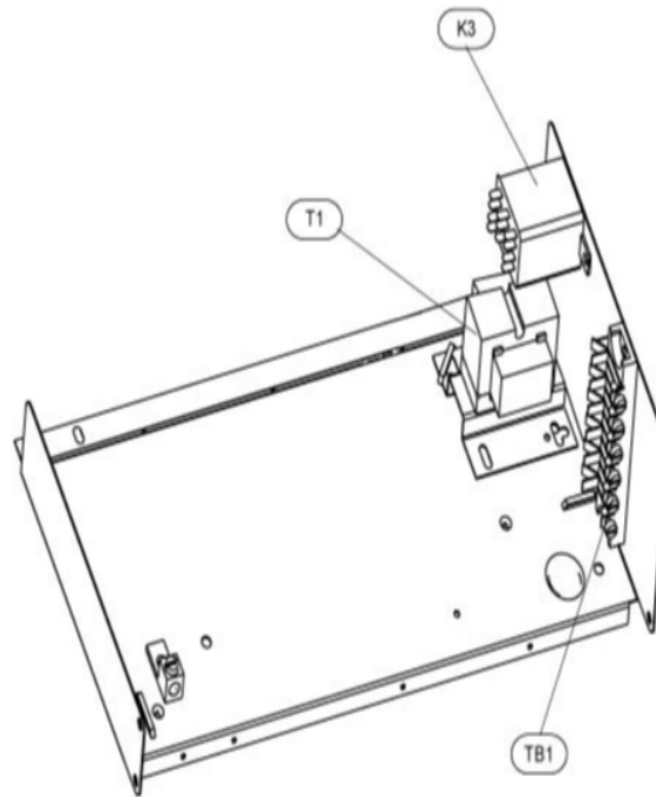

Revision Number - 3P

BLOWER PARTS

Callout	Name	Quantity	Description
	HARNES-WIRING Cat #: 64K20 Model/Part #: LB-74239	1	HARNES ASSEMBLY
	PLATE-CUTOFF Cat #: 11L49 Model/Part #: LB-88459	1	CUTOFF PLATE
33	ARM-MOTOR MTG Cat #: 89K26 Model/Part #: LB-59076CC	3	MOUNT-MTR
35	HOUSING-BLOWER Cat #: 71M72 Model/Part #: LB-107661B	1	W/CUTOFF PLATE
36	MOTOR-BLOWER Cat #: 93J67 Model/Part #: 93J6701	1	"1/3HP,825RPM,208-230/60/1"
38	WHEEL-BLOWER Cat #: 10H00 Model/Part #: LB-29333BBW	1	"1/2""BORE,11""X8""
C4	CAPACITOR Cat #: 53H06 Model/Part #: 39H6301	1	"15MFD,370VAC"

CABINET PARTS

Callout	Name	Quantity	Description
	FILTER-AIR"20"" X 20"" X 1"" Cat #: Model/Part #:	1	
	CLIP-FILTER Cat #: 49K46 Model/Part #: 49K4601	3	CLIP-FILTER
	KIT-HARDWARE Cat #: 97M37 Model/Part #: LB-110418A	1	PKG OF 10 FOR FILTER DOOR
	SPACER-FILTER Cat #: 43L91 Model/Part #: LB-74258	1	FILTER SPACER*
1	CAP-CABINET Cat #: 91M64 Model/Part #: LB-107656EE	1	TOP CAP
2	PLATE Cat #: 91M43 Model/Part #: LB-107656DD	1	PATCH

Callout	Name	Quantity	Description
3	PANEL Cat #: 91M92 Model/Part #: LB-107656FN	1	BLOWER
4	PANEL Cat #: 91M75 Model/Part #: LB-107656ES	1	PLUMBING
5	WRAPPER Cat #: 91M89 Model/Part #: LB-107656FK	1	TOP-RIGHT
6	WRAPPER Cat #: 91M91 Model/Part #: LB-107656FM	1	BOTTOM-RIGHT
7	WRAPPER Cat #: 91M88 Model/Part #: LB-107656FJ	1	TOP-LEFT
8	WRAPPER Cat #: 91M87 Model/Part #: LB-107656FH	1	BOTTOM-LEFT
9	WRAPPER Cat #: 91M90 Model/Part #: LB-107656FL	1	TOP-REAR
10	WRAPPER Cat #: 91M84 Model/Part #: LB-107656FE	1	BOTTOM-REAR
11	PANEL Cat #: 91M52 Model/Part #: LB-107656DN	1	FILTER ACCESS

CONTROL PANEL PARTS

Callout	Name	Quantity	Description
	FUSE 3 AMP 32 VOLT Cat #: 25J49 Model/Part #: 25J4901	1	FUSE (AUTO) - 3 AMP
	HARNESS-WIRING Cat #: 78K52 Model/Part #: LB-74237	1	POWER
	HARNESS-WIRING Cat #: 32L79 Model/Part #: LB-74238	1	CONTROL
K3	RELAY Cat #: 67K65 Model/Part #: 67K6501	1	"ID BLR,DPDT,24V"
T1	TRANSFORMER Cat #: 51M10 Model/Part #: 51M1001	1	"208/240V PRI,24V SEC,40VA W/FUSE"
TB1	STRIP-TERMINAL	1	6 POSITION

Callout	Name	Quantity	Description
	Cat #: 18K71 Model/Part #: 18K7101		

COOLING PARTS

Callout	Name	Quantity	Description
	LIQUID LINE Cat #: 44L35 Model/Part #: 44L3501	1	SWEAT ASSY INCLUDES SCREEN
	WASHER KIT Cat #: 49J23 Model/Part #: 49J2301PR	1	PKG(12)
	CHANNEL Cat #: 64K05 Model/Part #: LB-88628	1	DRAIN
	CHANNEL Cat #: 64K06 Model/Part #: LB-88651	2	CONDENSATE
	LIQUID LINE KIT Cat #: 69J46 Model/Part #: LB-95325A	1	TEN LIQUID LINES(44L35) + WASHERS&NUTS
12	COIL-INDOOR Cat #: 57K60 Model/Part #: LB-90287H	1	W/MANIFOLD
13	PAN-DRAIN Cat #: 93J59 Model/Part #: 93J5901	1	(HORIZONTAL)
13	PAN-DRAIN Cat #: 68K32 Model/Part #: LB-90788C	1	PAN-DRAIN
15	DISTRIBUTOR ASSY (FOOTNOTE 1) Cat #: Model/Part #:	1	
16	VALVE-EXPANSION Cat #: 37J69 Model/Part #: 37J6901	1	(R22)
16	VALVE-EXPANSION Cat #: 49L24 Model/Part #: 49L2401	1	(R410A)
20	SEAL-COIL Cat #: LB-88615 Model/Part #: LB-88615	1	REAR
21	SEAL-COIL Cat #: 40W91 Model/Part #: 600580-01	1	FRONT-TOP

Callout	Name	Quantity	Description
22	SEAL-COIL Cat #: 40W92 Model/Part #: 600581-01	1	FRONT-BOTTOM
23	SEAL-COIL Cat #: 23M90 Model/Part #: LB-88432	1	TOP

Note:

DISTRIBUTOR ASSEMBLIES ARE NOT SET UP AS A REPAIR PART. IF COIL HAS MULTIPLE LEAKS IN THE DISTRIBUTOR ASSEMBLY, THE COIL SHOULD BE REPLACED.