

Toyota U151E/F, U250E

sonnax®

TIME TESTED • INDUSTRY TRUSTED®


1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com



This Sonnax kit also is available, see www.sonnax.com for details.

Zip Kit®
U151E-U250E-ZIP

1 57917E-16K* Oversized Secondary Pressure Regulator Valve Kit

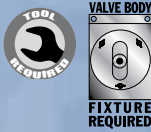

Helps cure:

- Harsh lockup
- Converter apply/release complaints

Note: Requires tool kit F-57917E-TL16 & the VB-FIX reaming fixture.

2 57917E-03K* Lockup Control Plunger Valve & Sleeve Kit

Helps cure:

- TCC apply/release problems
- Converter codes

3 27741-01K Boost Valve Kit

Helps cure:

- Insufficient line rise in drive ranges
- Soft shifts

4 27741-08K Oversized Pressure Regulator & Boost Valve Kit




Helps cure:

- Low/High line pressure
- Soft and/or harsh shifts

Note: Requires tool kit 57917E-TL8.


5 27741-13K Oversized Solenoid Modulator Valve Kit

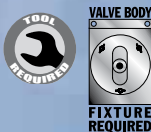

Helps cure:

- Harsh/Flare upshifts
- TCC slip
- RPM cycling

Note: Requires tool kit F-27741-TL13 & the VB-FIX reaming fixture.

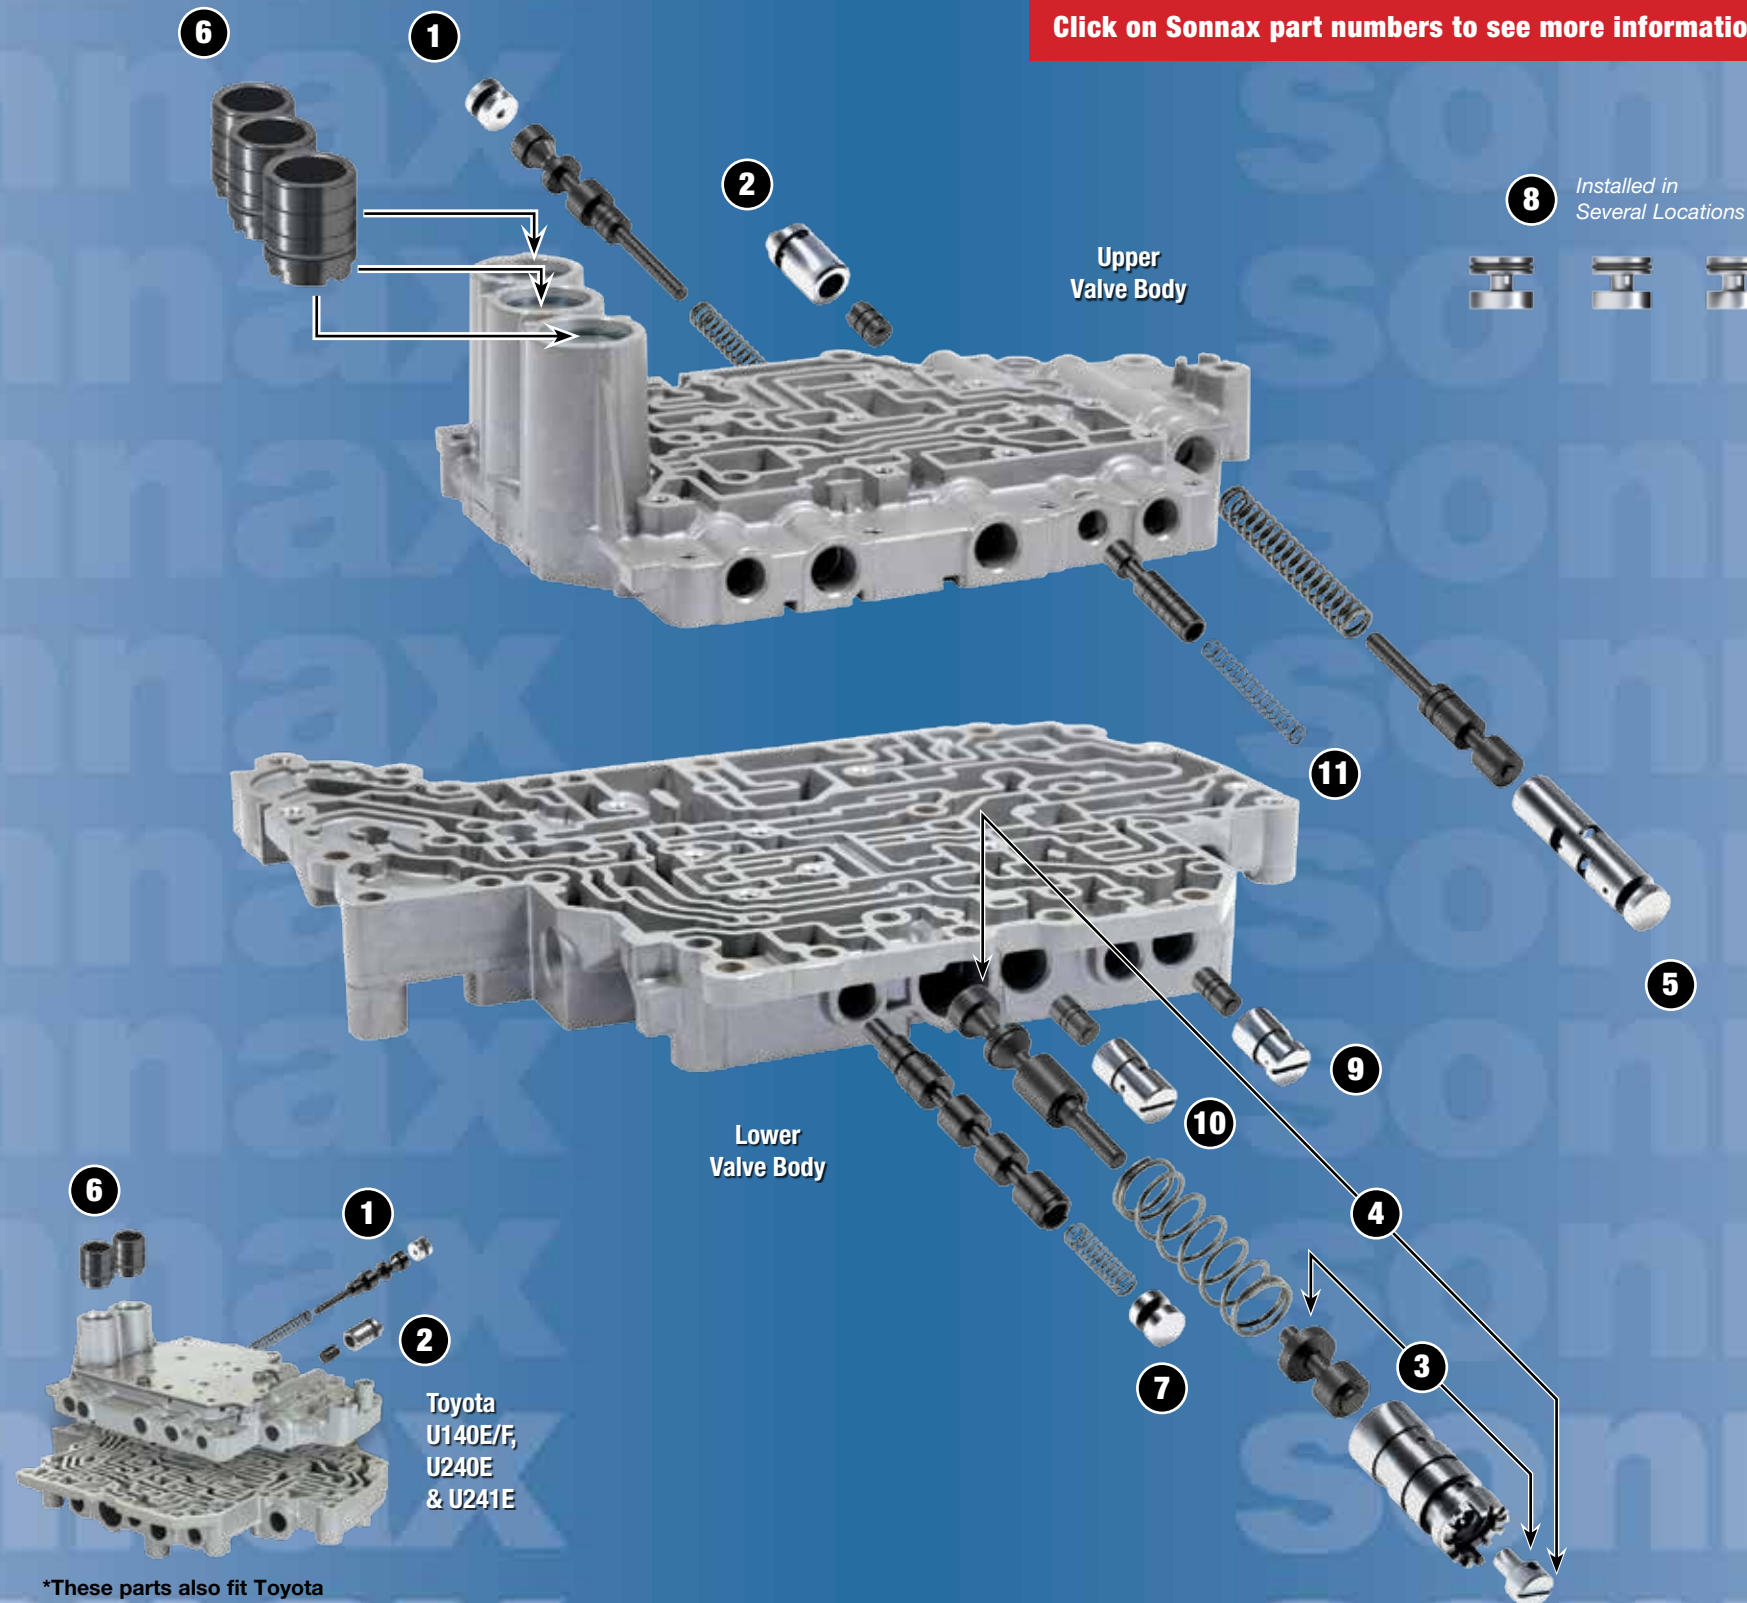

Click on Sonnax part numbers to see more information.

*These parts also fit Toyota U140E/F, U240E & U241E units.


6 57917E-19K* Accumulator Piston Kit

Fits any of 3 locations

Helps cure:

- Delayed engagements
- Slips/Flares in forward gears
- Burnt clutches

7 27741-18K Oversized Clutch Apply Control Valve Kit

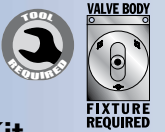

Helps cure:

- Shift flares/bind-ups
- Burned forward/C1 clutch
- Direct/C0 clutch
- 2nd/B1 brake

Note: Requires tool kit F-27741-TL18 & the VB-FIX reaming fixture.

8 57917E-20K* O-Ringed End Plug Kit

Fits 9 locations

Helps cure:

- Inconsistent shift quality
- Slips, flares, bumps, bangs and/or codes
- Clutch failures

9 27741-06K B2 Apply Control Plunger Kit

Helps cure:


- Burned B2 brake/clutch
- Delayed reverse

10 27741-04K B1 Apply Control Plunger Kit

Helps cure:

- Burned B1 brake/clutch
- 2-3 or 4-3 bind-up

11 27741-16K Oversized B3 Orifice Control Valve Kit

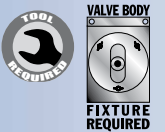

Helps cure:

- Burned UD/B3 brake
- Shift complaints

Note: Requires tool kit F-15741-TL18 & the VB-FIX reaming fixture.