

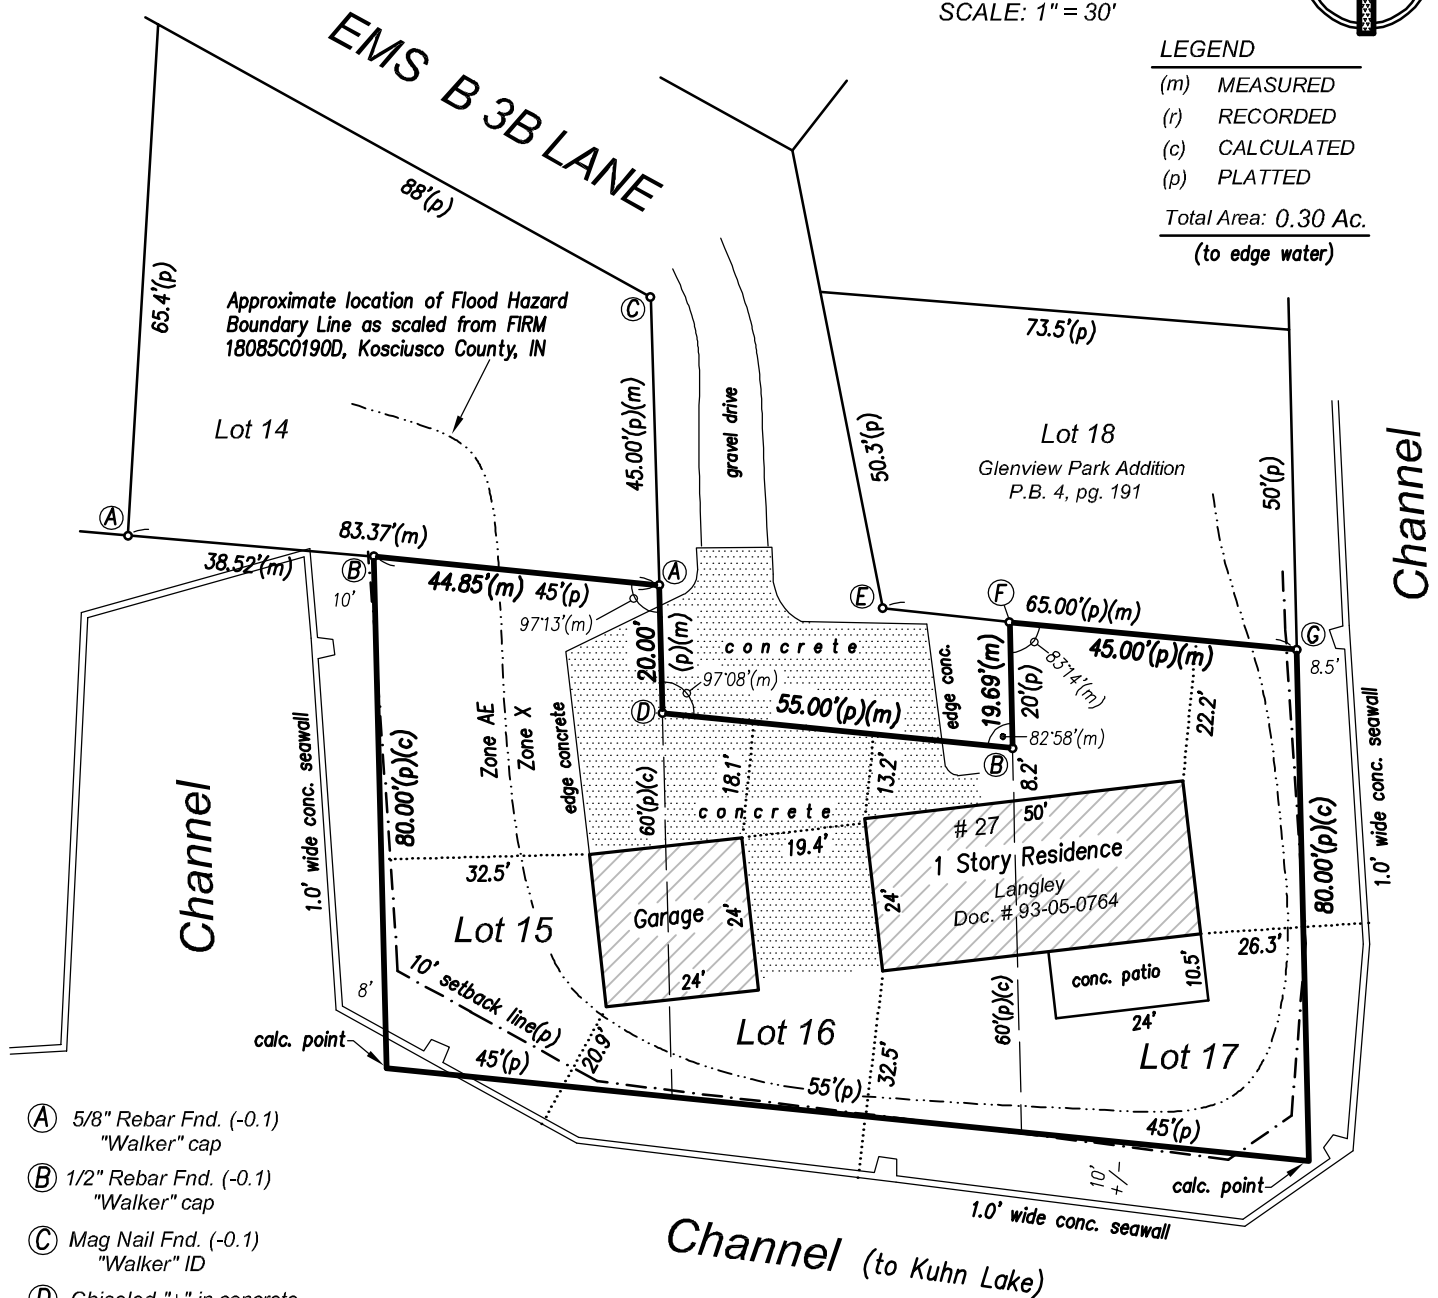




Lots 15, 16 & 17 - Glenview Park Addition
27 EMS B 3B Lane, Leesburg, IN 46538



- (A) 5/8" Rebar Fnd. (-0.1)
"Walker" cap
- (B) 1/2" Rebar Fnd. (-0.1)
"Walker" cap
- (C) Mag Nail Fnd. (-0.1)
"Walker" ID
- (D) Chiseled "+" in concrete
- (E) 1" P. Pipe Fnd. (-0.2)
- (F) 3/4" Pipe Fnd. (-0.5)
- (G) 3/4" Iron Bar Fnd. (-0.3)

Job No.: 20220124

By graphic plotting only and subject to map scale uncertainties, a portion of the real estate described and depicted hereon appears to lie in Zone "AE" (considered a special flood hazard area) on FIRM Map Number 18085C0190D, dated September 30, 2015 for Kosciusco County, Indiana.



**GOULOFF - JORDAN
SURVEYING AND DESIGN, INC.**

1133 BROADWAY FORT WAYNE, IN 46802
PH (260) 424-5362 FAX (260) 424-4916

SURVEYOR'S REPORT

Lots 15, 16 & 17 - Glenview Park Addition
27 EMS B 3B Lane, Leesburg, IN 46538

LEGAL DESCRIPTION - Doc. # 93-05-0764

Lot Numbered Fifteen (15), Sixteen (16) and Seventeen (17) in Glenview Park Addition to Kuhn Lake, Kosciusco County, Indiana, a plat of which is recorded in Plat Book 4, page 191 in the Recorder's Office of Kosciusco County, Indiana.

SURVEYOR'S REPORT

This report and the accompanying survey plat have been prepared in accordance with Title 865, Article 1, Rule 12, Sec 1-29 and all amendments thereto of the Indiana Administrative Code, which establishes the minimum standards for the practice of land surveying.

Monuments set are 5/8 inch round by 24 inch long steel rebars with yellow plastic caps stamped "GOU LS29500017", and set flush with the ground surface.

Monuments found are noted with an above (x.x) or below (-x.x) ground surface dimension.

This purpose for this survey is to "retrace" the boundary of the real estate described hereon.

THEORY OF LOCATION:

The lines and corners for this survey were established as depicted on the survey drawing and per information shown on the plat of Glenview Park Addition and Document Number 93-05-0764 as found in the Office of the Recorder of Kosciusco County, Indiana.

The uncertainty in the lines and corners found or established by this survey are as follows:

(A) Availability and condition of reference monuments:

Monuments found are described and depicted on the survey drawing.

Uncertainty created by the location of the monuments found or set on the subject property due to variations in reference monuments (monuments found on the subject property and on adjacent properties) is the difference between "measured" and "platted" or "recorded" angular or distance measurements as depicted on the survey drawing.

The maximum uncertainty for this survey is 0.31 feet.

(B) Occupation or possession lines:

No uncertainty was created by visible occupation or possession lines.

A 1.0' wide concrete seawall is intended to act as the West, South and East property lines of said real estate as shown on the recorded plat and survey drawing.

(C) Clarity or ambiguity of the record description and or adjoiner's descriptions:

No uncertainty was created by the above mentioned documents.

(D) This survey falls under the classification of a "Suburban" survey. The acceptable relative positional precision (random errors in measurements) = 0.13 feet (40 millimeters) plus 100 parts per million as specified in Section 7 of said Rule 12.

SURVEYOR'S CERTIFICATION

This survey was performed by, or under the responsible direction of the undersigned registered land surveyor and to the best of said registered land surveyor's knowledge and belief, said survey was executed according to the applicable survey requirements of 865 IAC-1-12-1 thru 29.

Field work for this survey was performed on April 28, 2022.

DATED THIS 5th DAY OF MAY, 2022.

Timothy C. Gouloff, R.L.S. 29500017



"I affirm, under the penalties for perjury, that I have taken reasonable care to redact each Social Security Number in this document, unless required by law."
Timothy C. Gouloff

Job No.: 20220124

SHEET 2 OF 2