

Radon Inspection Report

Measurement of Radon Concentration in Indoor Air

Report nr: 2700007402202010160452
Serial nr: 2700007402

Report generated date: 10/16/20 4:52 PM

Measurement Address:
4238 Griffith Avenue
Berkley, Michigan 48072
United States

Measurement performed by:
Matt Mozurkewich
MD Home Inspections, LLC
42807 Ford Rd STE 415
Canton, MI 48187
info@md2inspect.com
USA

Ventilation: Mechanical

Building type: House

Room	Floor	Measurement Start	Measurement End	Measured Value
Basement	Basement	10/14/20 6:51 PM	10/16/20 4:51 PM	4.6 pCi/L

Canton
Location

October 16, 2020
Date



Signature


Detailed Measurement Data

Units	Min	Max	Average
Radon [pCi/L]	1.4	7.1	4.6
Temperature [°F]	63.0	63.7	63.4
Humidity [%rH]	56	63	60
Pressure [kPa]	97.93	99.87	98.93


Radon measurements for hour 1 to hour 46

Hour	Radon [pCi/L]	Hour	Radon [pCi/L]	Hour	Radon [pCi/L]
10/14/20 6:51 PM	1.4	10/15/20 10:51 AM	5.2	10/16/20 2:51 AM	4.8
10/14/20 7:51 PM	3.4	10/15/20 11:51 AM	4.0	10/16/20 3:51 AM	5.9
10/14/20 8:51 PM	2.2	10/15/20 12:51 PM	3.4	10/16/20 4:51 AM	5.9
10/14/20 9:51 PM	3.1	10/15/20 1:51 PM	4.9	10/16/20 5:51 AM	5.9
10/14/20 10:51 PM	1.4	10/15/20 2:51 PM	3.7	10/16/20 6:51 AM	6.2
10/14/20 11:51 PM	2.8	10/15/20 3:51 PM	4.9	10/16/20 7:51 AM	5.9
10/15/20 12:51 AM	2.3	10/15/20 4:51 PM	3.7	10/16/20 8:51 AM	6.8
10/15/20 1:51 AM	1.7	10/15/20 5:51 PM	6.5	10/16/20 9:51 AM	7.1
10/15/20 2:51 AM	2.3	10/15/20 6:51 PM	6.5	10/16/20 10:51 AM	5.3
10/15/20 3:51 AM	2.0	10/15/20 7:51 PM	5.7	10/16/20 11:51 AM	5.6
10/15/20 4:51 AM	3.7	10/15/20 8:51 PM	5.7	10/16/20 12:51 PM	5.1
10/15/20 5:51 AM	4.0	10/15/20 9:51 PM	4.9	10/16/20 1:51 PM	5.9
10/15/20 6:51 AM	6.0	10/15/20 10:51 PM	6.3	10/16/20 2:51 PM	2.5
10/15/20 7:51 AM	3.7	10/15/20 11:51 PM	4.6	10/16/20 3:51 PM	5.9
10/15/20 8:51 AM	3.7	10/16/20 12:51 AM	5.4		
10/15/20 9:51 AM	5.7	10/16/20 1:51 AM	5.7		

MD
Home Inspections, LLC

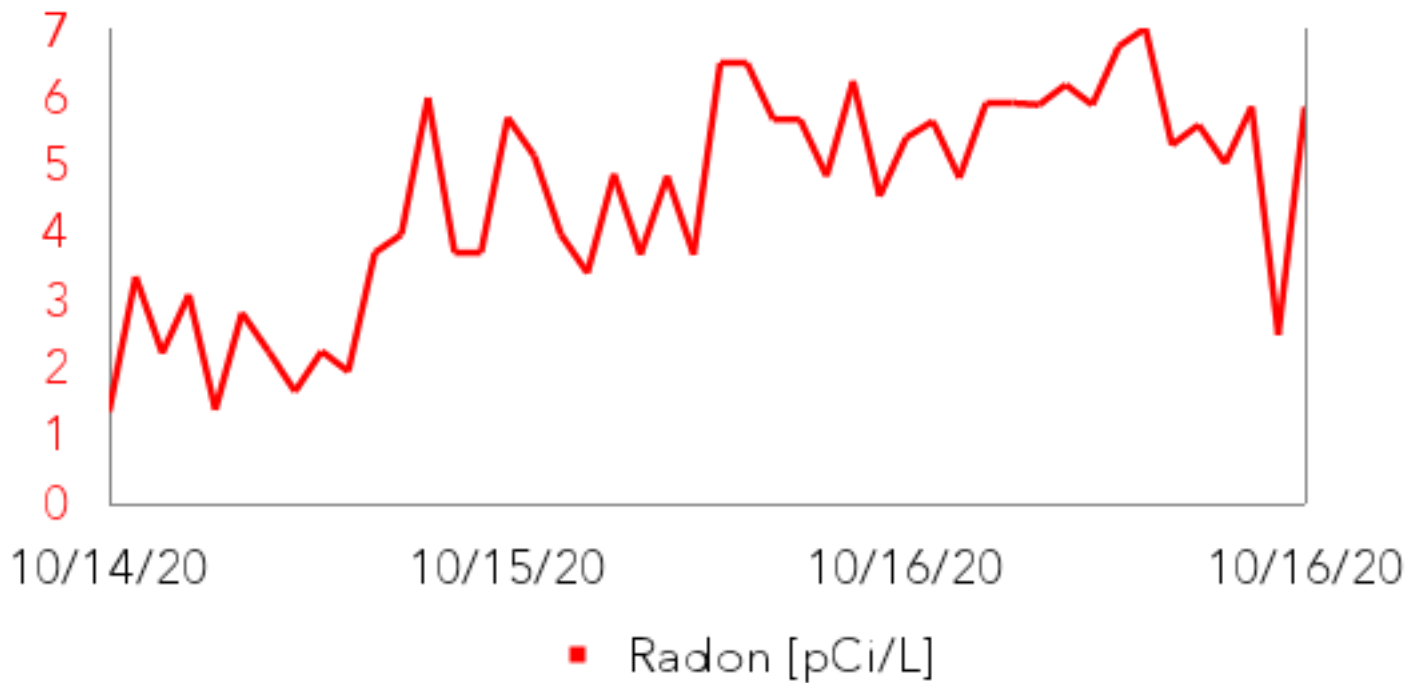

Humidity and Temperature Chart

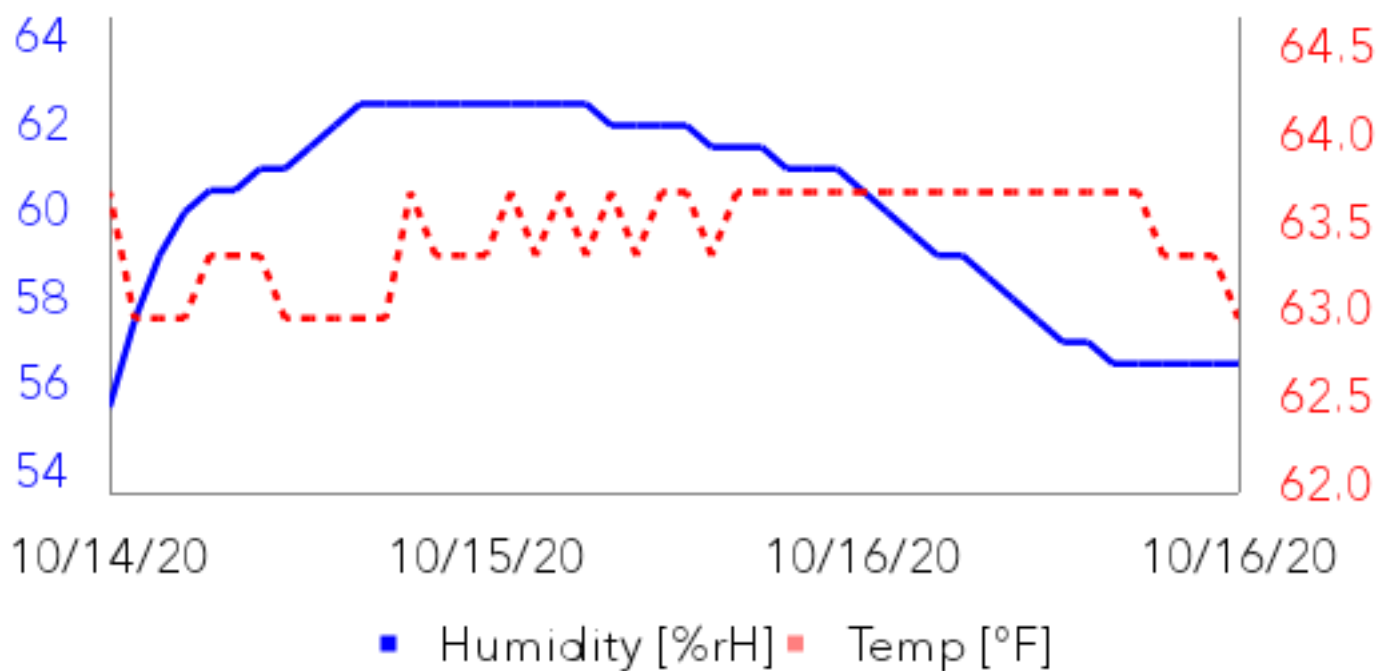

Pressure Chart

